Ford Motor Company

A. R. O'Neill
Director
Vehicle Service and Programs
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

December 2001

To:
All Ford and Lincoln Mercury Dealers

Subject:
Owner Notification Programs 97M91 and 01M02: PARTS UPDATE

References:

Owner Notification Program 01M02: Additional Coverage on Certain 4.6L SOHC Intake Manifolds Installed on certain 1996-2001 Crown Victoria Taxis, Police cars and Lincoln Town Car Limousine and Livery cars
Owner Notification Program 97M91: Certain 1996-1998 Crown Victoria Taxis, Town Car Limo Prep & Livery Packages, 1996-1997 Thunderbird, Cougar and Mustang Vehicles Equipped With 4.6L SOHC Engines- Intake Manifold Additional Coverage

The intake manifolds specified in the subject programs have been obsoleted. Please consult the chart below to determine part requirements.

MODEL YEAR	MODELS	OLD INTAKE MANIFOLD PART #	NEW INTAKE MANIFOLD
1996 – 1997 1996 - 1998	Thunderbird, Cougar Mustang	F8AZ-9424-BC*	F6SZ-9424-AA
1999 - 2001	Mustang	1L2Z-9424-DA*	1R3Z-9424-AAA
1996 - 1997	Crown Victoria, Grand Marquis, Town Car - *All*	F8AZ-9424-BC*	F8AZ-9424-AAA
1998 - 2000	Crown Victoria, Grand Marquis, Town Car: *Police, Limosine Vehicles*	F8AZ-9424-BC*	F8AZ-9424-CA
1998 - 2000	Crown Victoria, Grand Marquis, Town Car: *Retail Vehicles*	F8AZ-9424-BC*	F8AZ-9424-BAA
2001	Crown Victoria, Grand Marquis, Town Car: *Police, Limosine Vehicles*	1L2Z-9424-DA*	1W7Z-9424-BA
2001	Crown Victoria, Grand Marquis, Town Car: *Retail vehicles*	1L2Z-9424-DA*	1W7Z-9424-AAA

* indicates the Obsolete Intake Manifold – DO NOT ORDER

Ford Motor Company

A.R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

May 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 01M02 Supplement #1: Additional Coverage on Certain 4.6L SOHC Intake Manifolds Installed in the Following Vehicles:

- Certain 1996 through 2001 Model Year Crown Victoria Police Interceptor
- Certain 1998 through 2001 Model Year Crown Victoria with Taxi Prep Package
- Certain 1998 through 2001 Lincoln Town Car Limousine and Livery Prep Package

REFERENCE: Owner Notification Program 01M02: Additional Coverage on Certain 4.6L SOHC Intake Manifolds Installed on certain 1996-2001 Crown Victoria Taxis, Police cars and Lincoln Town Car Limousine and Livery cars.

PROGRAM TERMS: This additional coverage program will be in effect for 7 years from the warranty start date, regardless of mileage.

VEHICLES COVERED BY THIS PROGRAM

- Certain 1996 through 1997 Crown Victoria Police Interceptor Vehicles with 4.6L SOHC engines built at the St. Thomas Assembly Plant from the beginning of production for the 1996 Model Year through January 28, 1997
- Certain 1998 through 2001 Crown Victoria Police Interceptor Vehicles with 4.6L SOHC engines built at the St. Thomas Assembly Plant from November 22, 1997 through December 15, 2000
- Certain 1998 through 2001 Crown Victoria Taxi Vehicles with 4.6L SOHC engines built at the St. Thomas Assembly Plant from November 22, 1997 through December 15, 2000
- Certain 1998 through 2001 Lincoln Town Car Limousine Prep Package and Livery Vehicles with 4.6L SOHC engines built at the Wixom Assembly Plant from November 22, 1997 through December 15, 2000

REASON FOR SUPPLEMENT

This supplement revises the part number applications for 2001 model year vehicles. See Attachment II, page 1 of 2.

REASON FOR PROVIDING ADDITIONAL COVERAGE

Some of the composite intake manifolds used on 4.6L SOHC engines may develop fatigue cracks at the coolant crossover duct. This condition could result in engine coolant leakage

which, if not serviced, may cause engine overheating. Complete loss of coolant may result in engine damage or engine failure.

SERVICE ACTION

If an intake manifold coolant leak is detected, the dealer will replace the intake manifold. Owners of the affected cars are being notified that additional coverage for this specific condition is being provided. The coverage will be for 7 years from the warranty start date of the vehicle (no mileage limitation). This additional coverage is automatically transferred to subsequent owners.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……1-800-423-8851
Other Special Service Support Center Questions:……. -800-325-5621

Sincerely,

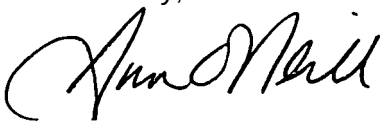

Ann O'Neill
Director
Vehicle Service and Programs

OWNER NOTIFICATION PROGRAM 01M02-Supplement #1
Additional Coverage on Certain 4.6L SOHC Intake Manifolds Installed In:
- Certain 1996 through 2001 Model Year Crown Victoria Police Interceptor
- Certain 1998 through 2001 Model Year Crown Victoria with Taxi Prep Package
- Certain 1998 through 2001 Lincoln Town Car Limousine and Livery Prep Package

OASIS

You must use OASIS to determine if a vehicle is eligible for this program.

NOTE: On an "M" program, the VIN number will remain in OASIS until the time limit of the program expires.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer.) Refer to ACESII manual for refund information.

Program Code:	01M02
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

Refer to ACESII manual for refund information.

RENTAL CARS

Rental vehicle coverage is not included under this program.

OWNER NOTIFICATION PROGRAM 01M02- Supplement #1
Additional Coverage on Certain 4.6L SOHC Intake Manifolds Installed In:
- Certain 1996 through 2001 Model Year Crown Victoria Police Interceptor
- Certain 1998 through 2001 Model Year Crown Victoria with Taxi Prep Package
- Certain 1998 through 2001 Lincoln Town Car Limousine and Livery Prep Package

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Inspect Intake Manifold Assembly and Return Vehicle to Owner	01M02A	0.2 Hours
Inspect Intake Manifold and Replace the Manifold (1996 through 1997 Crown Victoria)	01M02B	3.4 hours
Inspect Intake Manifold and Replace the Manifold (1998 through 2001 Town Car)	01M02C	3.1 Hours
Inspect Intake Manifold and Replace the Manifold (1998 through 2001 Crown Victoria)	01M02D	3.1 Hours

PLEASE NOTE: The labor times in the above table reflect the latest corporate standards for determining labor times. These times apply to Owner Notification Program 01M02 and are not retroactive to previous repairs.

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this program. Order your parts requirement through normal order processing channels as noted below:

Stock Orders	Effective immediately	Normal order process
Interim Orders	Effective immediately	Normal order process
Emergency Orders	First 30 days after launch	Call 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

Part Number	Description	Quantity
F8AZ-9424-BC	Manifold Assembly, Engine Intake (1996 through 2000 Model Years)	1
XW7Z-9439-AA	Gasket, Intake Manifold (1996 through 2000 Model Years)	2
1L2Z-9424-DA	Manifold Assembly, Engine Intake (2001 Model Year only)	1
YL3Z-9439-BA	Gasket, Intake Manifold (2001 Model Year only)	2

DOR/COR NUMBER

DOR/COR Number 50218 identifies parts ordered for this campaign through the Special Service Support Center (1-800-325-5621).

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673
www.ownerconnection.com

Your Vehicle Identification Number: 12345678901234567

March 2001

01M02

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Ford Motor Company is providing a no-charge service, Program Number 01M02, to owners of certain 1996 through 2001 Crown Victoria Police Interceptor vehicles, certain 1998 through 2001 Model Year Crown Victoria Taxis and certain 1998 through 2001 Lincoln Town Car Limousine and Livery Package vehicles with 4.6L SOHC engines. This service program provides additional coverage for the intake manifold.

Reason For This Additional Coverage Program…

A fatigue crack may develop in the composite intake manifold used on the 4.6L SOHC engines installed in your vehicle. This condition may result in engine coolant leakage, which, if not serviced, may cause engine overheating. Complete loss of coolant may result in engine damage or engine failure.

What *Ford Motor Company* and your dealer will do…

If the engine of your car should develop a coolant leak at the intake manifold crossover coolant passage, located directly behind the alternator, your dealer will verify the condition. If the coolant leakage is from the location described above, your dealer will replace the engine intake manifold assembly free of charge.

This no-charge coverage is available for 7 years from the vehicle's warranty start date (no mileage limitation) and is automatically transferred to subsequent owners.

How long will it take…

The time needed for this repair is less than one day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period of time.

What we are asking you to do…

PLEASE KEEP THIS LETTER. If your car's engine intake manifold should exhibit the condition described above within the 7 year coverage period, contact your dealer. Show the dealer this letter. The dealer will replace the intake manifold assembly after verification of this specific condition. If you lose this letter the dealer will still honor the provisions of this program.

If you've already paid for this service…

If you paid to have the engine intake manifold replaced due to a leak at the cross over coolant passage before the date of this letter, Ford Motor Company is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have questions…

If you have questions, please contact us through the Internet at *www.ownerconnection.com* Our current response time to Internet inquiries is three business days.

You may also the Ford Motor Company North American Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (866) 436-7332
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: 8am - 11pm Monday through Friday and 9am - 6pm Saturday (Eastern Time)


Quality Care service is there for you all year round.

QualityCare at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. We stand committed with our Ford and Lincoln Mercury dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We are taking this action as part of our ongoing effort to maintain owner confidence in our products. We hope this program will confirm your continued satisfaction in your Ford built vehicle.

Sincerely,

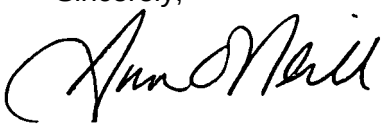

Ann O'Neill
Director
Vehicle Service and Programs