- **DRIVEABILITY—DETONATION OR SPARK KNOCK ON HEAVY ACCELERATION—MUSTANG BULLITT GT VEHICLES ONLY**
- **ENGINE—4.6L 2 VALVE—DETONATION OR SPARK KNOCK ON HEAVY ACCELERATION—MUSTANG BULLITT GT VEHICLES ONLY**

Article No. 01-12-3

FORD: 2001 MUSTANG

ISSUE

Some Mustang Bullitt GT vehicles may exhibit a detonation (spark knock) on heavy acceleration that can occur at any RPM. This may be caused by the calibration of the Powertrain Control Module (PCM).


ACTION

Verify condition. If normal diagnostics cannot pinpoint the condition, Reprogram the PCM to latest level calibration. Refer to the following PCM Calibration Information chart.

SERVICE INFORMATION

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
2001 Mustang Bullitt GTs only	1R3A-AB	KSG1	1R3Z-AC	1ZE2GB0505	1ZE2GB0510	WDS B13.2 Release or Later

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

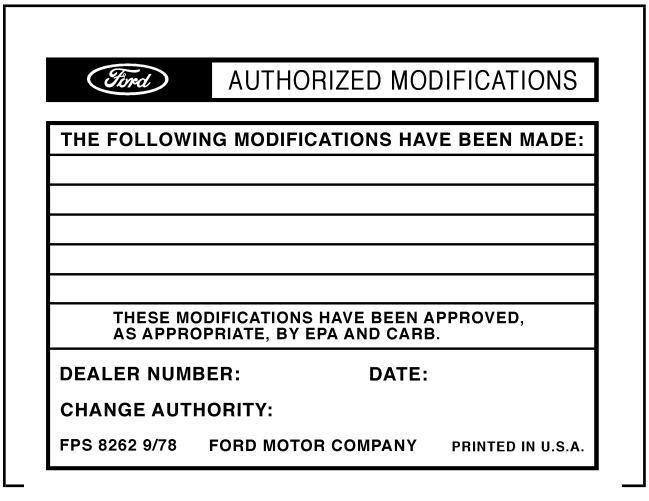

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 615000, 615500

Copyright © 2001 Ford Motor Company