FRONT CRASH SENSOR INSPECTION AND REPLACEMENT

AFFECTED VEHICLES: CERTAIN 2001 MODEL YEAR TOWN CAR AND WINDSTAR

OVERVIEW

Vehicles in this program may require replacement of the front crash sensor. The serial number of the sensor must be matched against the list of affected sensors to determine if replacement is required. The serial number is on the bar code label located on the sensor. The sensor in Windstar vehicles is located in the engine compartment and visible without the removal of any components. However, the sensor on the Town Car must be removed from the vehicle to properly view the serial number. This procedure gives you detail for inspecting the serial number and refers you to the Workshop Manual for instruction on replacement of the sensor.

SERVICE PROCEDURE

WINDSTAR

1. NOTE: If the front crash sensor is replaced, mutilate and discard the original sensor to prevent it from being installed on another vehicle.

   Locate the front crash sensor on the back of the radiator support and record the serial number. Refer to Figure 1.

   - If the serial number is listed in the Affected Serial Number Chart on Page 4, replace the front crash sensor. Refer to the service procedure in section 501-20B in the appropriate Workshop Manual.
   - If the serial number is **NOT** listed in the Affected Serial Number Chart on Page 4, replacement of the front crash sensor is not required, the vehicle may be released.

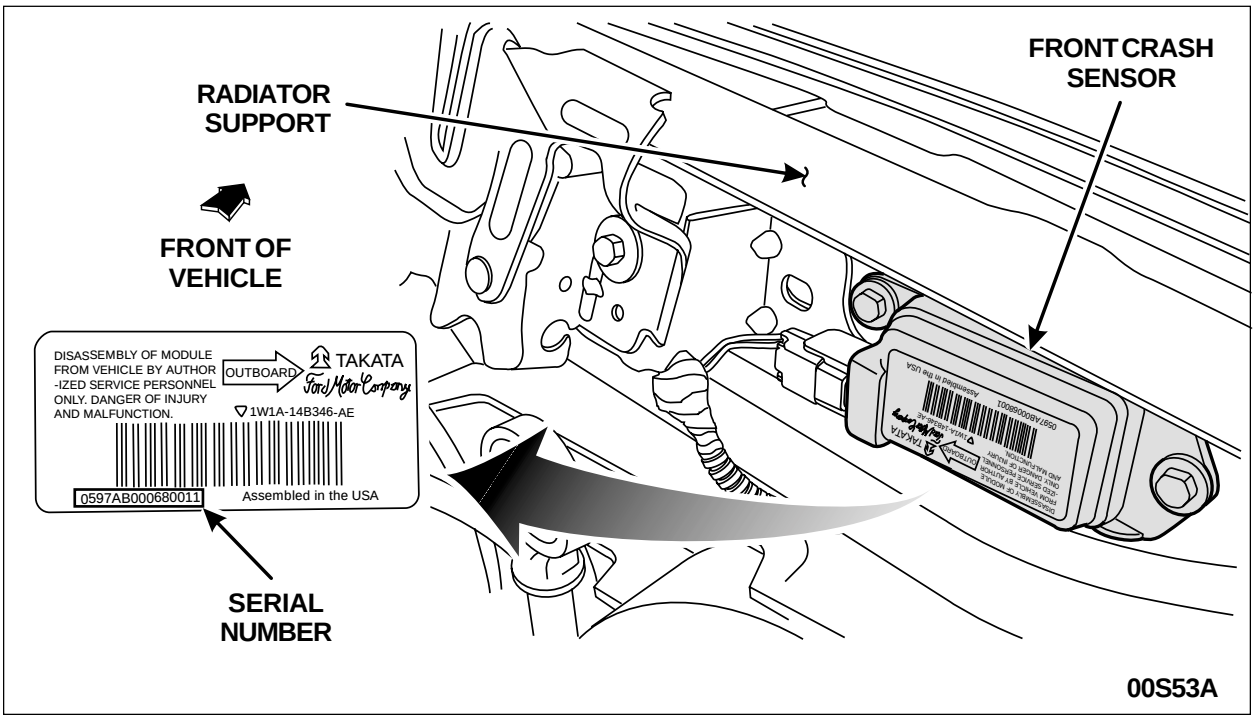


FIGURE 1

Ford Motor Company
CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
12/00

TOWN CAR

1. Perform a system prove out as follows. Turn the key to the “RUN” position, then observe the airbag indicator lamp on the instrument cluster for one (1) minute. The lamp should remain lit for six (6) seconds and then go out.
   - If the light remains out, no fault codes are present, continue procedure.
   - If the lamp fails to light for the initial six (6) seconds or remains lit (continuous or flashing), fault code(s) are present. Perform the applicable diagnostic and repair procedures in section 501-20B of the appropriate Workshop Manual before continuing with the procedure. If this vehicle is no longer under warranty, please call the Recall Hotline (1-800-325-5621) for direction.
2. Turn the key to the “OFF” position.
3. Disconnect the battery ground cable. Wait at least one minute for the backup power supply in the restraints control module (RCM) to deplete its stored energy.
4. Remove the radiator sight shield to access the front crash sensor.
5. Disconnect the front crash sensor, then unbolt the sensor from the radiator support.
6. NOTE: If the front crash sensor is replaced, mutilate and discard the original sensor to prevent it from being installed on another vehicle.

   Record the serial number on the front crash sensor. See Figure 2.
   - If the serial number is listed in the Affected Serial Number Chart on page 4, replacement of the front crash sensor is required. Discard the sensor and install a ***new*** one. Refer to the service procedure in section 501-20B in the appropriate Workshop Manual.
   - If the serial number is **NOT** listed in the Affected Serial Number Chart on page 4, replacement of the front crash sensor is not required. Proceed with this procedure.

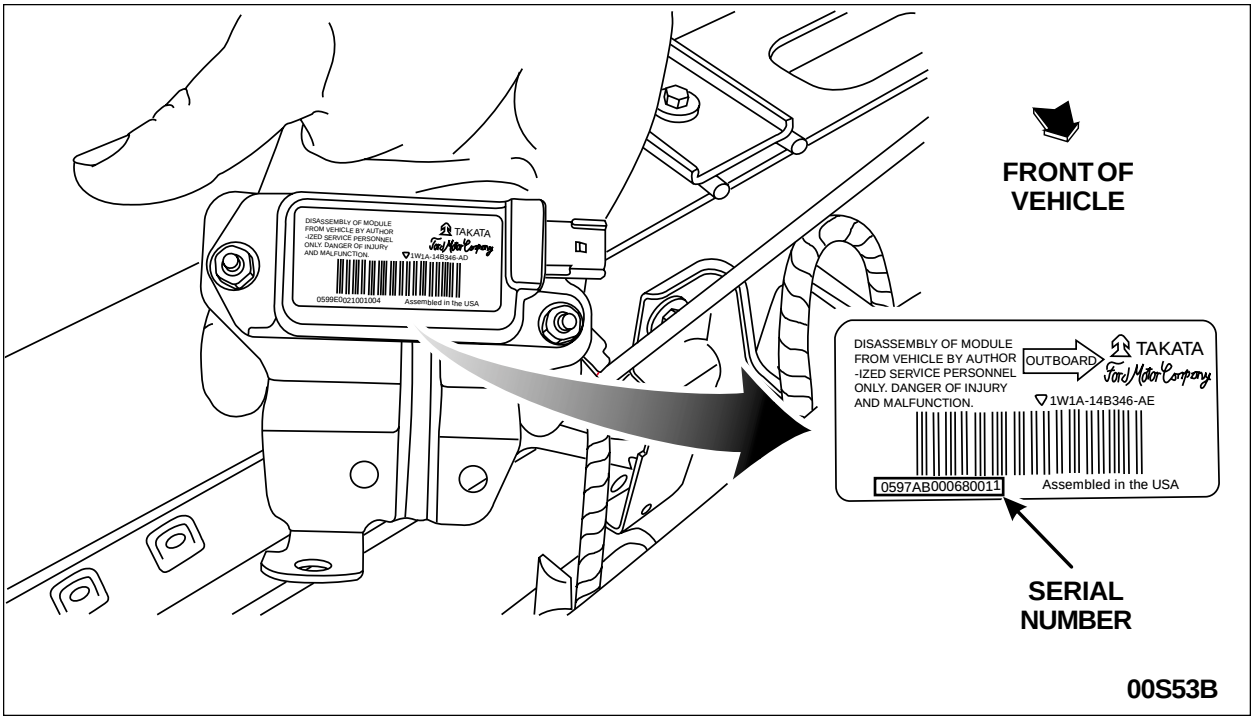


FIGURE 2

Ford Motor Company

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
12/00

7. Install and connect the original front crash sensor. Tighten the bolts to 12 Nm (9 lb-ft).
8. Install the radiator sight shield.
9. Connect the battery ground cable.
10. Repeat the system prove out as described in step 1.

Ford Motor Company
CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
12/00

AFFECTED FRONT CRASH SENSOR SERIAL NUMBER CHART

Replace only front crash sensors that have the following serial numbers located on the barcode label.

Town Car	**Windstar**	
8599EA002490350	8600EA002501748	8600EB002503311
" A002490351	" A002503399	" B002503328
" A002490362	" A002503400	" B002503329
" A002490367	" A002503406	" B002503331
" A002490369	" A002503407	" B002503851
" A002492215	" B002461529	" B002503852
" A002492217	" B002462557	" B002503918
" A002492218	" B002462562	" B002503985
" A002492219	" B002462563	" B002503986
" A002492220	" B002462720	" B002503995
" A002492239	" B002462889	" B002503996
" A002493012	" B002472474	" B002560520
" A002493044	" B002472475	" B002560626
" A002493352	" B002472479	" B002560627
" A002493357	" B002472511	" B002560628
" A002493358	" B002472594	" B002560630
" A002502285	" B002472599	" B002560632
" A002502290	" B002472600	" B002560633
" A002550038	" B002472619	" B002560634
" A002551348	" B002472623	" B002560651
" A002551437	" B002472624	" B002560659
" A002551438	" B002472657	" B002560781
" A002551439	" B002472926	" B002560782
" B002500811	" B002472927	" B002560792
" B002501795	" B002472928	" B002560799
" C002590178	" B002493275	" B002560899
" C002590234	" B002493276	" C002473555
" C002590477	" B002500687	" C002473718
" C002591626	" B002500690	" C002473719
	" B002502961	" C002473787

Ford Motor Company

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
12/00