POWERTRAIN CONTROL MODULE (PCM) REPROGRAM

AFFECTED VEHICLES: **CERTAIN 2001-2002 MODEL YEAR RANGER EQUIPPED WITH A 2.3L ENGINE**

SERVICE PROCEDURE

1. **NOTE: If you determine that the existing PCM calibration is already at the *new* level (or later) according to the chart, no reprogramming is necessary.**

   Identify the existing PCM calibration, then reprogram the PCM to the ***new*** calibration found in the applicable chart below. Use one (1) of the following two (2) methods:

   - Worldwide Diagnostic System (WDS), with the software level indicated in the chart.
   - New Generation STAR (NGS) Tester with Rotunda Flash Cable (007-00531) and Rotunda Flash Card (007-00532). The calibration must be downloaded to a flash card using WDS with the software level indicated in the chart.

2001-2002 MODEL YEAR PCM REPROGRAM CHART

Existing PCM Calibration	Existing PCM Part No.	Existing Catch word	NEW PCM Calibration	NEW PCM Part No.	NEW Catch word	Current Fordstar/PTS Version or Newer	Current CD WDS Version or Newer
1R31A20510	12A650-ASE	OMN0 OMN1 OMN2 OMN3 OMN4	1R31A20511	12A650-ASF	OMN5	B18.7	B19
1R32B20511	12A650-APF	VCH0 VCH1 VCH2 VCH3 VCH4 VCH5	1R32B20512	12A650-APG	VCH6	B18.7	B19
1R32A20511	12A650-ANF	VRK0 VRK1 VRK2 VRK3 VRK4 VRK5	1R32A20512	12A650-ANG	VRK6	B18.7	B19
1R32B20M11	12A650-AMF	MGF1 MGF2 MGF3 MGF4 MGF5	1R32B20M12	12A650-AMG	MGF6	B18.7	B19
1R32A20M11	12A650-ALF	KVK1 KVK2 KVK3 KVK4 KVK5	1R32A20M12	12A650-ALG	KVK6	B18.7	B19

Ford Motor Company

CPR © 2002 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/02

PREPARE AUTHORIZED MODIFICATIONS LABEL

1. Obtain and prepare the Authorized Modifications label. Write the modification completed, your P&A code, date of repair and the program number in the spaces provided on the label. See Figure 1.

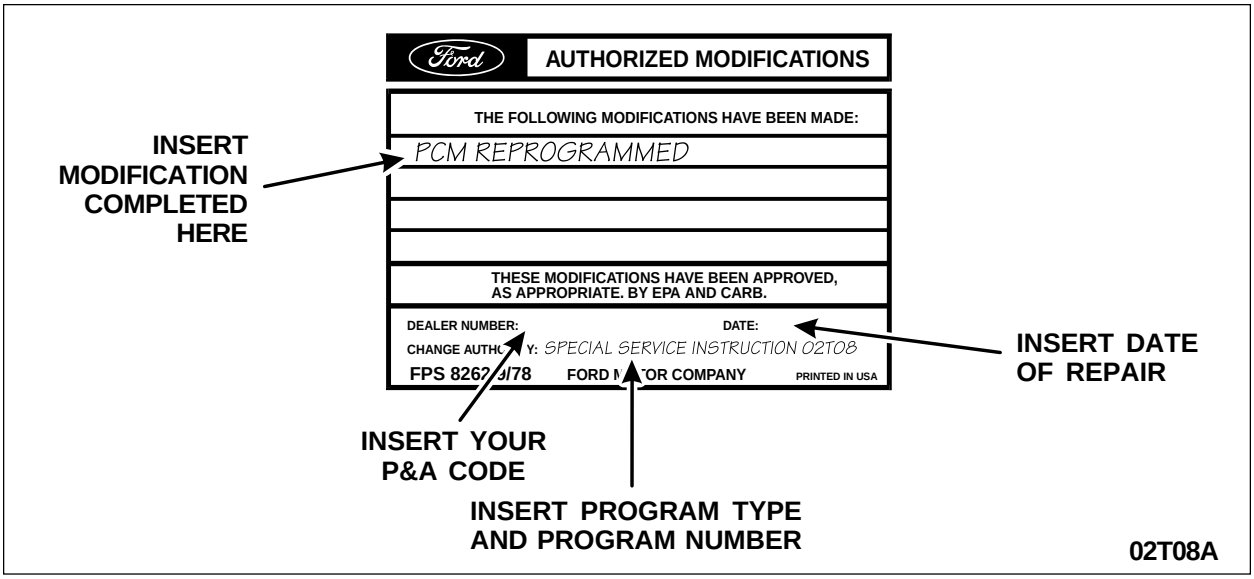

FIGURE 1

2. Open the hood and clean an area on the radiator support with isopropyl alcohol and a clean cloth.
3. Apply the label to the clean area.

Ford Motor Company
CPR © 2002 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/02