• **TRANSMISSION—4R70W—200-400 ENGINE RPM RISE DURING LIGHT THROTTLE 3-4 SHIFTS** • **TRANSMISSION—4R70W—FLASHING TRANSMISSION CONTROL INDICATOR LIGHT (TCIL)—DIAGNOSTIC TROUBLE CODE (DTC) P0782 STORED IN MEMORY**	**Article No. 00-25-1**

FORD: 2001 CROWN VICTORIA

LINCOLN: 2001 TOWN CAR

MERCURY: 2001 GRAND MARQUIS

ISSUE

Some vehicles may exhibit a flashing Transmission Control Indicator Light (TCIL) with Diagnostic Trouble Code (DTC) P0782 stored in memory and/or a 200-400 engine rpm rise during light throttle 3-4 shifts. This may be due to the Powertrain Control Module (PCM) calibration.

ACTION

If the calibration is not at the latest level, reprogram the PCM to the latest calibration level. To verify repair, complete the Transmission Drive Cycle Test per the Diagnosis and Testing Section of the appropriate model Workshop Manual. If the condition is not corrected after reprogramming the PCM, continue with normal diagnostics and repair per the appropriate model Workshop Manual. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Prior to performing any Service Procedures, verify tear tag and PCM information. Refer to the PCM Calibration chart in this article.

NOTE

IF THE VEHICLE AND AXLE RATIO ARE NOT LISTED IN THE APPLICATION CHART, REPROGRAMMING THE PCM WILL NOT CORRECT THE CONDITION. FOLLOW NORMAL DIAGNOSTIC PROCEDURES PER THE WORKSHOP MANUAL.

Copyright © 2000 Ford Motor Company

Article No. 00-25-1 Cont'd.

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
Crown Victoria/Grand Marquis - Mexico - 2.73 Axle	1W7F-FE	CTW4	1W7Z-FF	1FB1GX0M08	1FB1GX0M10	...
Crown Victoria/Grand Marquis - 2.73 Axle	1W7F-CE	RFRx	1W7Z-CF	1FB1GB0508	1FB1GB0510	1FB1GB05 CALIBRATION
Crown Victoria/Grand Marquis - Gulf Coast Countries (GCC) - 3.08 Axle	1W7F-HC	XAY2	1W7Z-HD	1FB1GX0G06	1FB1GX0G10	...
Crown Victoria - Gulf Coast Countries (GCC) Police - 3.08 Axle	1W7F-JC	GWE2	1W7Z-JD	1FB1GP0G06	1FB1GP0G10	...
Crown Victoria - Police - 3.27 Axle	1W7F-EE	BXT5	1W7Z-EG	1FBLGP0508	1FBLGP0510	1FB1GP05 CALIBRATION
Crown Victoria - Handling Package - 3.55 Axle	1W7F-DE	NHT4	1W7Z-DF	1FBLGH0508	1FBLGH0510	1FB1GH05 CALIBRATION
Town Car - 3.08 Axle	1W1F-AE	KMEx	1W1Z-AF	1VC1SB0508	1VC1SB0510	1VC1SB05 CALIBRATION
Town Car - Handling Package - 3.55 Axle	1W1F-BE	LWTx	1W1Z-BF	1VC1LH0508	1VC1LH0510	1VC1LH05 CALIBRATION
Town Car - Gulf Coast Countries (GCC) - 3.08 Axle	1W1F-CC	NNIx	1W1Z-CD	1VC1TX0G06	1VC1TX0G10	...

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

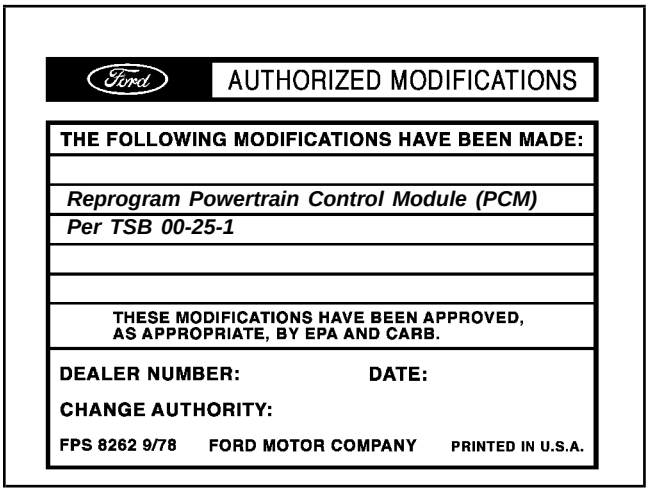

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 501000, 502000, 504000