Ford Motor Company

Ann O'Neill
Director
Vehicle Service and Programs
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

August 2000

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 00B49: Certain 1999 and 2000 Model Year Ranger-EV Vehicles – PTC Heater Control Inspection

OASIS : Yes
OWNER LIST: Yes
PARTS RETURN: Yes
PROGRAM TERMS: This program will be in effect until August 31, 2001, regardless of mileage.

AFFECTED DEALERS

All authorized Electric Vehicle (EV) dealers.

AFFECTED VEHICLES

Certain 1999 and 2000 model year Ranger-EV vehicles built at the EV Final Assembly Plant from June 1, 1999 through February 1, 2000. Approximately 400 vehicles are affected.

REASON FOR PROGRAM

In some of the affected vehicles, the Positive Temperature Coefficient (PTC) Heater Control Module may fail. The first symptom is that the customer will not be able to turn off the heater. However, the temperature control function will still operate normally. The vehicle performance and handling are not affected.

During the next key-on cycle, the vehicle and all auxiliary loads will be disabled. If the customer makes repeated attempts to start the vehicle, a burning smell along with smoke emitting from the underbody (battery pack) area, will alert the driver of a system malfunction. When the vehicle key is turned-off, no further damage is possible -- in all cases, power is interrupted and any damage is entirely contained within the battery pack.

During normal operation, the 12-volt auxiliary battery is constantly being recharged during drive. In the unlikely scenario where the auxiliary battery state of charge is low after a drive, and the customer puts the vehicle on-charge immediately after the drive (during which time the PTC module has failed), the Interface Adapter Assembly (IAA) will attempt to recharge the auxiliary battery. Under this condition, severe damage to the contactor module and the battery pack is likely to occur.

SERVICE ACTION

The PTC module (located under hood) of the affected vehicles must be inspected for a specific serial number. If the first three digits of the serial number start with "GD7xxxx", then the PTC module must be replaced. Otherwise, the vehicle is not affected by this Owner Notification Program. We are asking that the customer perform this inspection; however, the customer may elect to have this inspection performed by a dealership.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Letter and Inspection Instructions

QUESTIONS?

Claims Information: 1-800-423-8851
Other Program Questions: 1-800-325-5621

Sincerely,

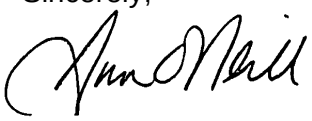

Ann O'Neill
Director
Vehicle Service and Programs

Owner Notification Program 00B49
Certain 1999 and 2000 Model Year Ranger-EV
PTC Heater Control Inspection

OASIS

You must use OASIS to determine if a vehicle is eligible for this program.

PLEASE NOTE

Correct all affected vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on the enclosed list and other eligible vehicles which are brought to your dealership.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will refund owner-paid repairs only if made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

Program Code:	00B49
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

RENTAL CARS

Ford Motor Company will pay for a rental vehicle, for a maximum of seven (7) days, except for fuel, which will be at the owner's expense. Enter the word "LOANER" plus the number of days the vehicle was used in the Miscellaneous Expense area.

Owner Notification Program 00B49
Certain 1999 and 2000 Model Year Ranger-EV
PTC Heater Control Inspection

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Inspect PTC Module Serial Number	00B49A	0.2 Hours
Replace PTC Module	00B49B	0.4 Hours

PARTS REQUIREMENTS

Parts Ordering Information

Parts ordering controls will be in effect for this recall until November 15th, 2000. Dealers must call 1-800-248-0186 and provide the VIN number of each affected vehicle.

Part Number	*Description*	*Quantity*
F8YZ-14B316-BA	PTC Heater Control Module	1

ORDER INFORMATION DOR/COR

DOR/COR number 50169 identifies parts ordered for this campaign through the Recall Hotline (1-800-248-0186).

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

00B49 August 2000

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Ford Motor Company is providing a no-charge service, Program Number 00B49, to owners of certain 1999 and 2000 model year Ranger-EV vehicles.

Reason For This Program …

In some of the affected vehicles, the Positive Temperature Coefficient (PTC) Heater Control Module may fail. The first symptom is that you will not be able to turn off the heater. However, the temperature control function will still operate normally. The vehicle performance and handling are not affected.

During the next key-on cycle, repeated attempts to start the vehicle may result in a burning smell (and possibly smoke) emitting from the underbody (battery pack) area, alerting you of a system malfunction. When the vehicle key is turned-off, no further damage is possible.

What *Ford Motor Company* and your dealer will do…

The PTC module of the affected vehicles must be inspected for a specific serial number. If the first three digits of the serial number start with "GD7xxxx", Ford Motor Company will replace the PTC module at no cost to you.

This program will be in effect until August 31, 2001, regardless of mileage.

What we are asking you to do…

Please inspect your PTC module serial number, or if you wish, have the dealer do it for you.

If the serial number starts with a "GD7xxx":

- Call your nearest EV-dealer
- Provide the dealer with your Vehicle Identification Number (located at the beginning of this letter).
- Ask for a service date and whether parts are in stock for Owner Notification Program 00B49.

If the serial number does NOT start with "GD7xxx":

Your PTC Module is okay (not affected by this program) and we apologize for this inconvenience.

How long will it take…

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns…

If you have trouble getting your vehicle repaired promptly and without charge, please contact the Ford Motor Company Customer Assistance Center and one of our representatives will be happy to assist you:

Call: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8am - 11pm

Saturday: 9am - 6pm

or you may contact us through the Internet at:
www.ownerconnection.com

Our current response time to Internet inquiries is three business days.


Quality Care service is there for you all year round.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs

RANGER EV POSITIVE TEMPERATURE COEFFICIENT (PTC) SWITCHING MODULE INSPECTION

AFFECTED VEHICLES: CERTAIN 1999 AND 2000 MODEL YEAR RANGER EV

INSPECTION

1. Open hood and locate part number/serial number tag on the back of the positive temperature coefficient (PTC) switching module. (The tag may be upside down, but is still visible). See Figure 1.

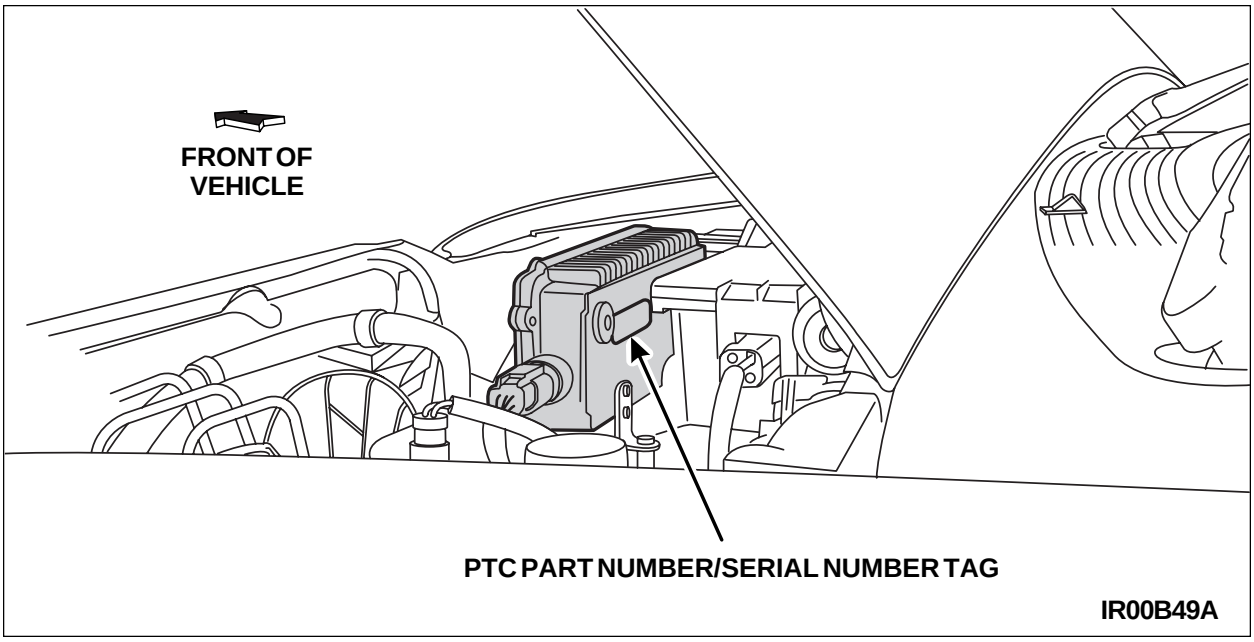


FIGURE 1

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
07/00

2. Check the first three (3) digits of the serial number on the tag. See Figure 2. If it is GD7, the PTC must be replaced by an authorized Electric Vehicle (EV) dealer. If the serial number begins with anything other than GD7, no further action is required and the vehicle may be released for service.

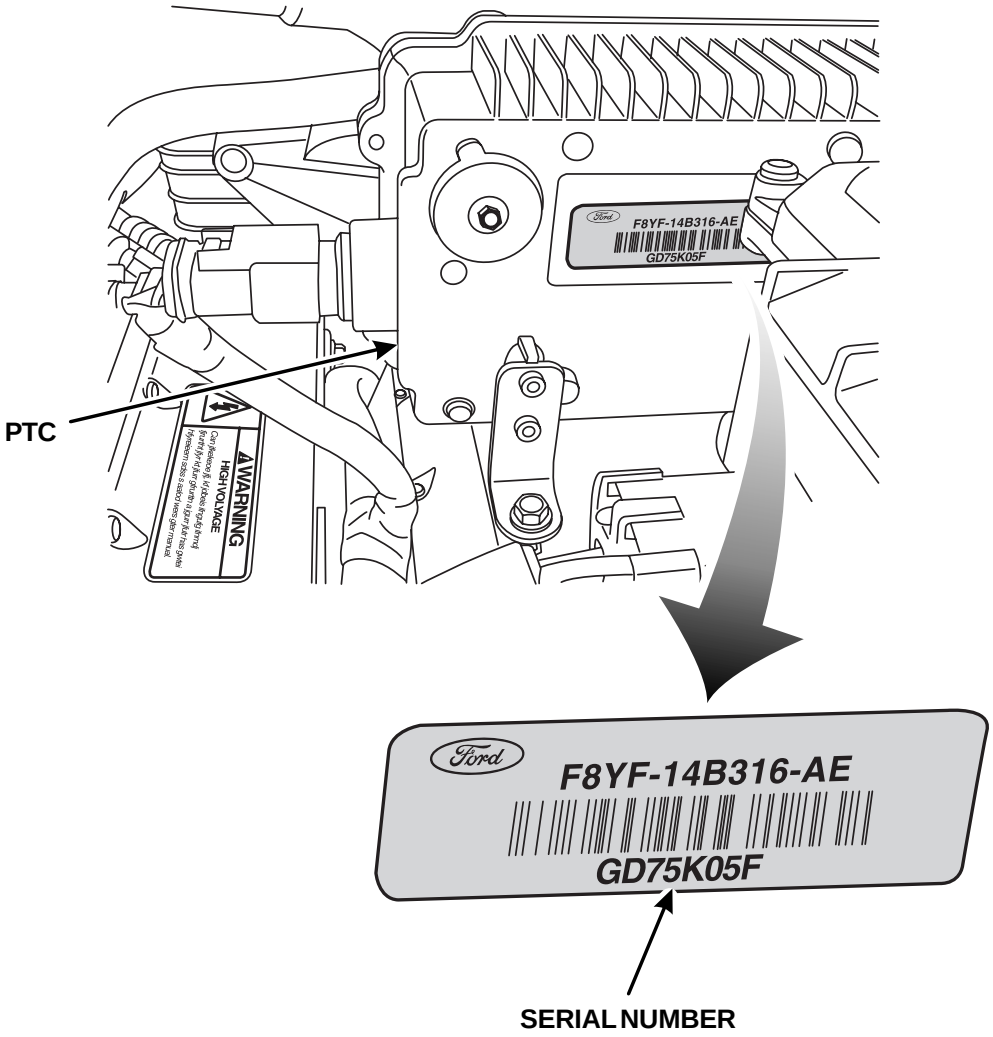


FIGURE 2

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
07/00