NOISE—WINDNOISE FROM THE “A” PILLAR AREA	Article No. 02-17-8

FORD: 2001-2003 MUSTANG

ISSUE

Some 2001-2003 model year Mustangs may exhibit a whistle type windnoise from the “A” pillar area. This may be caused by wind moving over the fastener holes of the “A” pillar applique.

ACTION

Verify condition by taping off the area. Install a foam block in the applique to keep wind from passing over the hole and causing the whistle. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Verify windnoise by placing tape the length of the “A” pillar applique (roof moulding) on the door glass side (Figure 1).
2. Drive vehicle and verify that the wind noise is gone.
3. If the noise remains, do not continue with this article. Refer to Workshop Manual Section 100-04 for further diagnosis.
4. If the tape eliminates the noise, remove the tape and remove the A-pillar applique per the Workshop Manual (Section 501-08). Do not continue with the removal of the C-pillar trim.
5. Place foam block 2R3Z-63518C46-AA over third retaining hole in applique (Figures 2 and 3).
6. Re-install applique.

NOTE
MAKE SURE THAT THE WEATHERSTRIP IS PROPERLY SEATED.

7. Verify service

PART NUMBER	PART NAME
2R3Z-63518C46-AA	Foam Block

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
021708A	Install Foam Block One Side Coupe	1.0 Hr.
021708B	Install Foam Block Both Sides Coupe	1.4 Hrs.
021708C	Install Foam Block One Side With Convertible Top	1.0 Hr.
021708D	Install Foam Block Both Sides With Convertible Top	1.2 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7603137 CONV. 6351726 COUPE	42

OASIS CODES: 108000, 701000

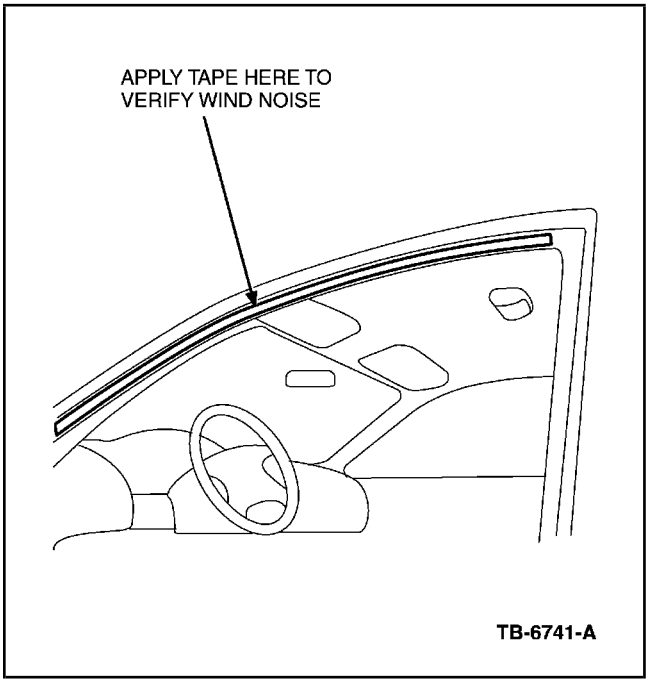


Figure 1 - Article 02-17-8

Copyright © 2002 Ford Motor Company

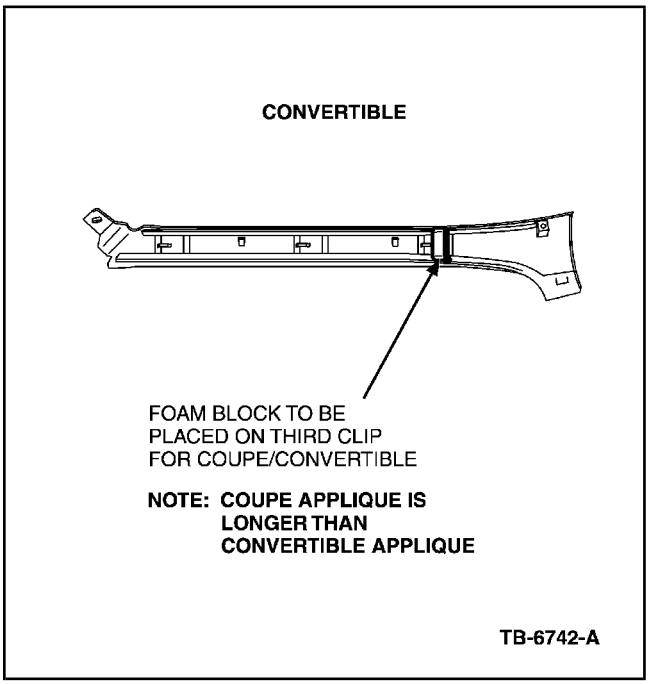


Figure 2 - Article 02-17-8

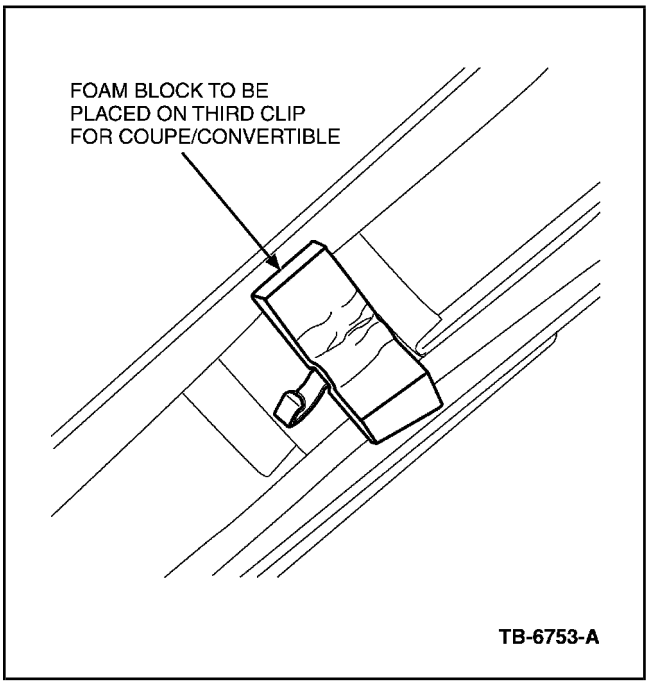


Figure 3 - Article 02-17-8

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.