ELECTRICAL—SPEED CONTROL—SPEED CONTROL INTERMITTENTLY INOPERATIVE—VEHICLES EQUIPPED WITH 5.9L CUMMINS ENGINE AND AUTOMATIC TRANSMISSION BUILT 7/20/2000 THROUGH 9/13/2000	Article No. 01-4-1

FORD: 2001 F-650, F-750

ISSUE

The cruise control may become inoperative when the vehicle reaches approximately 88 km/h (55 mph) on some vehicles equipped with automatic transmission, Cummins engine, and cruise control built from 7/20/2000 to 9/13/2000. This condition may be caused by an incorrect Engine Control Module (ECM) parameter for the transmission type, which should be set to AUTOMATIC transmission instead of MANUAL.

ACTION

Reprogram Cummins ECM with the correct transmission type parameter, following the INSITE professional ISB (Cummins software) instructions. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Access the INSITE Professional ISB (Cummins Software).

1. Select “OPEN” to enter (Figure 1).
2. Select “ADJUSTMENTS” menu and go to “FEATURES AND PARAMETERS 1” (Figure 2).
3. Select “APPLICATION SETUP 2”, go to “TRANSMISSION TYPE” and click on “AUTOMATIC”. Follow the instructions (Figure 3).
4. Click “YES” and follow screen instructions (Figure 4).
5. Turn key switch to Off position and wait for 30 seconds.
6. Turn switch to On and click “OK” (Figure 5).

These steps will make the parameter change.

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
010401A	Reprogram Cummins Engine Control Module (ECM) With Correct Transmission Type Parameter	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
12A650	42

OASIS CODES: 204000, 205000, 504000

Copyright © 2001 Ford Motor Company

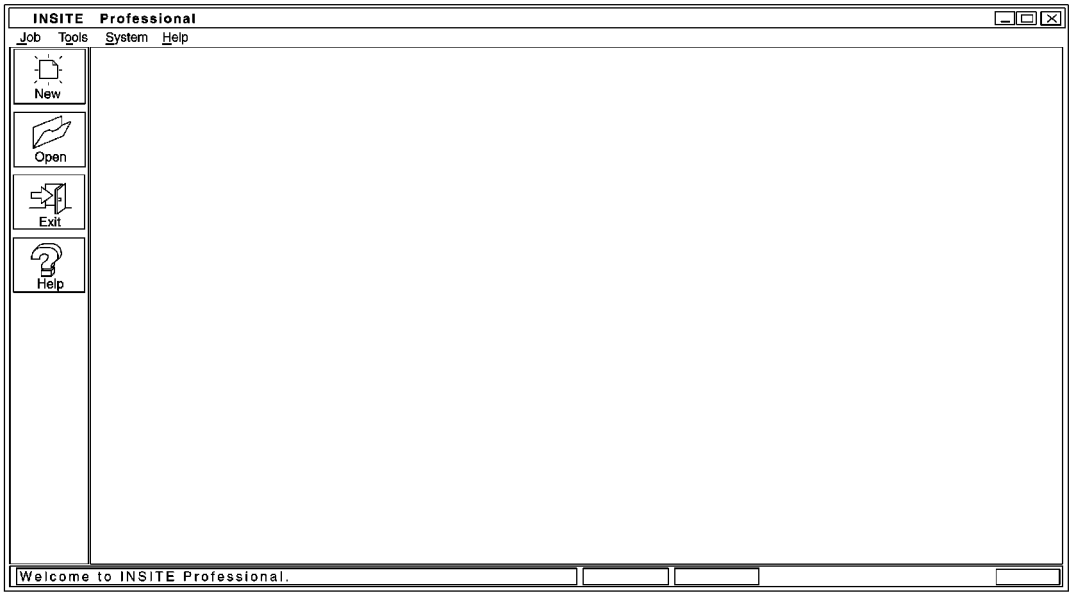

TB-6217-A

Figure 1 - Article 01-4-1

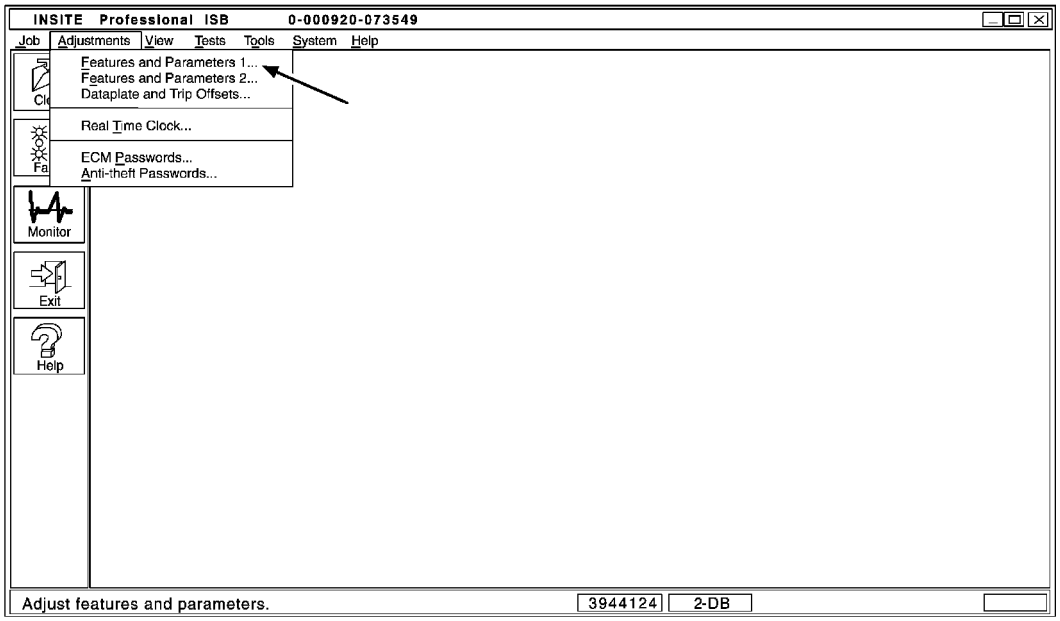

TB-6218-A

Figure 2 - Article 01-4-1

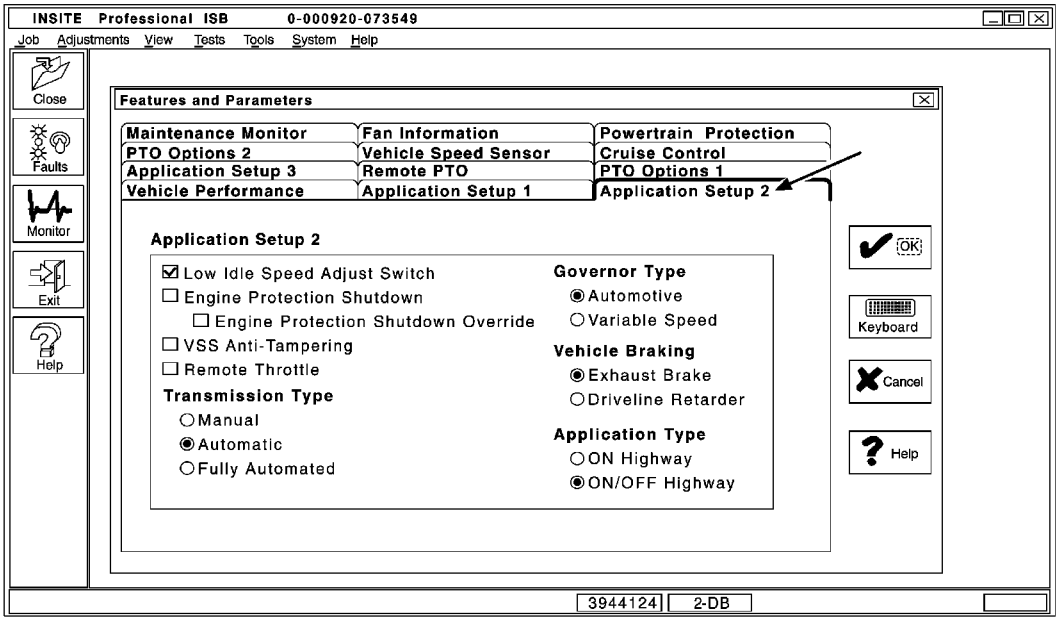

TB-6219-A

Figure 3 - Article 01-4-1

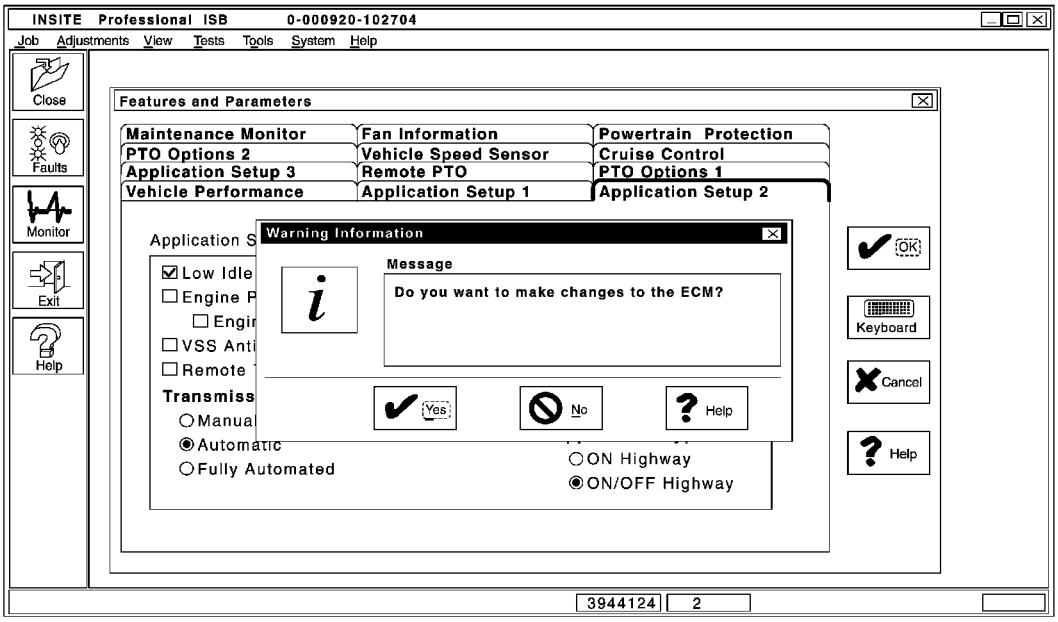

TB-6220-A

Figure 4 - Article 01-4-1

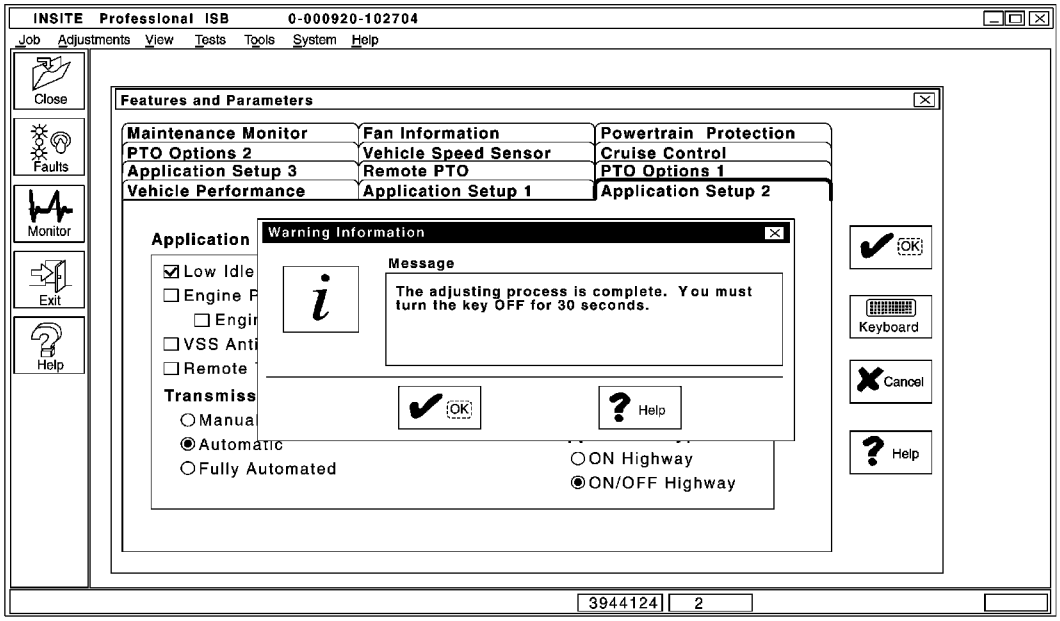

Figure 5 - Article 01-4-1