TRIM—INTERIOR REAR CORNER TRIM—MOUNTING HOLES DO NOT LINE UP CORRECTLY—POOR FIT—VEHICLES BUILT THROUGH 10/9/2000	Article No. 01-11-3

FORD: 1995-2001 RANGER

ISSUE

When replacing interior rear corner trim (left and/or right) the mounting holes within the sheet metal and center trim panel do not line up correctly. This may be caused by missing attachment holes in the sheet metal.

ACTION

Obtain new quarter trim panel(s) (left or right) and fasten to back of cab by creating new mounting point(s). Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Verify that quarter trim panel(s) needs replacement due to the unwanted gap, as shown in Figure 1 or for normal rear quarter trim panel service replacement.

Obtain new quarter trim panel(s) left or right and push pins accordingly (color) as per chart below:

NOTE

OBTAIN A TOTAL OF SIX (6) PUSH PINS FOR EACH SIDE: FIVE (5) PINS OF THE SAME SIZE AND SAME APPROPRIATE TRIM COLOR AND ONE (1) SMALLER PIN (BLACK).

To repair, perform the following after obtaining appropriate colored components:

1. Remove existing quarter trim panel and push pins, left or right side.

NOTE

REFER TO THE APPROPRIATE YEAR WORKSHOP MANUAL FOR PROPER REMOVAL PROCEDURE.

2. Install new quarter trim panel(s) and five (5) colored push pins in holes #1, #2, #3, #4, #6 and one unique black push pin in hole #5 as shown in Figure 2.

NOTE

HOLE #6 WILL REQUIRE STEP 3, PRIOR TO INSTALLATION OF THE PUSH PIN. REFERENCE FIGURE 2.

3. On the side where a quarter trim panel is being replaced, hole #6 will require drilling through the back center trim panel and sheet metal as shown in Figure 3. Use the new quarter trim panel as a guide to determine where to drill hole #6. If the existing quarter trim panel is not being replaced, on the opposite side a new hole needs to be drilled through the existing quarter trim panel, back center trim panel AND the sheet metal. To determine the centerline of the additional hole, measure 60mm from the top of the quarter trim panel to get the vertical axis. To determine the horizontal axis, measure from the side of the quarter trim panel to pin #4 and adjust the measurement to the previous vertical axis spot. Make sure holes #4 and #6 line up vertically. Use a 7mm diameter drill bit and DO NOT EXCEED 30mm (3 cm or 1-3/16″) in depth.
4. After drilling required hole(s), install corresponding colored push pins in holes #4 and #6 on both sides.
5. Verify the quarter trim panel(s) and back panel are secure prior to releasing the vehicle, as in Figure 4.

Copyright © 2001 Ford Motor Company

Article No. 01-11-3 Cont'd.

COMPONENT - PUSH PINS		
Part Name	**Qty. Req. Per Panel**	**Part Number**
Push Pins (Dark Graphite) - (4 per package)	5	N806344-SSZUE
Push Pins (Medium Graphite) - (4 per package)	5	N806344-SSZU4
Push Pins (Prairie Tan) - (4 per package)	5	N806344-SSAYC
Push Pins (Dark Denim Blue) - (4 per package)	5	N806344-SSKY
Push Pins (Willow) - (4 per package)	5	N806344-SSGA
Push Pins (Unique - Smaller) (Black) - (4 per package)	1	W705589-S300

COMPONENT - QUARTER TRIM PANEL		
Part Name	**Qty. Req. Per Vehicle**	**Part Number**
Quarter Trim Panel (Prairie Tan - Left)	1	1L5Z-10278D13-AAA
Quarter Trim Panel (Prairie Tan - Right)	1	1L5Z-10278D12-AAA
Quarter Trim Panel (Dark Denim Blue - Left)	1	1L5Z-10278D13-AAD
Quarter Trim Panel (Dark Denim Blue - Right)	1	1L5Z-10278D12-AAD
Quarter Trim Panel (Willow - Left)	1	1L5Z-10278D13-AAE
Quarter Trim Panel (Willow - Right)	1	1L5Z-10278D12-AAE
Quarter Trim Panel (Medium Graphite - Left)	1	1L5Z-10278D13-AAB
Quarter Trim Panel (Medium Graphite - Right)	1	1L5Z-10278D12-AAB
Quarter Trim Panel (Dark Graphite - Left)	1	1L5Z-10278D13-AAC
Quarter Trim Panel (Dark Graphite - Right)	1	1L5Z-10278D12-AAC

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
011103AB	Replace Left Interior Quarter Trim Panel (Includes Time To Drill Holes For New And Existing Trim Panels) - 1996-2001 Model Year Vehicles	0.6 Hr.
011103AC	Replace Both Interior Quarter Trim Panels (Includes Time To Drill Holes For Both Trim Panels) - 1996-2001 Model Year Vehicles	1.1 Hr.
011103A	Replace Right Interior Quarter Trim Panel (Includes Time To Drill Holes For New And Existing Trim Panels) - 1996-2001 Model Year Vehicles	0.6 Hr.
011103BB	Replace Left Interior Quarter Trim Panel (Includes Time To Drill Holes For New And Existing Trim Panels) - 1995 Model Year Vehicles Only	0.5 Hr.
011103BC	Replace Both Interior Quarter Trim Panels (Includes Time To Drill Holes For Both Trim Panels) - 1995 Model Year Vehicles Only	0.9 Hr.
011103B	Replace Right Interior Quarter Trim Panel (Includes Time To Drill Holes For New And Existing Trim Panels) - 1995 Model Year Vehicles Only	0.5 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
10278D12	07

OASIS CODES: 107000

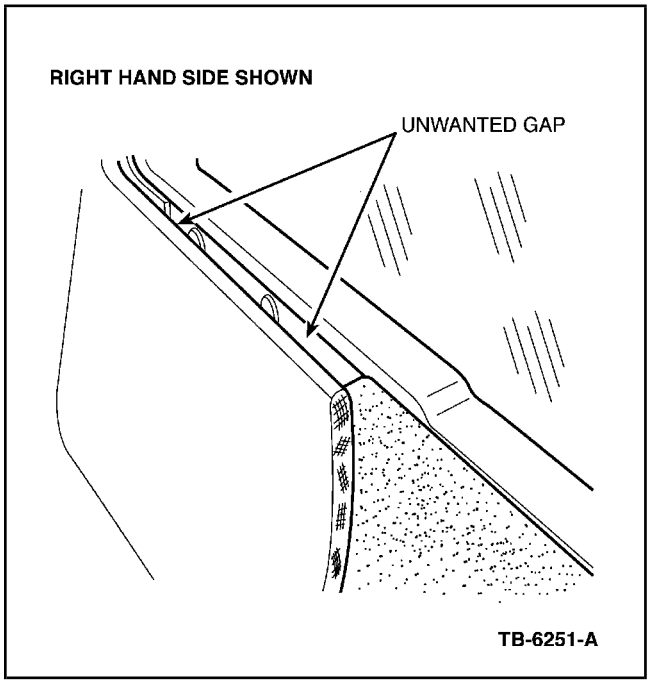

Figure 1 - Article 01-11-3

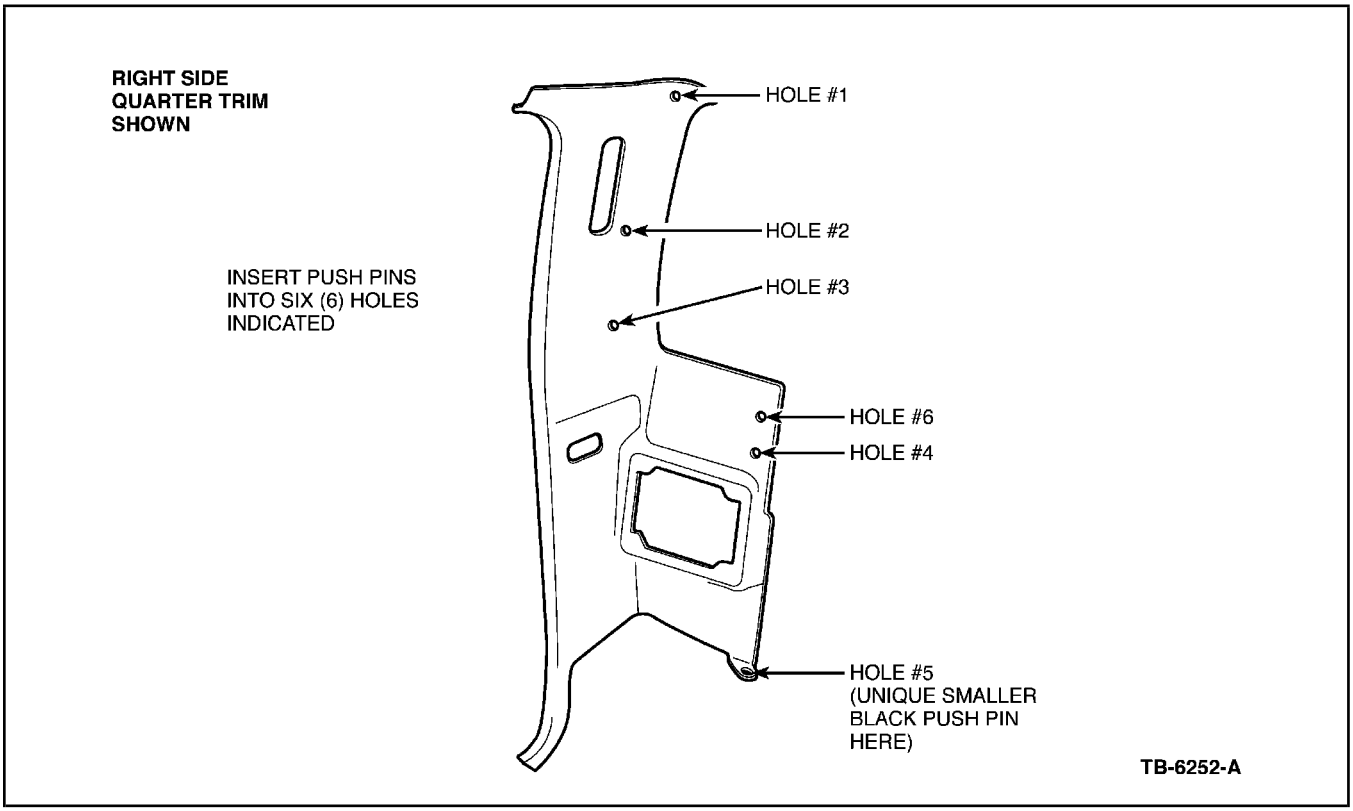

Figure 2 - Article 01-11-3

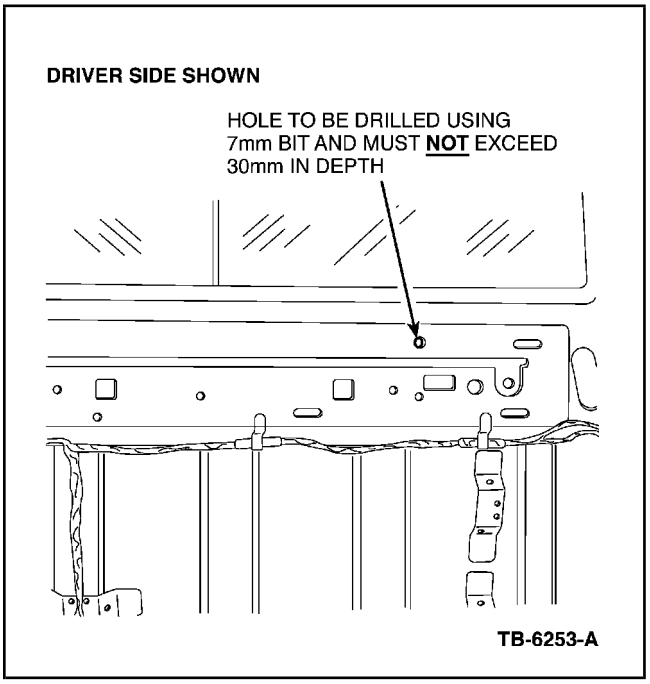

Figure 3 - Article 01-11-3

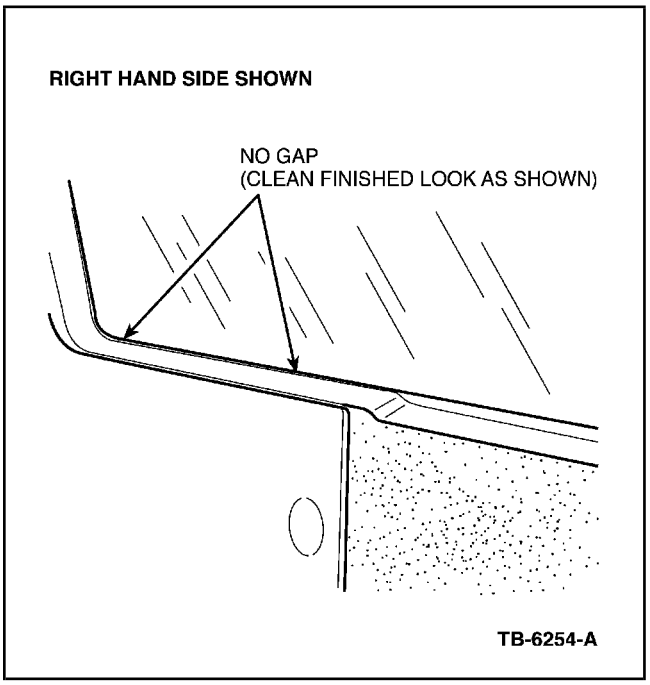

Figure 4 - Article 01-11-3