• **DRIVEABILITY—HIGH IDLE COLD IN GEAR OR WHEN COLD SHIFTING FROM PARK/NEUTRAL TO DRIVE/REVERSE—VEHICLES EQUIPPED WITH 3.0L 2 VALVE VULCAN ENGINE—BUILT BEFORE 3/1/2001 ONLY** • **TRANSAXLE—AX4S—AX4N—ROUGH ENGAGEMENT INTO GEAR WHEN COLD—ROUGH COLD SHIFTS—RPM SURGE DURING 2-3 COASTING UPSHIFT—VEHICLES EQUIPPED WITH 3.0L 2 VALVE VULCAN ENGINE—BUILT BEFORE 3/1/2001 ONLY**	**Article No. 01-8-1**

FORD: 2001 TAURUS

MERCURY: 2001 SABLE

ISSUE

Some vehicles equipped with a 3.0L Vulcan engine built prior to 3/1/2001 may exhibit a perceived:

- high idle when shifting from Park/Neutral to Drive/Reverse on a cold start
- High creep speed in Drive or Reverse when cold
- Rough and harsh shifts while driving
- Cold engine harsh Park/Neutral to Drive/Reverse engagements
- Engine rpm surge during a 2-3 coasting upshift at approximately 40 km/h (25 mph)

This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify condition. If normal diagnostics cannot pinpoint condition, reprogram the PCM. Refer to following Service Procedure for details.

SERVICE PROCEDURE

1. Reprogram the PCM to the latest calibration. Refer to the PCM Calibration Information Chart in this article for applications.

NOTE

IF USING A NEW GENERATION STAR (NGS) TESTER TO REPROGRAM THE PCM, THE NGS MAY ASK "WOULD YOU LIKE TO MODIFY ANY PCM PARAMETERS?" ANSWER "NO" TO THIS QUESTION. THIS WILL PREVENT CHANGES TO THE TIRE SIZE AND AXLE RATIO. IF "YES" WAS INADVERTENTLY SELECTED, IT MAY BE NECESSARY TO ENTER 797 FOR TIRE SIZE AND 3.47 FOR THE FINAL DRIVE AXLE RATIO.

2. Advise the customer that it may take several drive cycles (dependant on cycle) before the PCM will completely adapt to the new calibration.

Copyright © 2001 Ford Motor Company

Article No. 01-8-1 Cont'd.

PCM CALIBRATION INFORMATION							
Application	**Old Part Number (-12A650-)**	**Old Tear Tag**	**New Part Number (-12A650-)**	**New Tear Tag**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
3.0L 2V AX4S Trans.	1F1Z-FD	VMC3	1F1Z-FE	VMC4	12S0507	12S0510	WDS B11.15 or B12.3 Release
3.0L 2V AX4N Trans.	1F1Z-ED	TYD3	1F1Z-EE	TYD4	12N0507	12N0510	WDS B11.15 or B12.3 Release
3.0L 2V Flex Fuel, AX4S Trans.	1F1Z-ZD	PKK3	1F1Z-ZE	PKK4	1FS0507	1FS0510	WDS B11.15 or B12.3 Release
3.0L 2V Flex Fuel, AX4N Trans.	1F1Z-DC	LUA3	1F1Z-DD	LUA4	1FN0507	1FN0510	WDS B11.15 or B12.3 Release
3.0L 2V, AX4N GCC Countries, Leaded Fuel	1F1Z-NC	PWF2	1F1Z-ND	PWF3	12N0G06	12N0G10	WDS B11.15 or B12.3 Release

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

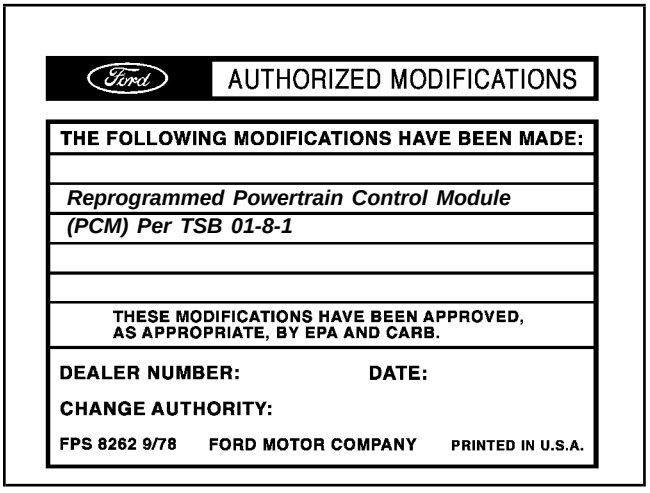

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 501000, 502000, 503000, 504000, 610000, 610700, 612000, 612500, 612600, 617400, 619400