NO START—VEHICLES WITH 7.3L DIESEL ENGINE	Article No. 00-5-3

FORD: 2000 F-650, F-750

ISSUE

A no start condition may occur on some vehicles. This may be caused by moisture in the Injection Driver Module (IDM) relay main engine wiring harness (-12A581-), which is mounted on the bulkhead.

ACTION

Replace IDM relay with a revised IDM relay and replace its connector with a sealed connector. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Obtain IDM Service Kit (YC3Z-14303-AA).
2. Cut the takeout to the relay about 70mm after takeout (Figure 1).
3. Shorten the pigtails to the legs that you need and splice to the same colored wire. Refer to TSB 99-22-2 for wire harness terminal repair and wire splice procedure.
4. Remove the IDM relay and install revised IDM relay. If the IDM retainer is broken, tape the new relay on the harness.

PART NUMBER	PART NAME
YC3Z-14303-AA	IDM Service Kit

OTHER APPLICABLE ARTICLES: 99-22-2
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 601300, 603300

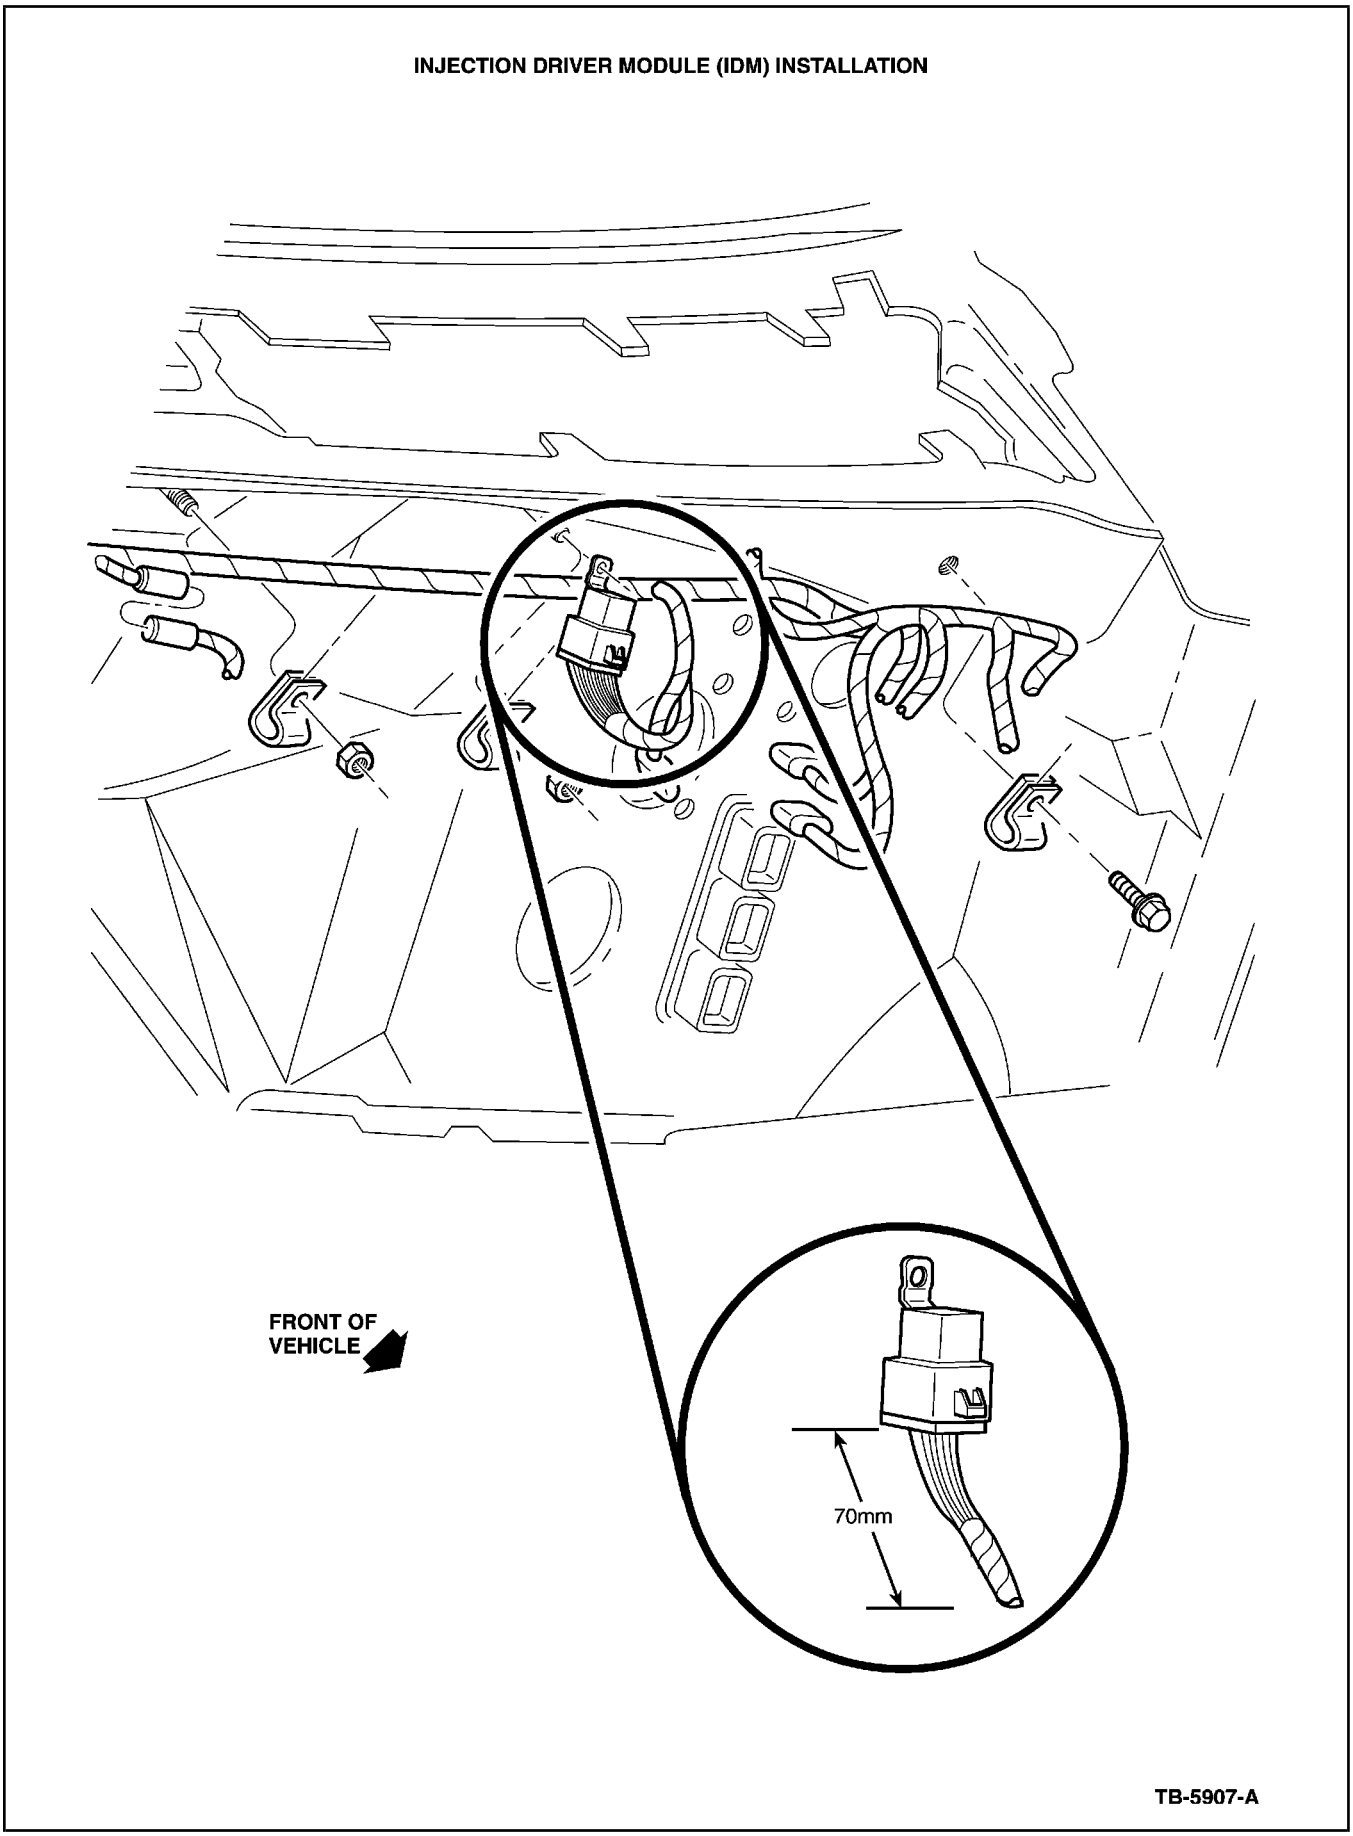

Figure 1 - Article 00-5-3