RADIO—REDUCED VOLUME/INOPERATIVE SUB-WOOFER OR INOPERATIVE FRONT SPEAKERS—VEHICLES EQUIPPED WITH TREMOR RADIO PACKAGE BUILT 5/22/2000 THROUGH 7/14/2000 ONLY	Article No. 00-21-7

FORD: 2000 RANGER

ISSUE

Vehicles equipped with the (Tremor) Pioneer Audio System may experience front speakers and or sub-woofer speakers that operate intermittently and/or at a reduced volume. This may be due to cracked and/or broken components within the amplifier.

ACTION

Replace amplifier with a more robust amplifier. Refer to the following Service Procedure for details.

First verify that the Tremor Radio Package exhibits one or all of the following:

- Reduced volume output
- Front speakers and/or sub-woofers cut in-or-out (operate intermittently)
- Front speakers and/or sub-woofers do not operate at all

If one or all of the above is evident:

1. Contact your local Visteon Radio Repair Center for an advance exchange amplifier. If additional technical information is needed, contact your Visteon Audio Technical Hotline 1-800-367-3333 Monday-Friday 8:00 AM-8:00 PM Eastern Time.
2. Have customer return back to repair facility when advance exchange or repaired amplifier has arrived from Visteon Radio Repair facility.

NOTE

IF AN ADVANCE EXCHANGE AMPLIFIER IS NOT READILY AVAILABLE, PLEASE EXPECT APPROXIMATELY 10 BUSINESS DAYS FOR A REPAIRED AMPLIFIER TO BE SHIPPED.

3. When new amplifier has arrived, remove existing amplifier and reinstall using the following Service Procedure.

SERVICE PROCEDURE

1. Remove 50 amp inline fuse which is found under the hood, just after the battery on the wheel apron (Figure 1).
2. Remove four (4) bolts from sub-woofer enclosure located behind the seats (Figure 2).
3. Disconnect electrical connectors at each quarter panel (right and left side of inside quarter panel) from sub-woofer enclosure (Figure 2).
4. Rotate sub-woofer enclosure up to gain access to amplifier on bottom (pivot up on back edge).
5. Disconnect (unplug) RCA connectors from amplifier (Figure 3). Use caution not to damage RCA connectors.
6. Disconnect spade connectors from amplifier (Figure 4).
7. Remove six (6) amplifier attaching nuts (Figure 4).
8. Separate/remove amplifier from enclosure.
9. Install new amplifier, provided by Visteon Radio Repair Facility, into vehicle by reversing the removal process as noted above.

NOTE

HAND START FOUR (4) SUB-WOOFER ENCLOSURE-TO-FLOOR BOLTS DURING INSTALLATION (FIGURE 2) TO AVOID CROSS-THREADING.

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
002107A	Replace Amplifier	0.8 Hrs.

Copyright © 2000 Ford Motor Company

Article No. 00-21-7 Cont'd.

DEALER CODING

BASIC PART NO.	CONDITION CODE
18C808	42

OASIS CODES: 207000

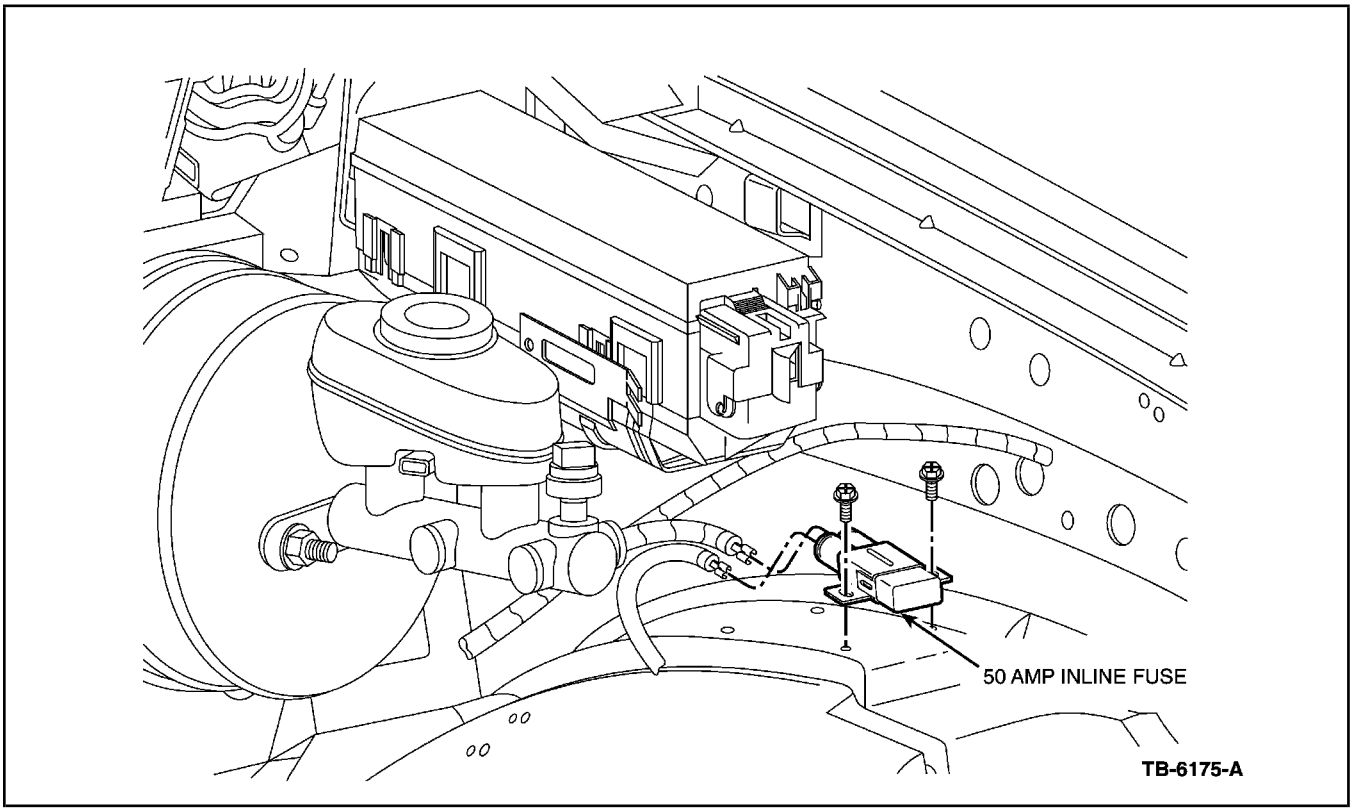


Figure 1 - Article 00-21-7

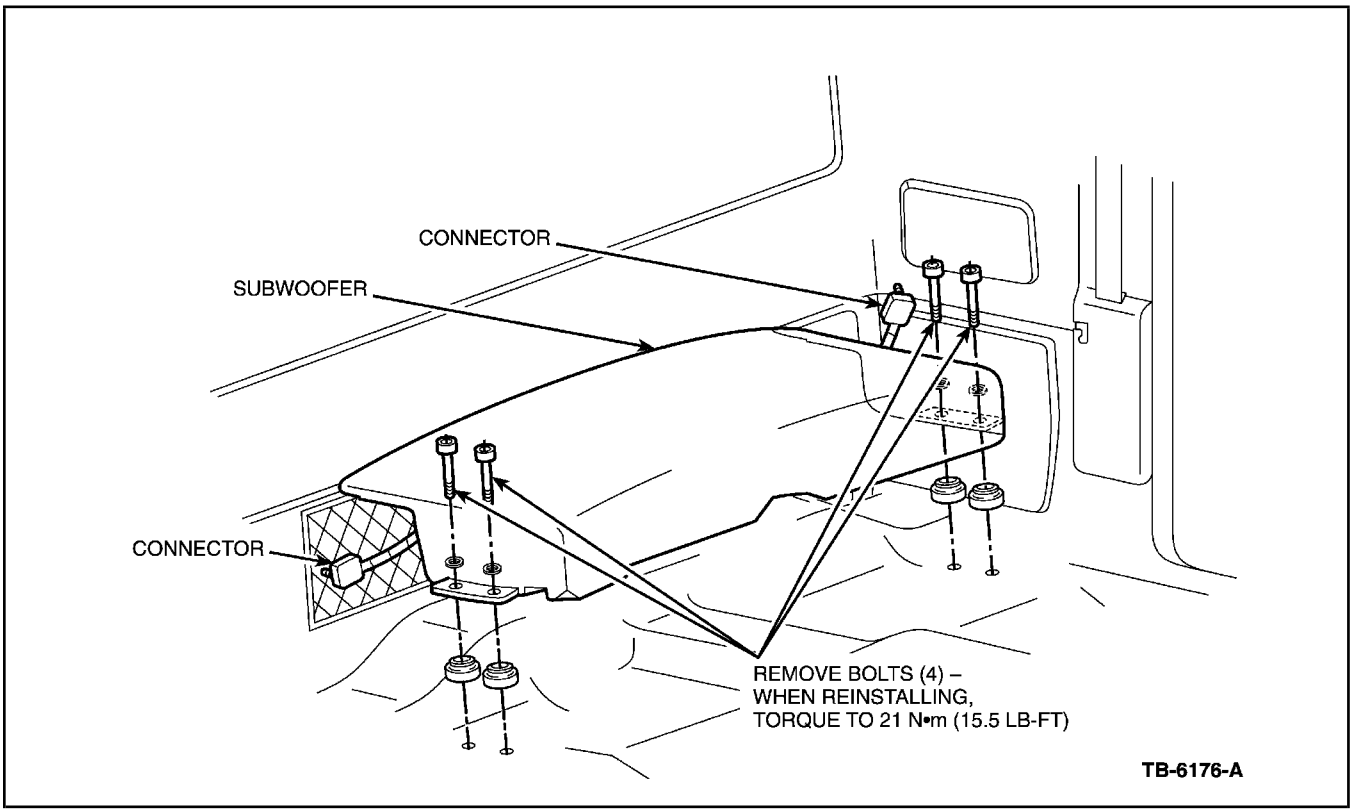


Figure 2 - Article 00-21-7

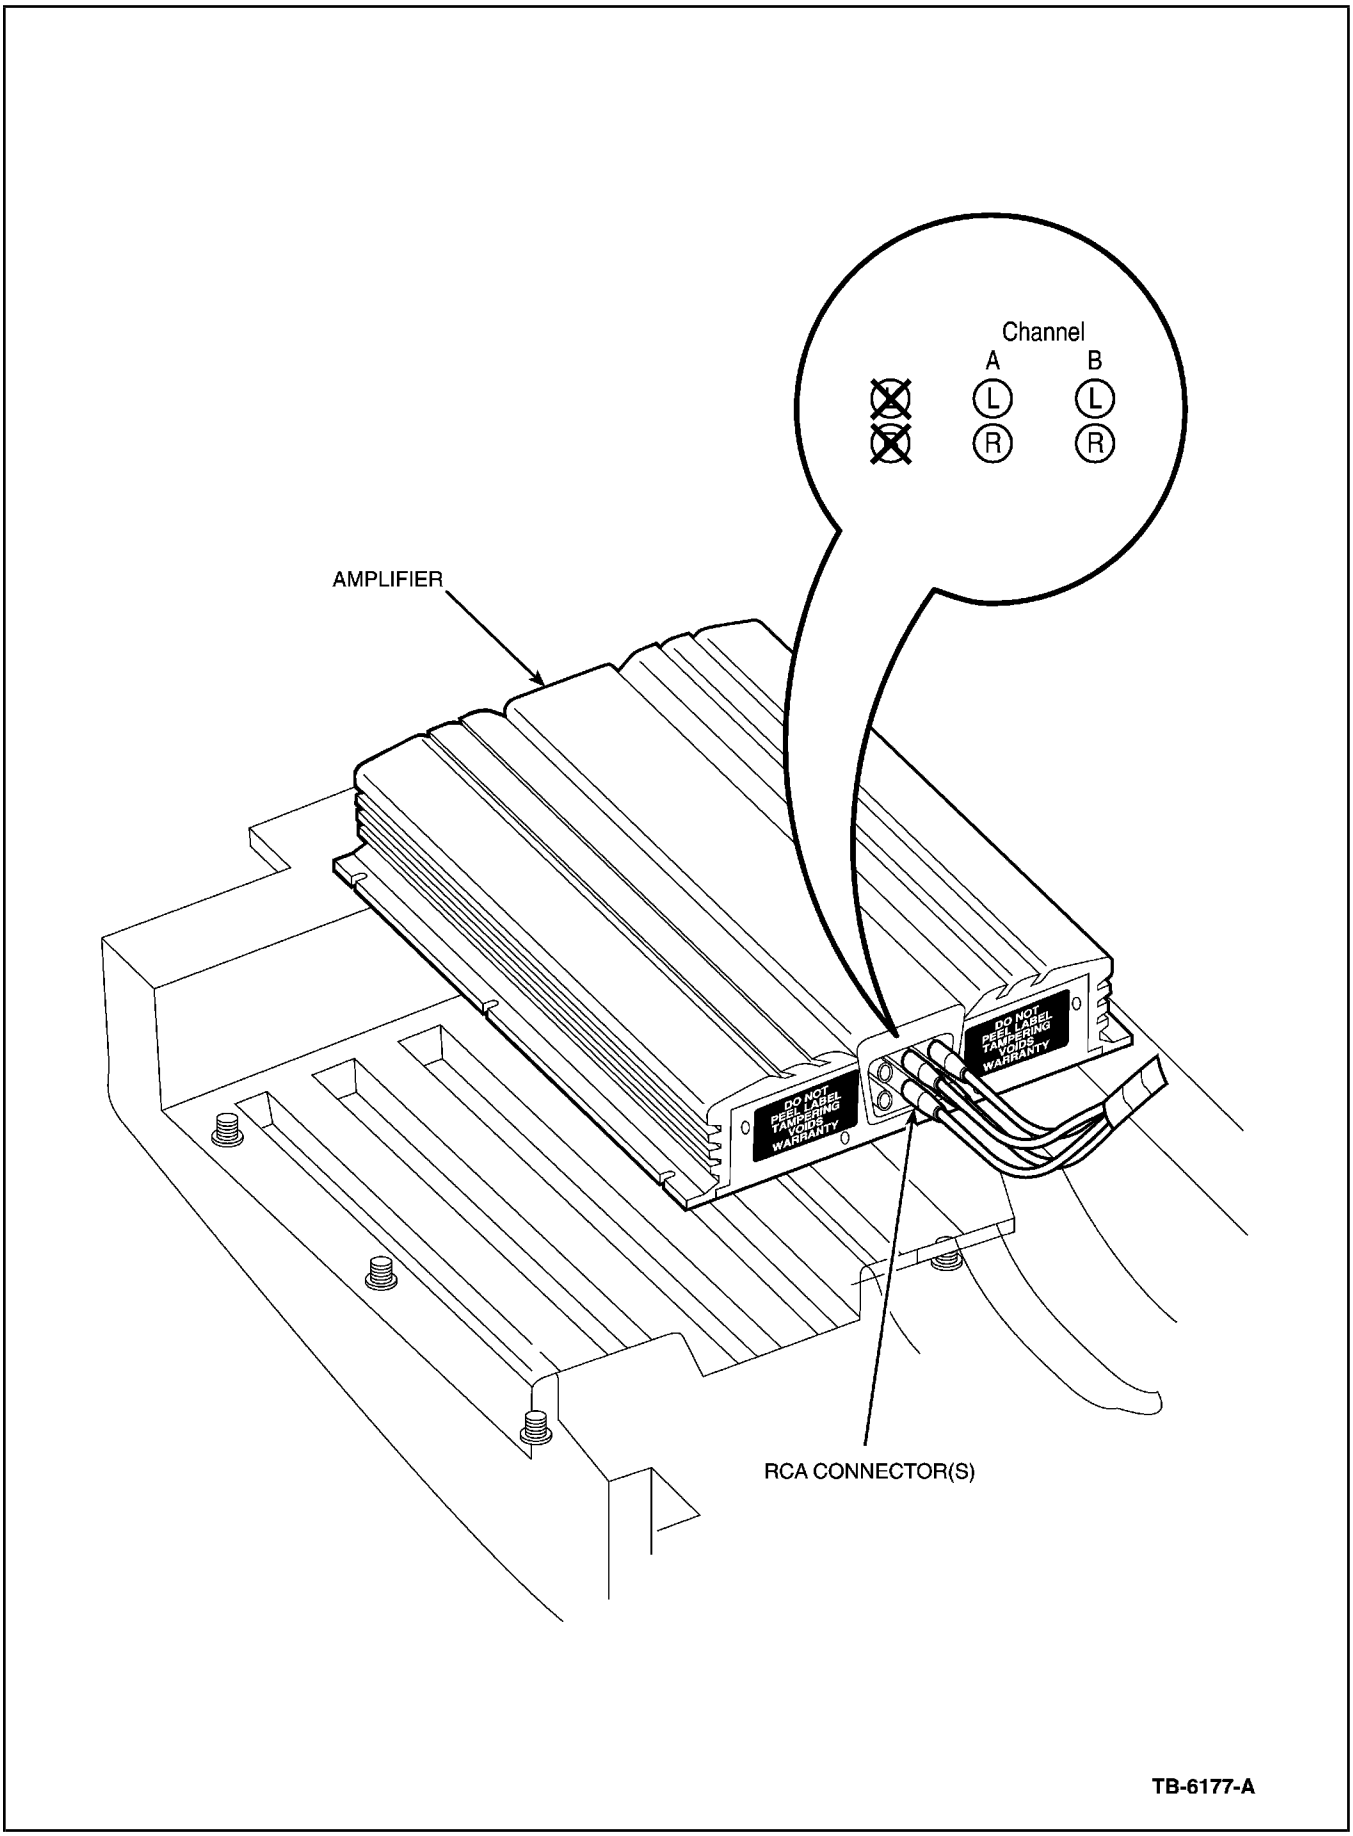


Figure 3 - Article 00-21-7

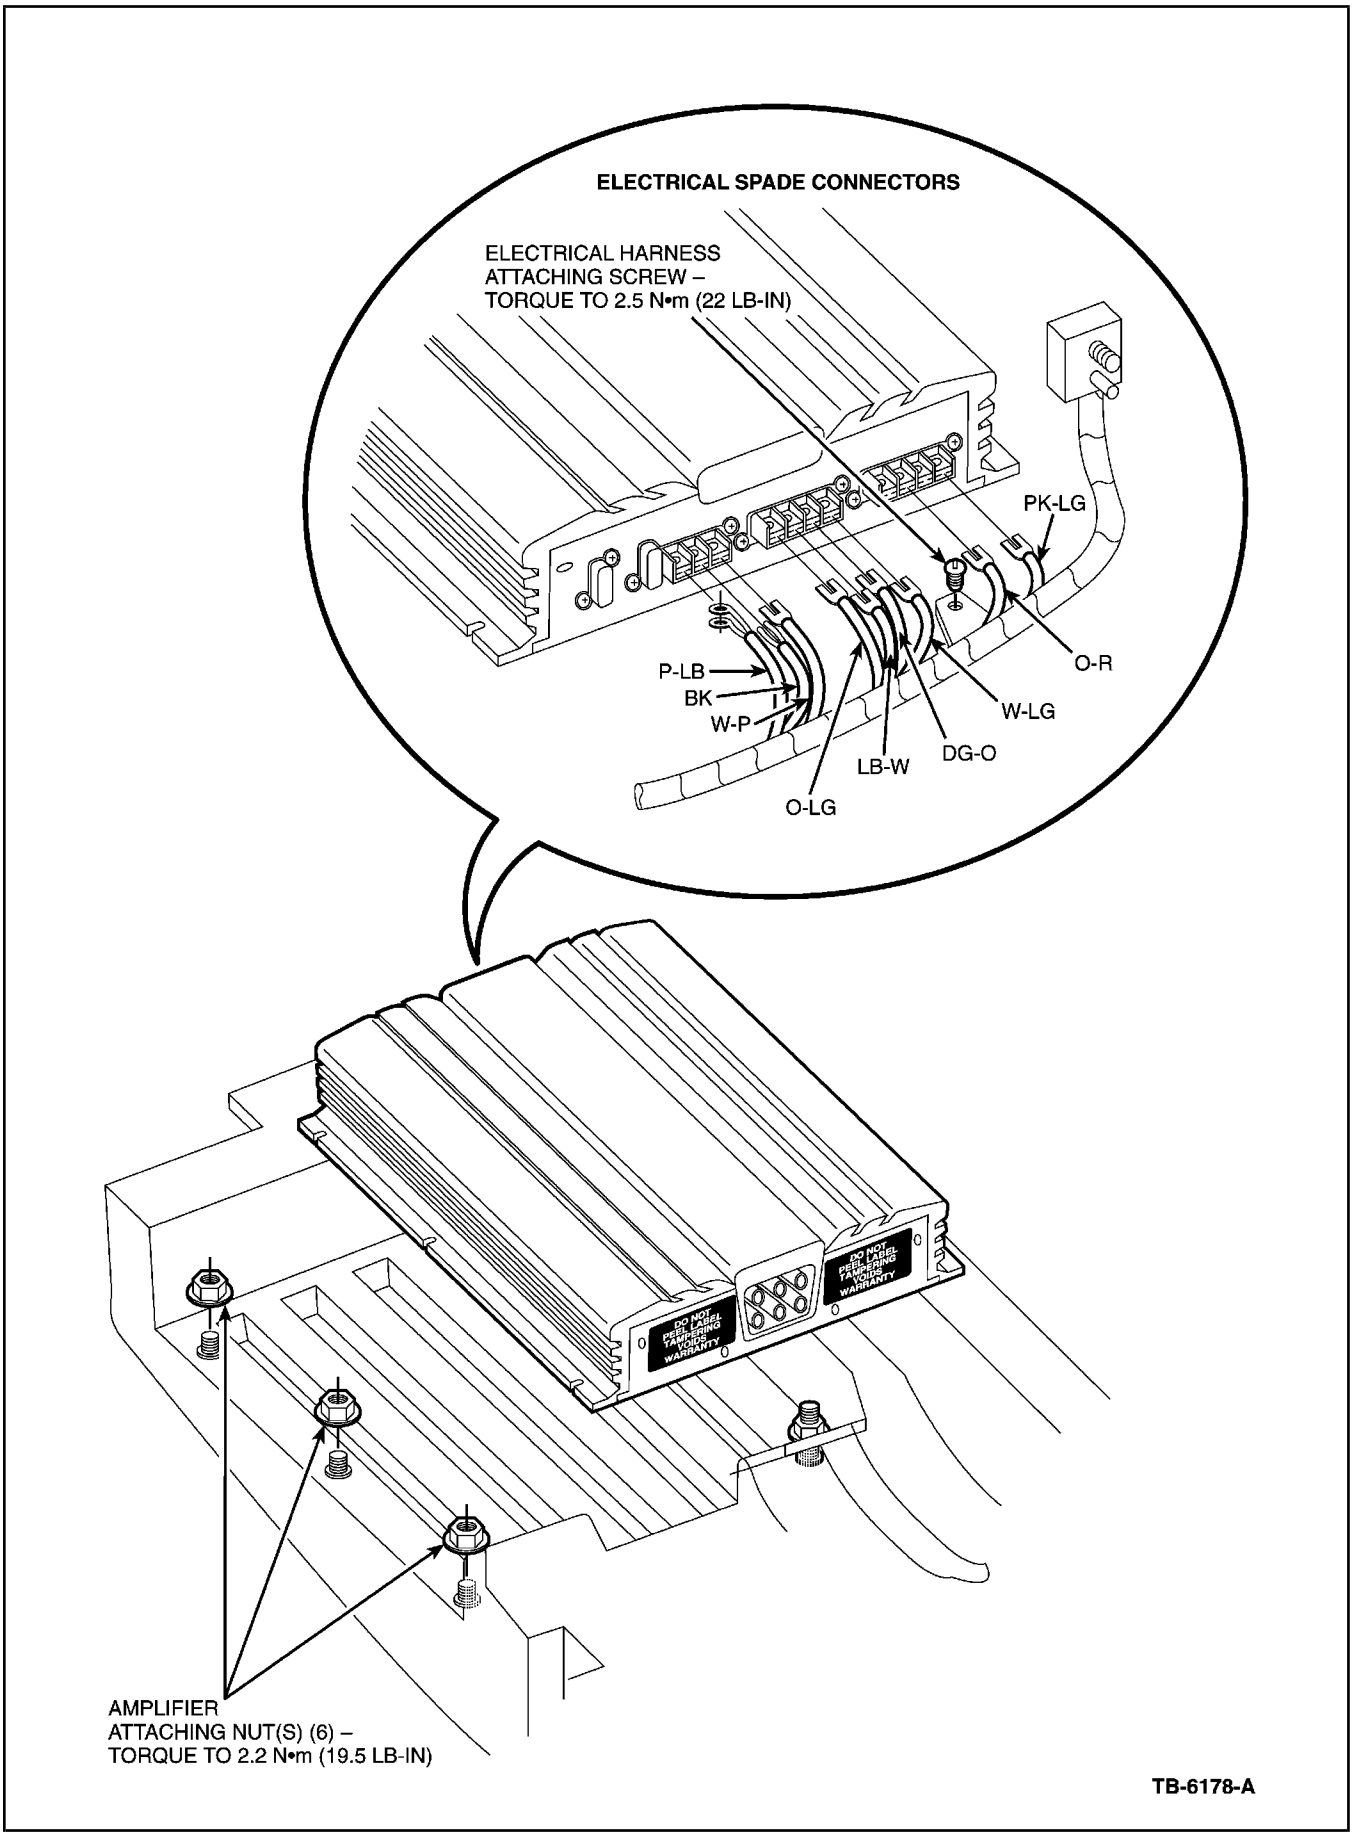


Figure 4 - Article 00-21-7