• HESITATION—DURING STARTUP AFTER HOT SOAK—2.5L VEHICLES BUILT THROUGH 5/1/2000 • ROUGH IDLE—DURING STARTUP AFTER HOT SOAK—2.5L VEHICLES BUILT THROUGH 5/1/2000	Article No. 00-10-2

FORD: 1999-2000 CONTOUR

MERCURY: 1999-2000 COUGAR, MYSTIQUE

ISSUE

Some vehicles may exhibit a rough idle, or hesitation when first operated after being parked for 20-30 minutes (also known as a hot soak condition). This may be due to the presence of winter grade fuels along with the existing Powertrain Control Module (PCM) calibration. The present calibration may not increase the fuel pressure sufficiently when first started after a hot soak to compensate for the winter grade fuels. This may result in fuel vapor (instead of liquid fuel) accumulating in the fuel rail and ultimately being directed to the cylinders through the injectors.

ACTION

Reprogram the PCM with a new calibration which has a revised fuel pressure strategy. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Perform the diagnostic self-test to check for Diagnostic Trouble Codes (DTCs). If any codes are present, refer to the appropriate diagnostic routines in the Powertrain Control/Emissions Diagnosis (PC/ED) Service Manual and repair as necessary.
2. Using the New Generation Star (NGS) Tester or Worldwide Diagnostic System (WDS), access the PCM identification function (Log File on WDS) to obtain the present part number of the PCM.
3. Use the PCM part number to identify the vehicle's existing calibration by referring to the following PCM Reprogramming Information Chart.
4. Once the existing calibration has been identified, reprogram the PCM to the latest calibration revision level using an NGS Tester or WDS.

NOTE

AFTER A MODEL YEAR GOES OUT OF PRODUCTION, THE SERVICE CALIBRATION SUFFIX IS NOT CHANGED. ONLY THE PCM PART NUMBER IS UPDATED WHEN THE PCM IS RECALIBRATED.

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

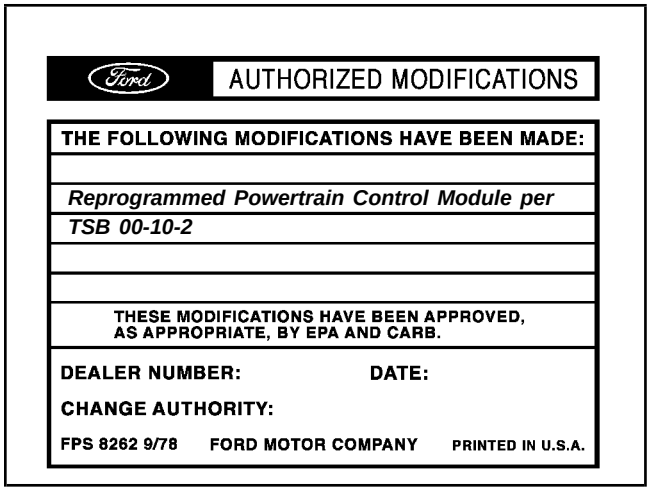

Article No. 00-10-2 Cont'd.

PCM REPROGRAMMING INFORMATION			
Old PCM No.	**New PCM No.**	**Tear Tag**	**NGS/WDS Qualifier**
XS2A-XA, XB	XS2A-XC	VNM0, VMN1, VMN2	9LCA-BV CALIBRATION
XS2A-YA, YB	X2SA-YC	TRM0, TRM1, TRM2	Not Available on NGS
XS8A-MA, MB	XS8A-MC	DMX0, DMX1, DMX2	9LCA-BW CALIBRATION
XS2A-ZA, ZB	XS2A-ZC	CGB0, CGB1, CGB2	9LCM-BV CALIBRATION
XS2A-ABA, ABB	XS2A-ABC	HKG0, HKG1, HKG2	Not Available on NGS
XS8A-PA, PC	XS8A-PD	NCF0, NCF1, NZK0	9LCM-BW CALIBRATION
XS2A-GD, GE	XS2A-GF	LXP3, LXP4, LXP5	9LCA-AC CALIBRATION
XS2A-HD, HE	XS2A-HF	MZZ3, MZZ4, MZZ5	9LCA-BC CALIBRATION
X2SA-VD, VE	X2SA-VF	PPC3, PPC4, PPC5	Not Available on NGS
XS8A-GD, GE	XS8A-GF	GGR3, GGR4, GGR5	9LCA-AD CALIBRATION
XS8A-HD, HE	XS8A-HF	HYA3, HYA4, HYA5	9LCA-BD CALIBRATION
XS2A-ED, EE, EF	XS2A-EG	JTA3, JTA4, JTA5, JTA6	9LCM-AC CALIBRATION
XS2A-FD, FE, FF	XS2A-FG	DAR3, DAR4, DAR5, DAR6	9LCM-BC CALIBRATION
XS2A-PD, PE, PF	XS2A-PG	NRE3, NRE4, NRE5, NRE6	Not Available on NGS
XS8A-ED, EE, EF	XS8A-EG	EDL3, EDL4, EDL5, EDL6	9LCM-AD CALIBRATION
XS8A-FD, FE, FF	XS8A-FG	FWF3, FWF4, FWF5, FWF6	9LCM-BD CALIBRATION

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	**DESCRIPTION**	**TIME**
001002A	Reprogram Powertrain Control Module (PCM)	0.6 Hrs.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECAL	42

OASIS CODES: 602300, 603300, 607000, 607400, 607500, 607700, 608000, 608400, 608500, 609000, 609400, 610000, 610500, 611000, 611500, 612000, 612500, 614000, 614500, 618400