• **DRIVEABILITY—LOW POWER CONDITION WHILE IN REVERSE GEAR—VEHICLES EQUIPPED WITH 6.8L 2V ENGINE, 4R100 TRANSMISSION AND PTO OPTION ONLY** • **TRANSMISSION—4R100—LOW POWER CONDITION WHILE IN REVERSE GEAR—VEHICLES EQUIPPED WITH 6.8L 2V ENGINE, 4R100 TRANSMISSION AND PTO OPTION ONLY**	**Article No. 02-2-1**

FORD: 2000-2001 SUPER DUTY F SERIES

ISSUE

Some vehicles equipped with the 6.8L-2V engine, 4R100 transmission and PTO option may exhibit a low power condition while in reverse gear. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify the condition. If the condition exists, reprogram the PCM with an updated calibration. If the condition persists after the reprogram, continue with normal diagnostics to pinpoint the condition. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Verify that a low power or lack of power condition exists while in reverse. Prior to performing any service procedures, verify tear tag information. Refer to the PCM Calibration Information Chart in this article. If the calibration is not at the latest level, follow the procedures found in the Powertrain Control/Emissions Diagnosis (PC/ED) Workshop Manual to reprogram the PCM to latest calibration level.

Verify repair. If the condition is not corrected, continue with normal diagnostics and repair per the Workshop Manual.

Copyright © 2002 Ford Motor Company

Article No. 02-2-1 Cont'd.

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
2000 6.8L w/4R100 w/PTO 50S	YU7A-BEA	EUA1	YU7Z-BEB	0F717N0511	0F717N0511	WDS B17.1 Release or Later
2000 6.8L w/4R100 w/PTO Less LPO	YU7A-BGA	OEM1	YU7Z-BGB	0F717P0A11	0F717P0A11	WDS B17.1 Release or Later
2000 6.8L w/4R100 w/PTO Calif/49S w/LPO	YU7A-BKA	DXX1	YU7Z-BKB	0F717R0B11	0F717R0B11	WDS B17.1 Release or Later
2000 6.8L w/4R100 w/PTO Calif.	YU7A-BMA	QQX1	YU7Z-BMB	0F717C0B11	0F717C0B11	WDS B17.1 Release or Later
2000 6.8L w/4R100 w/PTO Calif/49S w/PTO	YU7A-BPA	OCO1	YU7Z-BPB	0F717T0B11	0F717T0B11	WDS B17.1 Release or Later
2001 6.8L w/4R100 w/PTO Calif.	1C3A-RA	RAD0	1U7Z-ARA	1F717C0B10	1F717C0B15	WDS B17.1 Release or Later
2001 6.8L w/4R100 w/PTO Calif.	YU7A-ATA	IBF1	YU7Z-ATB	1F717C0B15	1F717C0B15	WDS B17.1 Release or Later
2001 6.8L w/4R100 w/PTO 50S/Alt/Can	1C3A-HA	SDP0	1U7Z-ASA	1F717N0515	1F717N0515	WDS B17.1 Release or Later
2001 6.8L w/4R00 w/PTO w-o/LPO Fed/Alt/Can	1C3A-KA	TAE0	1U7Z-ATA	1F717P0A15	1F717P0A15	WDS B17.1 Release or Later
2001 6.8L w/4R100 w/PTO Calif/49S w/LPO	1C3A-NA	UNS0	1U7Z-AUA	1F717R0B15	1F717R0B15	WDS B17.1 Release or Later
2001 6.8L w/4R100 w/PTO	1C3A-TA	VRD0	1U7Z-AVA	1F717T0B15	1F717T0B15	WDS B17.1 Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

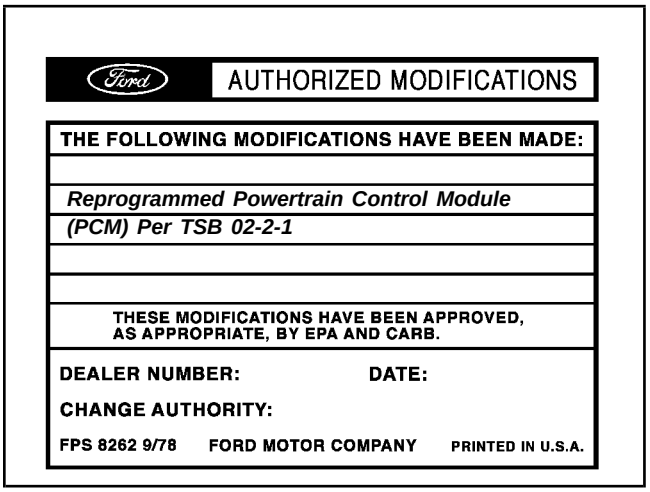

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	**DESCRIPTION**	**TIME**
020201A	Reprogram Powertrain Control Module (Includes Time To Verify Complaint And Repair)	0.9 Hr.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECAL	42

OASIS CODES: 504000, 614000, 614500