TRIM—HEADLINER SAG/LOOSE AT REAR QUARTER GLASS NEAR C OR D PILLAR AREA	Article No. 01-23-7

FORD: 2001 ESCAPE

ISSUE

Some vehicles built prior to 7/31/2001 may exhibit a headliner sag/loose condition at rear quarter glass area near C/D pillar. This may be caused by a process change at the headliner manufacturing facility.

ACTION

Verify condition. Inspect headliner for amount of sag and overall condition. Repair or replace headliner. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

NOTE

PRIOR TO REPAIRING THE HEADLINER, PLEASE READ THROUGH THE FOLLOWING PROCEDURE. REMEMBER TO INSTALL THE PROTECTIVE TUBING SLEEVE ONTO THE DRILL BIT TO PREVENT DAMAGE TO THE ROOF. DO NOT DRILL THE HOLES UNTIL STEP 12.

Prior to repair, inspect the vehicle for the following conditions to determine if the headliner should be replaced:

1. If the headliner sags in excess of 30 mm (1.180 inch) below quarter window black-out paint, the headliner must be replaced (refer to Workshop Manual Section 501). Do not attempt repair.
2. Inspect for delamination of headliner cloth to substrate. If cloth has come loose, the headliner must be replaced (refer to Workshop Manual Section 501). Do not attempt repair.

If headliner does not meet the above replacement criteria, the headliner can be repaired. Continue with procedure.

To repair the headliner, use the Headliner Retainer Installation Kit.

- For parchment interior, use part number 2L8Z-78519D80-AAA
- For graphite interior, use part number 2L8Z-78519D80-AAB

Headliner Repair Procedure

1. Locate new push-pin holes (See Figure 1 for example locations).
2. Cut template along the curves printed on both sides of template.
3. Make two holes on template along the printed circles.
4. Align template with glass and C-pillar or D-pillar as noted on template. Make sure arrow points to front of the vehicle. Use template for locating proper push-pin spacing (Figure 2).
5. Fit the D-pillar side edge as noted on template and the D-pillar to locate the new push-pin positions between D-pillar and C-pillar (Figure 2).
6. Mark both left-hand side and right-hand side new pin position holes as noted on template. Make sure arrow points to front of the vehicle.

NOTE

DO NOT DRILL AT THIS POINT.

NOTE

ELECTRICAL CONNECTOR AND HARNESS NEED TO BE TEMPORARILY MOVED TO PREVENT DAMAGE TO WIRES. MUST BE ROTATED 90 DEGREES ON LEFT HAND SIDE ONLY AS VIEWED FROM REAR OF VEHICLE.

7. Remove the pushpin and child seat tether cap on left hand side only. This allows headliner to flex and helps prevent crease damage (Figure 3).
8. Remove top portion of left hand D-pillar trim to allow headliner to flex down. Be careful not to bend or over flex headliner too much or creasing will occur (Figure 4).
9. Rotate electrical connector 90 degrees. Pull harness toward rear of vehicle to avoid drill damage (Figure 5).
10. Install protective tubing sleeve onto 7mm (9/32 inch) drill bit with 7 - 10mm of the drill bit exposed beyond the end of the tube (Figure 6).

Copyright © 2001 Ford Motor Company

NOTE
THIS SLEEVE MUST BE USED TO PREVENT DAMAGE TO THE ROOF.

11. Align drill perpendicular (90 degrees to surface of headliner) so that pin will be flush with headliner surface (Figure 7).

NOTE
USE SAFETY GLASSES OR GOGGLES TO PROTECT EYES FROM CHIPS WHEN DRILLING HOLES.

12. Drill holes using the 7mm (9/32 inch) drill bit with protective sleeve.

13. Before inserting the push-pins, remove any debris/metal shavings that have accumulated on the headliner and/or rear cargo department as a result of drilling the holes.

NOTE
DO NOT INSERT PUSH-PINS YET.

14. Rotate electrical connector and harness to original position.

15. Insert new pins into holes until headliner is 2mm (.080 inch) above glass blackout line.

NOTE
BE CAREFUL NOT TO PULL HEADLINER UP TOO FAR. THIS WILL CAUSE GAPPING AT C AND D PILLAR TRIM. PUSHPINS CAN BE REMOVED AND RE-INSTALLED TO DESIRED LENGTH.

16. Verify electrical function of center dome lamp, rear dome lamp and rear wiper.

17. Install D-pillar trim and pushpins in original locations. Make sure clips and pins are properly positioned and seated.

18. Inspect headliner and trim positioning.

PART NUMBER	PART NAME
2L8Z-78519D80-AAA	Headliner Retainer Installation Kit - Parchment
2L8Z-78519D80-AAB	Headliner Retainer Installation Kit - Graphite

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
012307A	Verify Concern And Replace Headliner	2.3 Hrs.
012307B	Verify Concern And Perform Repair Procedure	0.5 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7851944	34

OASIS CODES: 107000

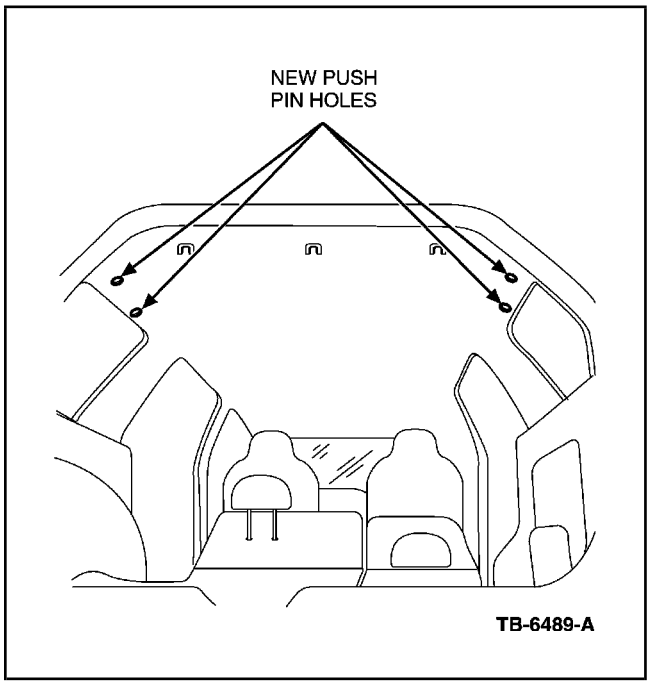


Figure 1 - Article 01-23-7

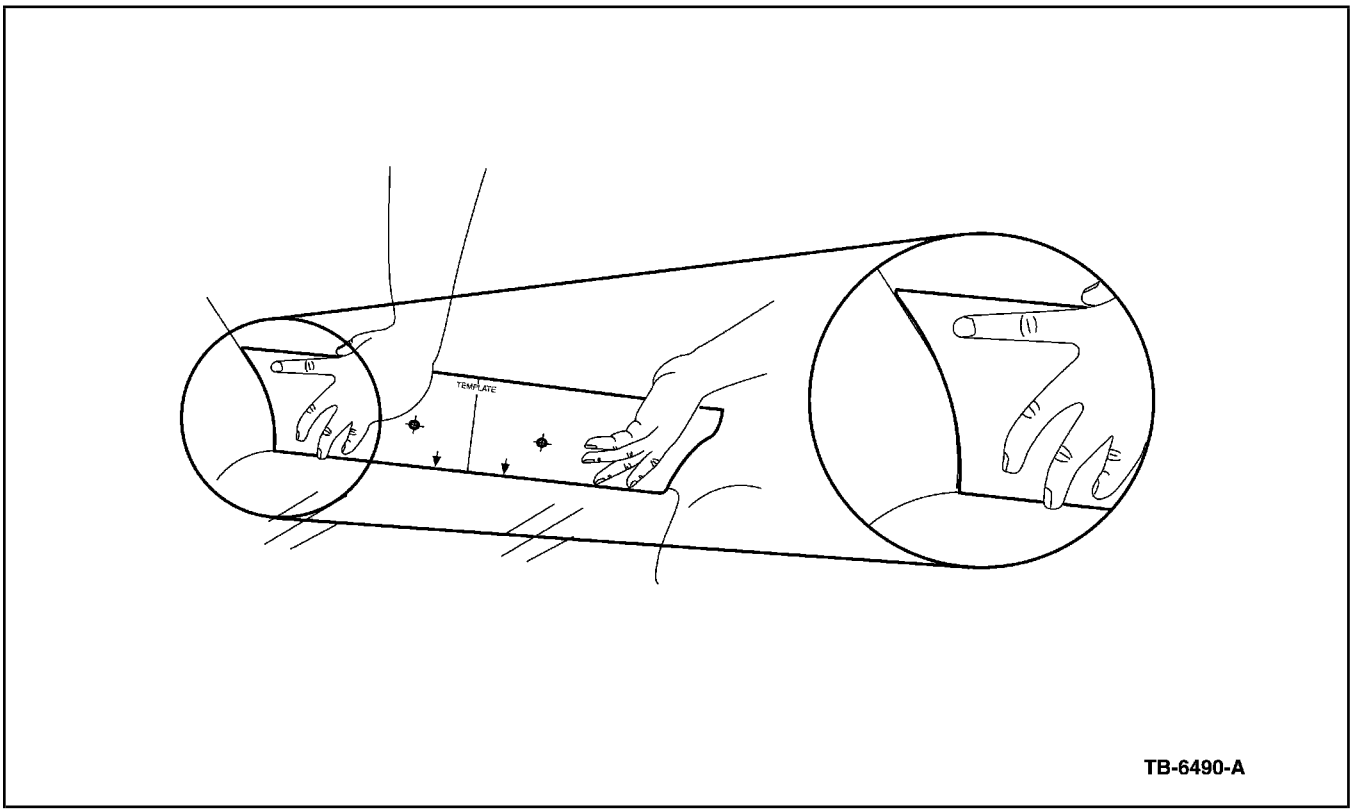


Figure 2 - Article 01-23-7

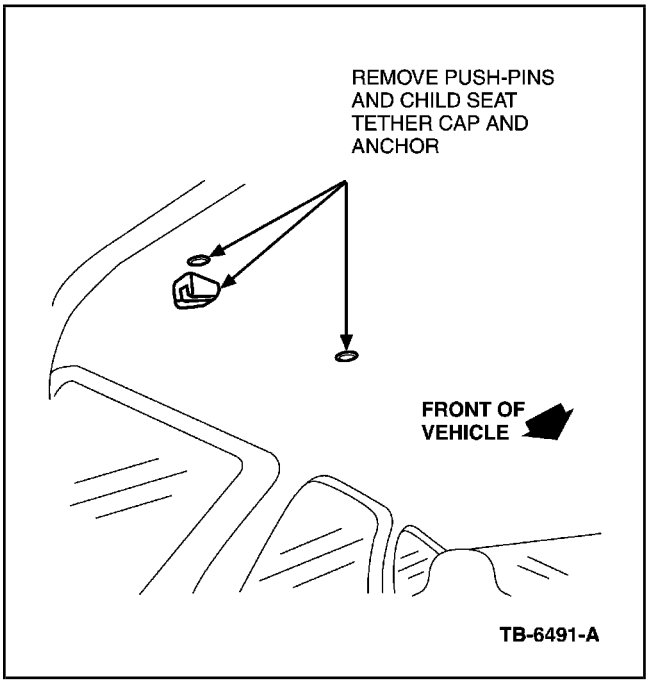


Figure 3 - Article 01-23-7

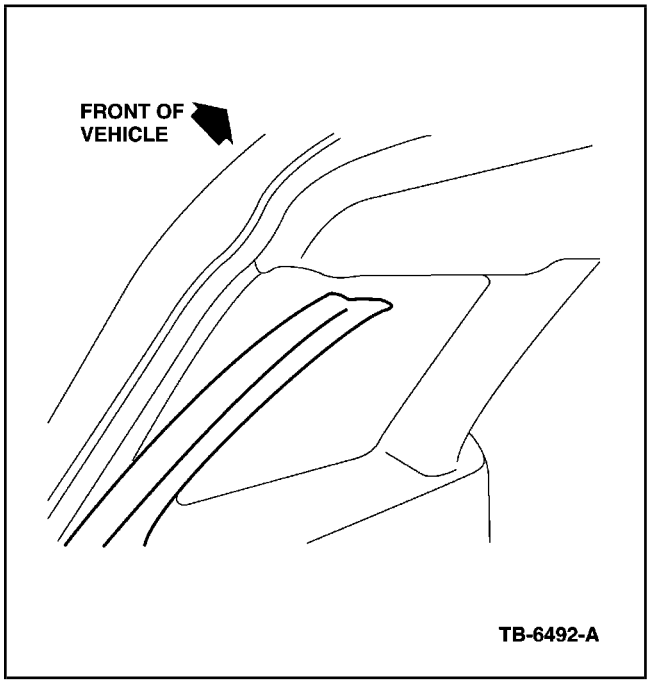


Figure 4 - Article 01-23-7

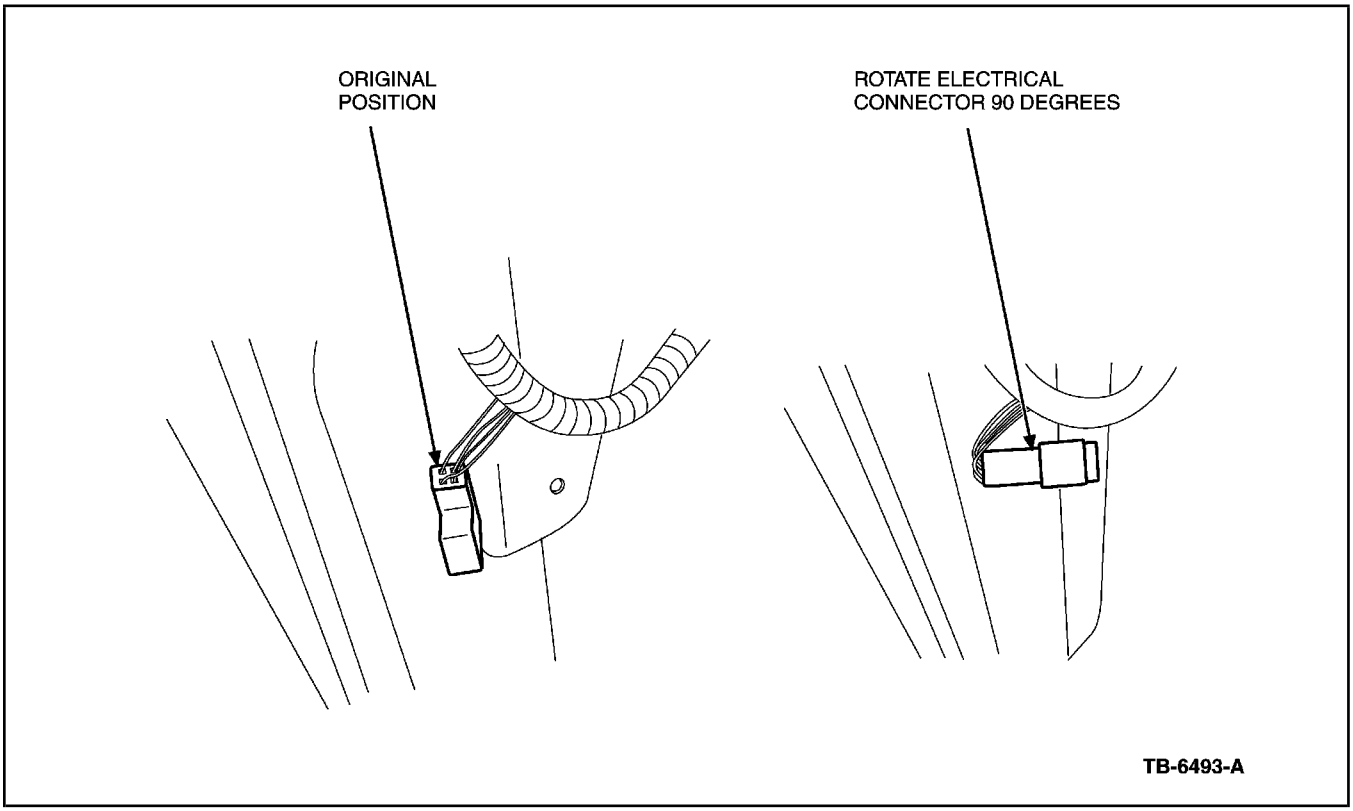


Figure 5 - Article 01-23-7

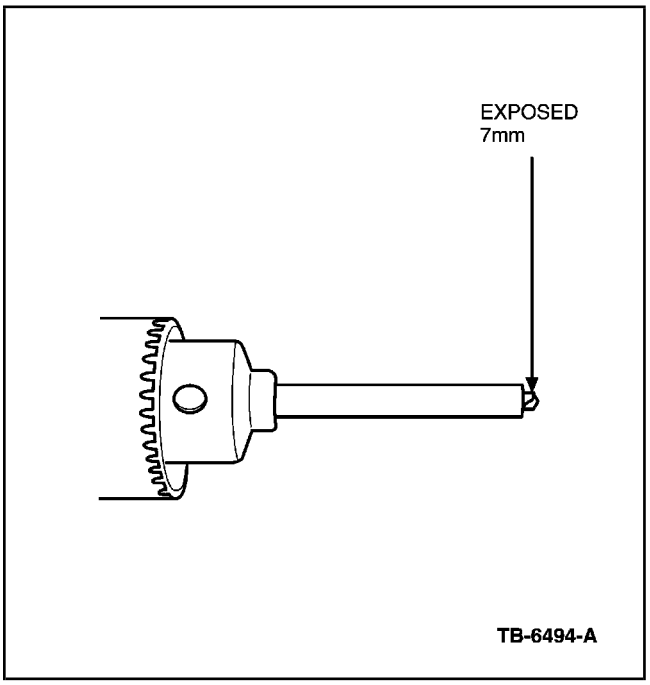


Figure 6 - Article 01-23-7

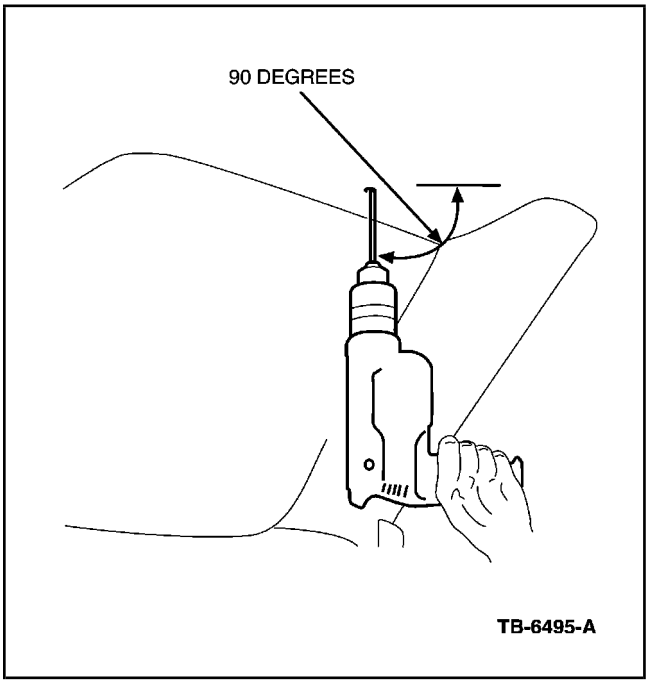


Figure 7 - Article 01-23-7