BRAKE PEDAL POSITION SWITCH WIRE ROUTING INSPECTION AND REPAIR

AFFECTED VEHICLES: CERTAIN 2000 F-53 MOTORHOME CHASSIS

1. Remove the steering column shrouds necessary to gain access to the Brake Pedal Position Switch (BPPS).
2. Inspect the wiring harness to see if it is routed properly. See Figures 1 and 2.
   a) **CORRECTLY ROUTED HARNESS**: The harness retainer (which secures it to the switch) will be installed from the front toward the back and the harness will be routed away from all steering column rotating parts. See Figure 1.
   b) **INCORRECTLY ROUTED HARNESS**: The harness retainer will be installed from the back to the front and the harness will be located very close to (if not touching) the steering column rotating parts. See Figure 2.

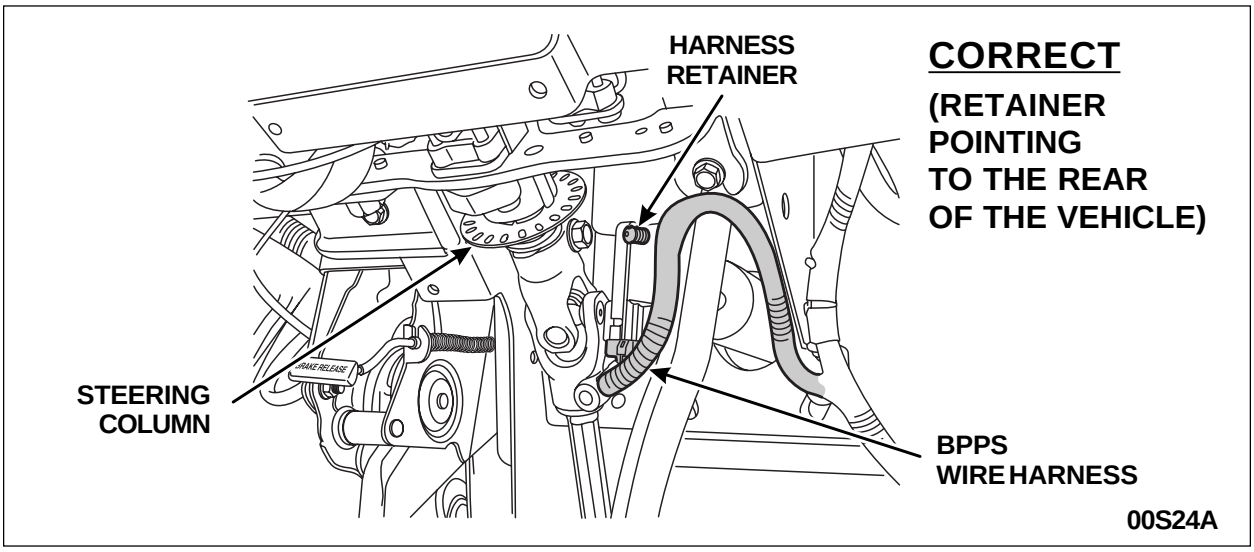


FIGURE 1

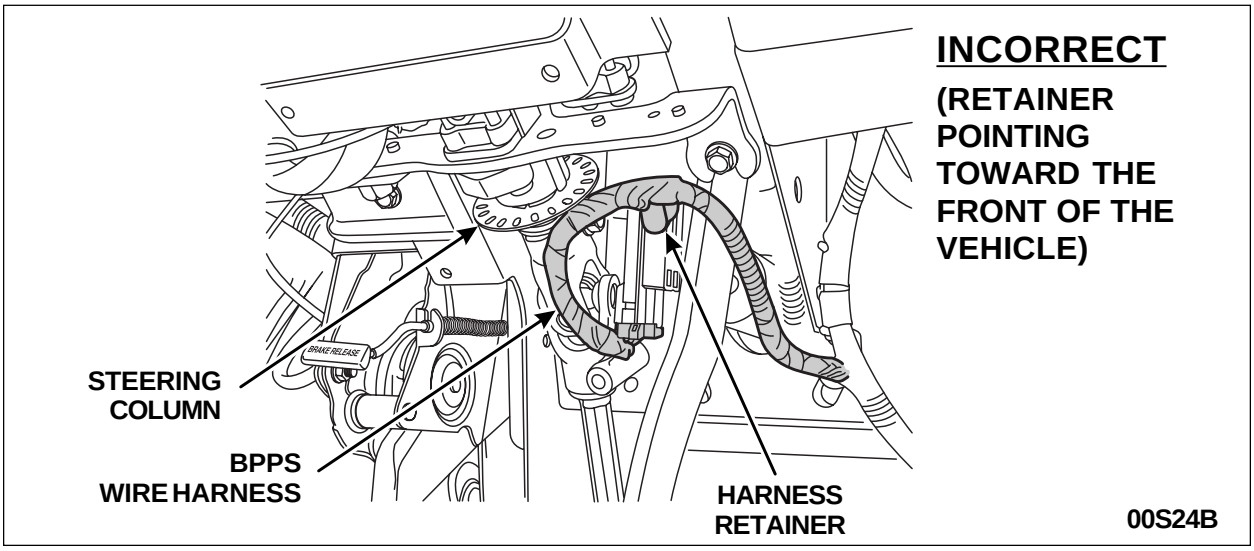


FIGURE 2

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/00

3. If the harness is routed properly, reinstall the steering column shrouds and return the vehicle to the owner.
4. If the harness is routed incorrectly but there is no damage to the harness, detach the retainer from the switch, reposition the wiring away from the steering column and reattach the retainer from the front toward the back. See Figure 1 for proper routing. Reinstall the shrouds and return the vehicle to the owner.
5. If the harness shows signs of damage, disconnect the switch and peel back the tape to reveal the wires. Inspect the wires carefully to determine if any wires need to be repaired.
6. Following standard wire repair procedures, splice any wire that is cut. Repair insulation where needed using standard electrical tape. Refer to TSB 99-22-02 for wiring repair instruction.
7. Check fuse #8 and #9. Replace if necessary. Location of fuse #8 is in the power distribution box located in the engine compartment and #9 is located in the I/P fuse panel.
8. Reinstall all shrouds and return the vehicle to the owner.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/00