- **DIAGNOSTIC TROUBLE CODES (DTCS)—P0351 THROUGH P0354 WITH NO DRIVEABILITY CONCERNS PRESENT—VEHICLES EQUIPPED WITH 5.0L ENGINE ONLY**
- **LAMP—MALFUNCTION INDICATOR LAMP (MIL) ILLUMINATED—DIAGNOSTIC TROUBLE CODES (DTCS) P0351 THROUGH P0354 WITH NO DRIVEABILITY CONCERNS PRESENT—VEHICLES EQUIPPED WITH 5.0L ENGINE ONLY**

Article No. 00-24-5

FORD: 2000-2001 EXPLORER

MERCURY: 2000-2001 MOUNTAINEER

ISSUE

Some 2000-2001 Explorer/Mountaineer vehicles equipped with a 5.0L engine may exhibit a Malfunction Indicator Lamp (MIL) on with Diagnostic Trouble Codes (DTCs) P0351 through P0354 possible with no driveability concerns present. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

If no driveability concerns are present and no other failures are observed during normal diagnosis, reprogram the PCM using a New Generation Star (NGS) Tester or the Worldwide Diagnostic System (WDS) as necessary.

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
Explorer/Mountaineer	XL2F-PE	EQEx	XL2Z-PF	9VAABAH	9VAABAJ	9VAA-BA CALIBRATION

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

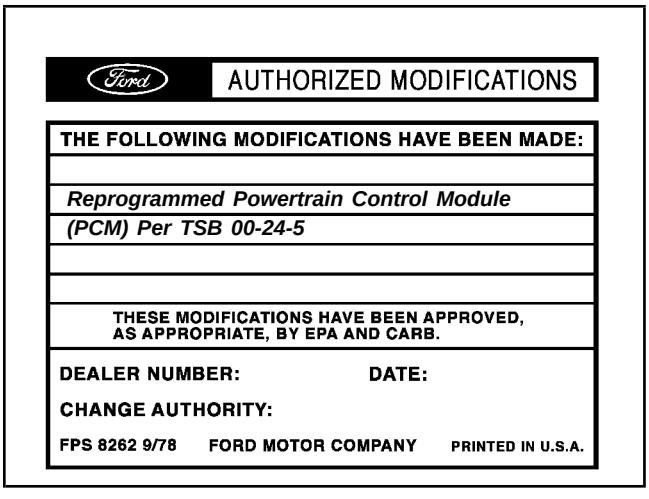

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 698298

Copyright © 2000 Ford Motor Company