INTAKE MANIFOLD INSPECTION/REPLACEMENT

AFFECTED VEHICLES: **1996-2001 MODEL YEAR CROWN VICTORIA POLICE**
1998-2001 MODEL YEAR CROWN VICTORIA TAXI
1998-2001 MODEL YEAR TOWN CAR LIMOUSINE/LIVERY

INSPECTION

1. NOTE: To properly inspect the intake manifold you must look down behind the alternator.

   Inspect the coolant crossover area of the intake manifold as shown in Figure 1 for engine coolant seepage.

   - If seepage **IS** present, the intake manifold **MUST** be replaced. Refer to the appropriate Workshop Manual section 03-01 for 1996 through 1998 model year vehicles and section 303-01 for 1999 through 2001 model year vehicles for replacement procedures for intake manifold.
   - If seepage is **NOT** present, no service action is required.

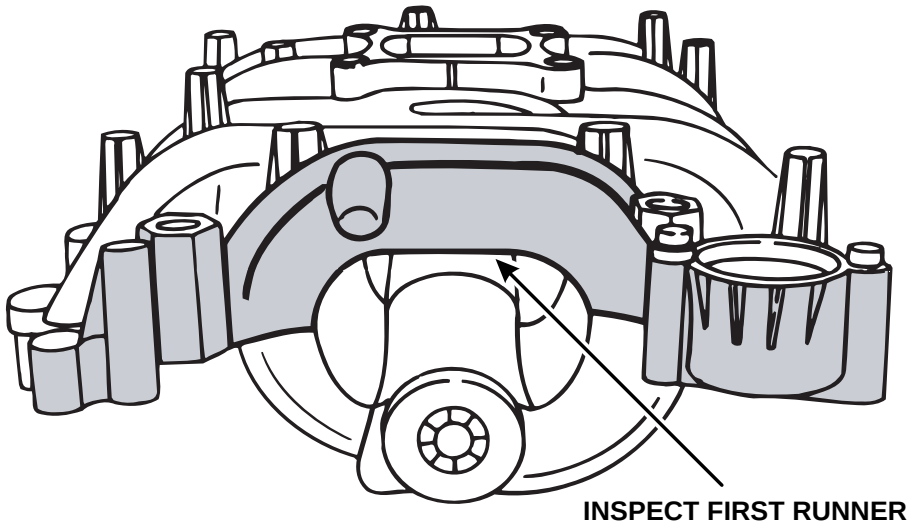

ALTERNATOR REMOVED FOR CLARITY

01M02A

FIGURE 1

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01