- **BODY—LEFT FRONT DOOR WILL NOT STAY OPEN—LOOSE DOOR CHECK STRAP—VEHICLES PRODUCED AT WAYNE ASSEMBLY PLANT BETWEEN 5/22/2002 AND 5/24/2002 ONLY**
- **NOISE—RATTLE NOISE FROM LEFT FRONT DOOR AREA—LOOSE DOOR CHECK STRAP—VEHICLES PRODUCED AT WAYNE ASSEMBLY PLANT BETWEEN 5/22/2002 AND 5/24/2002 ONLY**

Article No. 02-25-10

FORD: 2002 FOCUS

ISSUE

Some vehicles produced at the Wayne Assembly Plant Between 5/22/2002 and 5/24/2002, may exhibit a door that does not stay open due to a loose Door Check Strap Reinforcement Bracket. This is caused by a missing spot weld on the door inner sheet metal.

ACTION

Inspect left front door area around door check strap for damage, or loose door check Strap Reinforcement Bracket. If the door check strap is damaged or loose, refer to the following Repair Procedure for details.

SERVICE PROCEDURE

1. Inspect left front door area around door check strap for damage (Figure 1):
   a. Verify if check strap reinforcement bracket is loose.
   b. Remove door trim panel.
   c. Inspect 5 spot welds between check Strap Reinforcement Bracket and door inner sheet metal (Figure 2).
   d. Inspect for distortion around door inner sheet metal near check Strap Reinforcement Bracket.
   e. Inspect if door check strap is bent or damaged.
2. If damage to door inner is too great (heavy distortion around failed spot welds), replace entire sheet metal door assembly.
3. If damage to door inner is repairable, perform the following steps on damaged/loose/missing spot welds:
   a. Remove door check strap and rubber boot from door.
   b. Drill 5.0 mm diameter pilot holes in door inner and check strap bracket in location of existing damaged/loose spot welds.
   c. Use Flash prime on drilled holes to prevent corrosion.
   d. Use pop rivet P/N W525106-S427 to secure each repaired weld location.
   e. Drill two additional 5.0mm diameter pilot holes through both door inner and check Strap Bracket Reinforcement in locations shown in Figure 3.
   f. Repeat Steps c and d.
   g. Use body color touch-up paint on exposed pop rivets (3 rivets not hidden by door trim panel).
   h. Reinstall check strap and rubber boot.
   i. Cycle door open/closed to verify smooth door operation and check strap alignment.
   j. Reinstall door trim panel.

PART NUMBER	PART NAME
W525106-S427	Rivet - 4 Rivets Per Package (2 Packages Required Per Vehicle)

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Copyright © 2002 Ford Motor Company

Article No. 02-25-10 Cont'd.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
022510A	Inspect And Repair Door	0.9 Hr.
022510B	Inspect And Replace Door	2.2 Hrs.
022510C	Additional Time To Paint For Operation B	2.5 Hrs.
022510P101	Basic Paint Labor Operation - Can Be Claimed Once With Operation B	0.5 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
20124	61

OASIS CODES: 102000, 111000, 112000

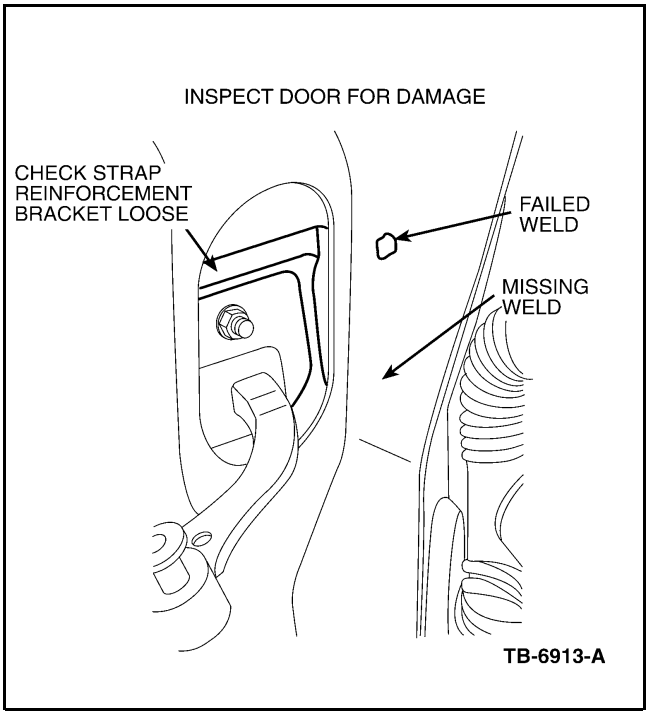


Figure 1 - Article 02-25-10

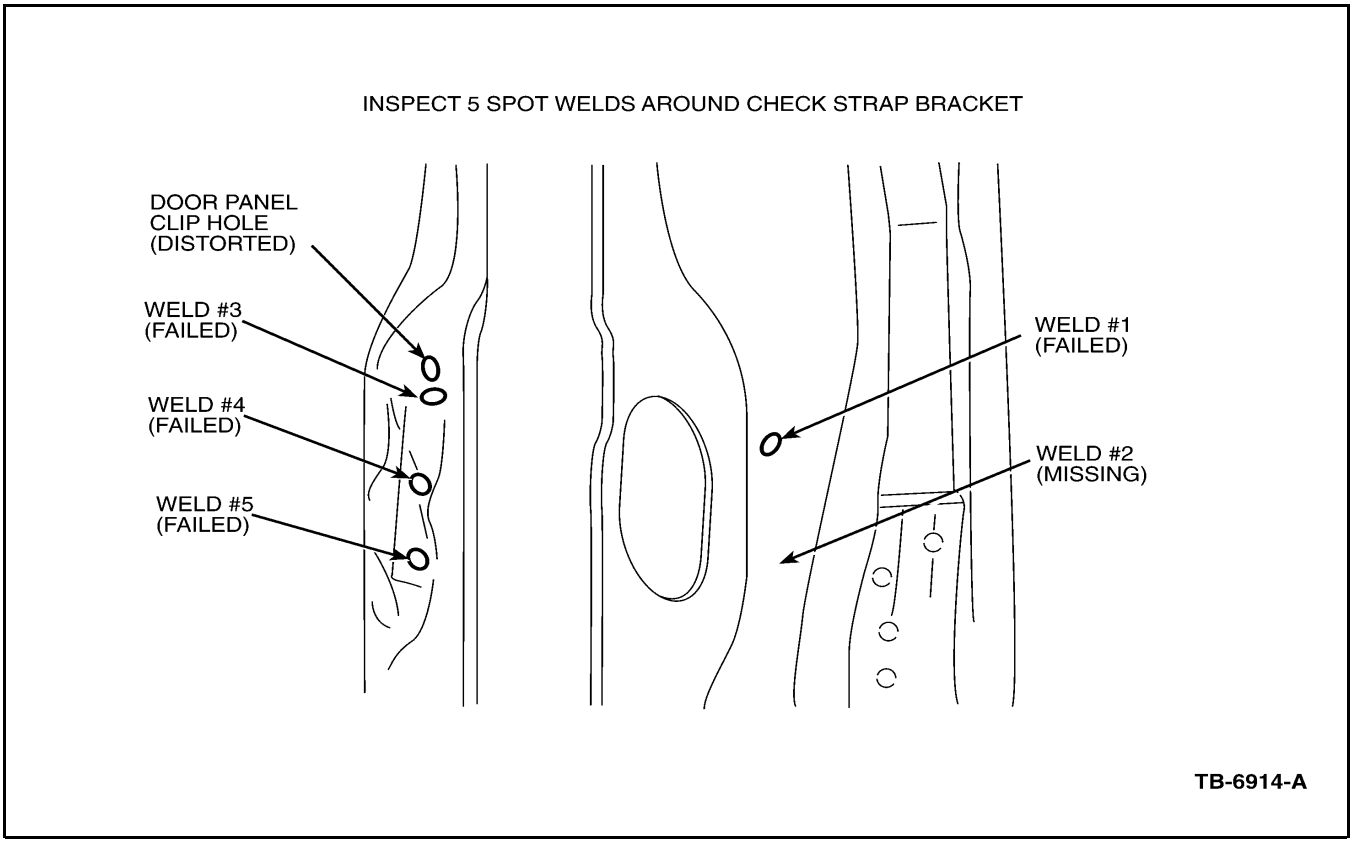


Figure 2 - Article 02-25-10

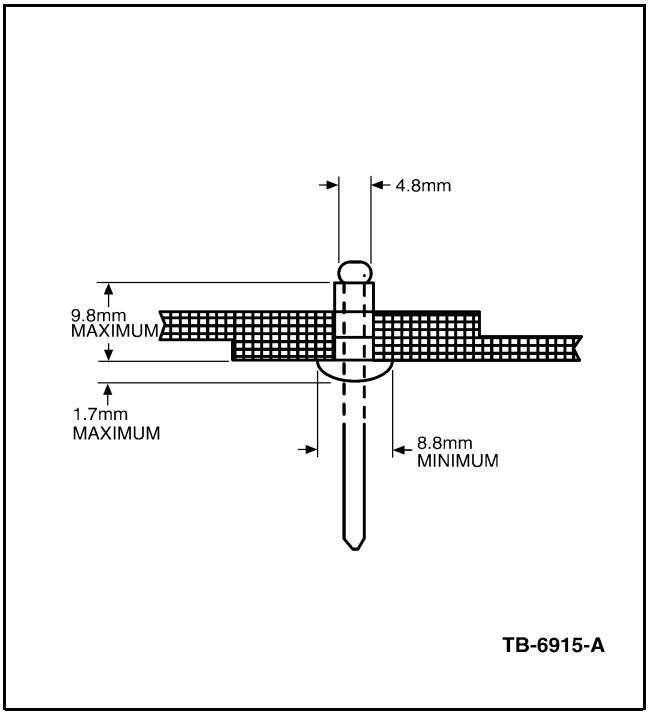


Figure 3 - Article 02-25-10

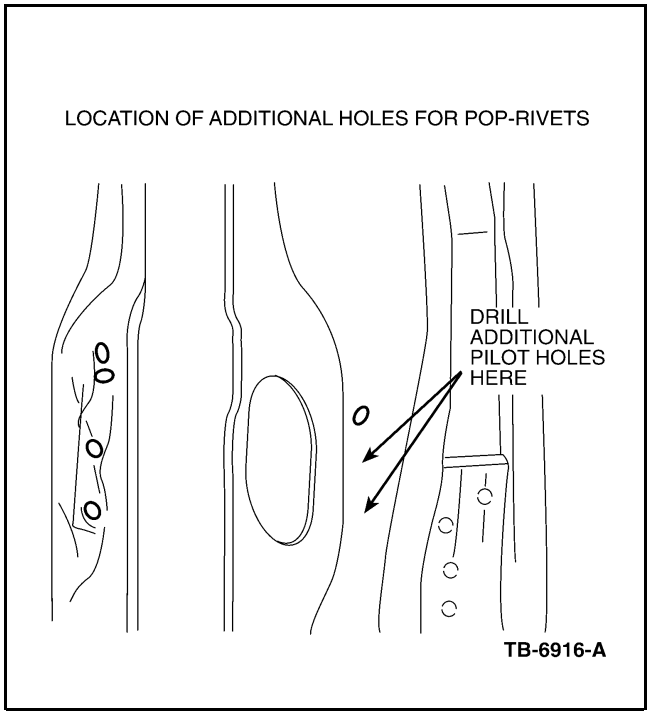


Figure 4 - Article 02-25-10

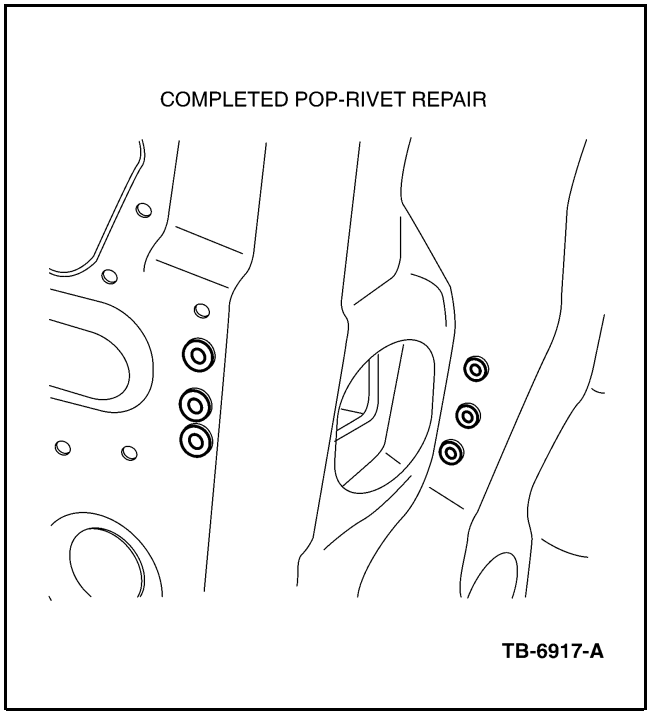


Figure 5 - Article 02-25-10