TRANSMISSION—5R55N—DELAYED REVERSE OR DRIVE ENGAGEMENTS—HARSH UPSHIFTS OR DOWNSHIFTS—ERRATIC UPSHIFTS—DELAYED DOWNSHIFTS NEAR 20 MPH—VEHICLES BUILT BEFORE 10/17/2000	Article No. 01-14-5

LINCOLN: 2000-2001 LS

This article is being republished in its entirety to include additional calibrations and to update the build date range.

ISSUE

Some vehicles built prior to 10/17/2000 with the 5R55N transmission may exhibit delayed Reverse or Drive engagements, harsh upshifts or downshifts, erratic upshifts, or delayed downshifts near 32 km/h (20 mph). This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Follow normal diagnostic procedures and verify the condition. If the condition is valid, reprogram the PCM to latest calibration level. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

If the vehicle is built prior to 10/17/2000 and has the conditions listed and does not have the latest PCM calibration, (see chart) reprogram the PCM. Vehicles built after 10/17/2000 are not affected by this TSB.

1. If the condition is valid, first repair all Diagnostic Trouble Codes (DTCs) that may be present.
2. Determine if the condition is caused by an internal transmission component and repair as required.
3. Clear all DTCs and validate the repair.
4. If the condition is still present or returns after repair, the PCM must be reprogrammed. Refer to the following PCM Calibration Information Chart.
5. Follow the procedures found in the Powertrain Control/Emissions Diagnosis (PC/ED) Service Manual and reprogram the PCM to latest calibration level.
6. After reprogramming has been completed, the transmission adaptive strategy for pressure control on engagements must be updated.
7. Install diagnostic equipment and monitor the Transmission Fluid Temperature (TFT).
8. Warm the transmission fluid to at least 54°C (130°F) as indicated by the TFT.
9. Perform five (5) engagements from Park to Reverse. Each engagement must be 5 seconds apart.
10. Perform five (5) engagements from Drive to Reverse. Each engagement must be 5 seconds apart.
11. Perform five (5) engagements from Reverse to Drive. Each engagement must be 5 seconds apart.
12. Perform five (5) engagements from Neutral to Drive. Each engagement must be 5 seconds apart.

NOTE

ALL OF THESE ENGAGEMENTS MUST BE PERFORMED IN ORDER FOR THE ENGAGEMENT PRESSURES TO PROPERLY ADAPT WITH THE NEW CALIBRATION.

Copyright © 2001 Ford Motor Company

Article No. 01-14-5 Cont'd.

PCM CALIBRATION INFORMATION						
Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
LS - 3.0L, 5R55N	XW4F-JJ	VAV0	XU7Z-TA	9LDA-AAH	9LDA-AAH	WDS B14.3 Release
LS - 3.0L, 5R55N w/SST	XW4F-KH	DYZ0	XU7Z-SA	9LDA-ACG	9LDA-ACG	WDS B14.3 Release
LS - 3.0L, 5R55N	1U7A-JA	MSU1	1U7Z-JB	1LQ16B0507	1LQ16B0507	WDS B14.3 Release
LS - 3.0L, 5R55N w/SST	1U7A-KA	DJY1	1U7Z-KB	1LQ16S0507	1LQ16S0507	WDS B14.3 Release
LS - 3.9L, 5R55N w/SST	1U7A-HA	MFF1	1U7Z-HB	1LQ19S0506	1LQ19S0506	WDS B14.3 Release
LS - 3.9L, 5R55N w/3.31 axle	1U7A-DA	KQI1	1U7Z-DB	1LQ18B0506	1LQ18B0506	WDS B14.3 Release
LS - 3.9L, 5R55N w/3.58 axle	1U7A-GA	KSF1	1U7Z-GB	1LQ19B0506	1LQ19B0506	WDS B14.3 Release
LS - 3.9L, 5R55N 50 States w/SST	1U7A-FA	FMS1	1U7Z-FB	1LQ18S0506	1LQ18S0506	WDS B14.3 Release

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

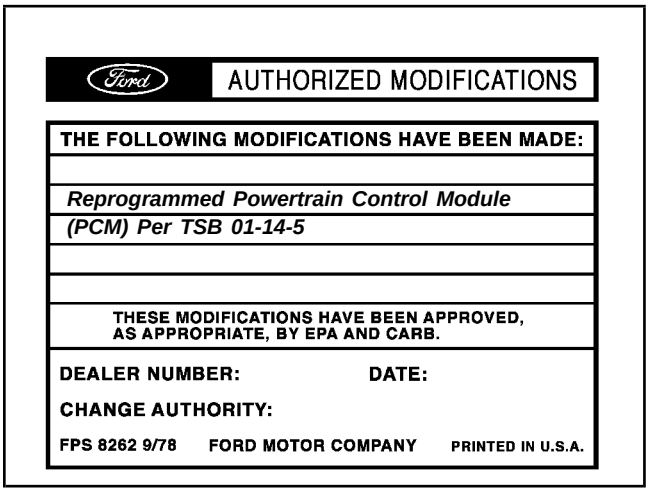

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 01-1-5
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage And Emissions Warranty Coverage

OPERATION	DESCRIPTION	TIME
011405A	Reprogram Powertrain Control Module Then Update Transmission Adaptive Strategy (Includes Time For Final Test Drive)	1.0 Hrs.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECALEM	42

OASIS CODES: 501000, 502000, 503000, 504000