DRIVEABILITY—HESITATION, STUMBLE OR STALL DURING LOW SPEED PARKING MANEUVERS OR AFTER TRACTION ASSIST OPERATION

Article No. 01-20-9

LINCOLN: 1999-2001 CONTINENTAL

ISSUE

Some vehicles may exhibit a hesitation, stumble or stall during low speed parking maneuvers or after releasing the throttle following operation of the traction assist system. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify condition. If normal diagnostics cannot pinpoint the condition, reprogram the PCM with the latest level calibration using the Worldwide Diagnostic System (WDS) or the New Generation Star (NGS) Tester. Refer to the appropriate model year Workshop Manual for PCM reprogramming instructions. Refer to the PCM Calibration Chart for reprogramming information.

SERVICE INFORMATION

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
1999 Continental	XF3F-CD	RWZ2	1F3Z-CC	9VWA-BCD	9VWA-BCD	WDS B13.2 Release or Later
2000 Continental	YF3F-AA	RWZ2	1F3Z-CC	0JC1BN0B10	0JC1BN0B10	WDS B13.2 Release or Later
2001 Continental	1F3F-CA	RWZ2	1F3Z-CC	1JC1BN0500	1JC1BN0511	WDS B13.2 Release or Later
2001 Continental	1F3F-CB	RWZ2	1F3Z-CC	1JC1BN0510	1JC1BN0511	WDS B13.2 Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

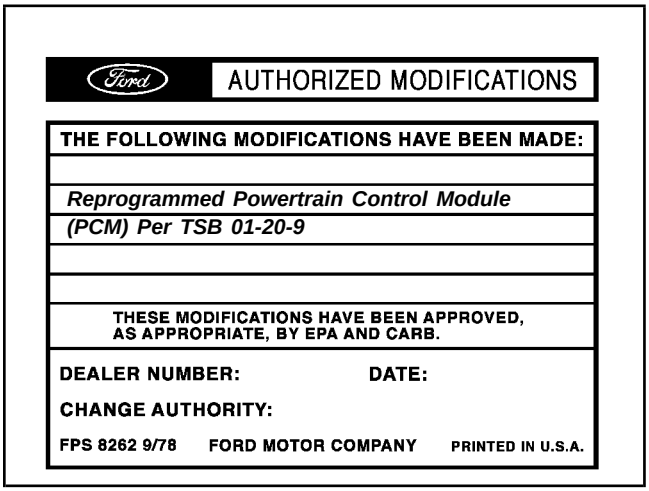

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 607000, 607400, 611000, 611500, 612000, 612500

Copyright © 2001 Ford Motor Company