TRANSMISSION—4R44E—DELAYED OR SLIPPING 1-2 SHIFT AT LIGHT THROTTLE—3.0L ENGINE—VEHICLES BUILT 8/1/99 THROUGH 7/31/00—UPDATED POWERTRAIN CONTROL MODULE (PCM) CALIBRATION	Article No. 00-21-6

FORD: 2000 RANGER

ISSUE

Some vehicles may exhibit a delayed or slipping 1-2 upshift during light throttle. This may be due to insufficient control pressures created by PCM calibration.

ACTION

Verify condition and tear tag information. If the calibration is incorrect the PCM will need to be Reprogrammed with a new calibration. Refer to the following Service Procedure.

Service Procedure

Verify 1-2 delayed or slipping shifts during light throttle. Prior to performing any service procedures, verify tear tag information. Refer to chart. If the calibration is not at the latest level follow Workshop Manual procedures to reprogram PCM calibration. Verify repair, if the condition is not corrected, continue with normal diagnostics and repairs per the Workshop Manual.

Copyright © 2000 Ford Motor Company

Article No. 00-21-6 Cont'd.

PCM CALIBRATION INFORMATION							
Application	**Old Part Number (-12A650-)**	**Old Tear Tag**	**New Part Number (-12A650-)**	**New Tear Tag**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
FED/ALT 4x2 A/T Ranger FFV	YL5F-SA	N/A	YU7Z-UA	XCW0	9LAA-AHK	9LAA-AHK	9LAA-AH cal with module change
FED/ALT 4x4 A/T Ranger FFV	YL5F-TA	N/A	YU7Z-KA	XIF0	9LAA-AJK	9LAA-AJK	9LAA-AJ cal with module change
FED/ALT Troy Lee FFV	YL5F-UA	N/A	YU7Z-LA	DCH0	9LAA-AKJ	9LAA-AKJ	9LAA-AK cal with module change
CALIF 4x2 A/T Ranger FFV	YL5F-VA	N/A	YU7Z-MA	OER0	9LAA-BHK	9LAA-BHK	9LAA-BH cal with module change
CALIF 4x4 A/T Ranger FFV	YL5F-XA	N/A	YU7Z-NA	WAJ0	9LAA-BJK	9LAA-BJK	9LAA-BJ cal with module change
CALIF TROY LEE FFV	YL5F-YA	N/A	YU7Z-PA	OIV0	9LAA-BKJ	9LAA-BKJ	9LAA-BK cal with module change
CAN/MEX 4x2 A/T Ranger Gas	YL5F-AJA	N/A	YU7Z-RA	YYI0	9LAA-MAJ	9LAA-MAJ	
CAN/MEX 4x4 A/T Ranger Gas	YL5F-AKA	N/A	YU7Z-SA	XWD0	9LAA-MBJ	9LAA-MBJ	
CAN/MEX TROY LEE Gas	YL5F-RA	N/A	YU7Z-TA	GXK0	9LAA-MCH	9LAA-MCH	
MEX 4x2 w/94mph Speed Limiting	XU7A-DA	N/A	XU7Z-DB	RDV1	9LAA-MAG	9LAA-MAG	

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

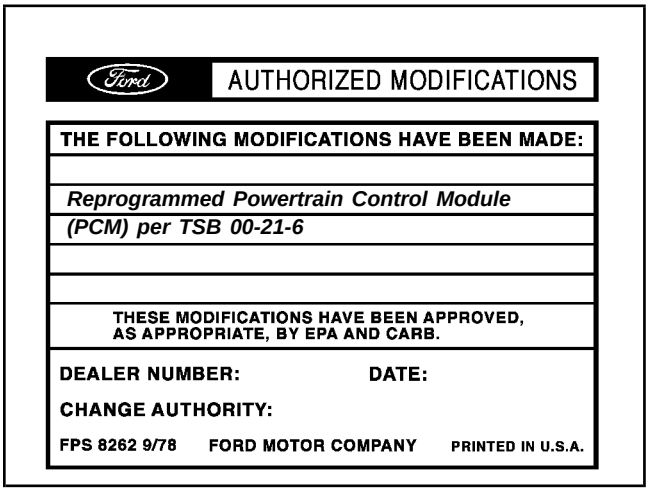

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage And Emissions Warranty Coverage

OPERATION	DESCRIPTION	TIME
002106A	Verify Customer Concern, Reprogram PCM, And Verify Repairs	1.0 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
12A650	42

OASIS CODES: 504000