SSI	Number 02T07-S1	DEMONSTRATION / DELIVERY HOLD **Parts Update** **RE: Upgrade Certain 2002 Model Year Windstar Vehicles Prior to Sale**

Date: March 2002

Model Year	Model	Assembly Plant	Vehicle Build Date Range	Coverage Terms
2002	Windstar	Oakville	Certain vehicles built from March 1, 2002 through March 11, 2002	Through applicable new vehicle warranty coverage only (3/36)

OASIS Activation	Yes, you must use OASIS to determine if a vehicle is eligible for this Special Service Instruction.
Involved Unit Listing	Yes, list will include in-stock units identified by Ford Motor Company as of the date this SSI was issued. Promptly correct all affected in-stock units, as identified on your dealer Online Involved Unit Listing available on QCDealer.com. **NOTE:** Some of the VINs on your Online Involved Unit Listing may not require repair because approximately 20% of the affected vehicles will be repaired at the plant. Therefore, please check OASIS before performing any repairs.
Rental Vehicles	Rental vehicle coverage is not approved for this SSI.

Issue

On all affected vehicles, an incorrect hose clamp is installed on the fuel tank filler hose that connects to the fuel tank. This condition may cause fuel odors or a MIL light to illuminate.

Action

On all affected vehicles, dealerships are instructed to remove existing hose clamp and install hose clamp with part number N808860S1. The hose clamp must be torqued to 3.6Nm. (See Technical Instructions on next page.)

Claims Preparation and Submission	**Note:** Please prepare and submit claims on the ACESII **warranty** screen rather than the ACESII recall screen.
	• Enter claims using DWE.
	• Refer to ACESII Manual for claims preparation and submission information.
	• Use code information shown below:
	  • Claim Code – 02T07
	  • Causal Component – 9170
	  • Condition Code – 79
	  • Labor Operation – See Labor Allowances (Page 2)
	  • Customer Concern Code – E68

© Copyright 2002 Ford Motor Company

Labor Allowances	Description	Labor Operation	Labor Time
	Remove and replace hose clamp at fuel tank filler hose.	02T07B	0.2 Hours

Part Requirements	Quantity	Description	Part Number
	1 per vehicle	Hose Clamp	N808860S1 (Single Clamp) (Part Number N808860-S is now obsolete.)
Part Availability	Dealerships with identified vehicles will have the hose clamp seed stocked to their dealerships beginning 3-20-02. If additional parts are required, contact the Special Service Support Center at 1-800-325-5621. DOR/COR Number 50277		

Questions?	
	Claims Information: 1-800-423-8851 Special Service Support Center: 1-800-325-5621

Technical Instructions	
	1. Raise the vehicle. 2. Completely unscrew the clamp and remove it from the fuel filler hose. 3. Install the new clamp and tighten it to 3.6 Nm (32 lb-in.). 4. Lower the vehicle. 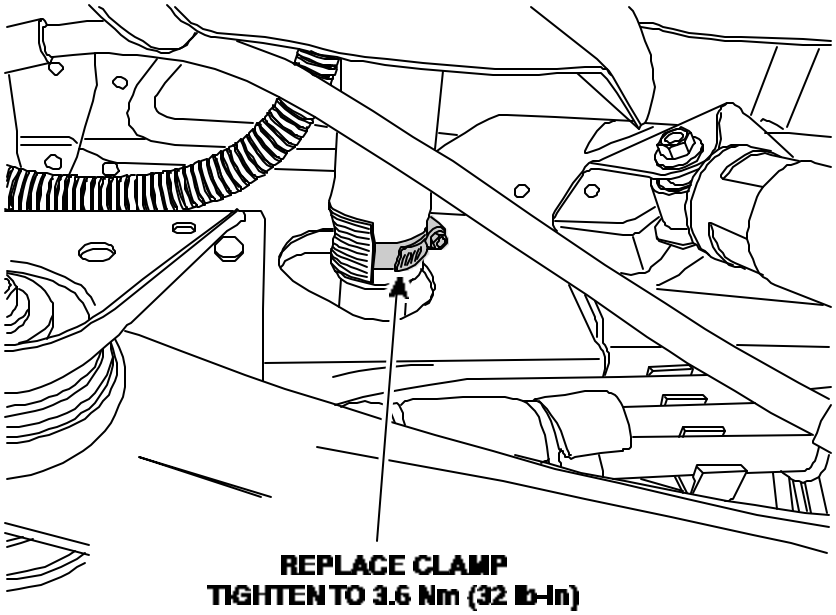

© Copyright 2002 Ford Motor Company