SUSPENSION—CNG EXTENDED RANGE VEHICLES SITTING LOW IN REAR	Article No. 02-18-6

FORD: 1998-2002 CROWN VICTORIA

ISSUE

Some CNG Extended Range vehicles may appear to sit low in the rear. This may be caused by the rear springs.

ACTION

Replace the existing springs with revised springs. The revised springs provide a higher ride height at curb weight and reduce the possibility of the rear being too low. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Verify that the vehicle is low in the rear by measuring the ride height “D” dimension, at curb height. At curb conditions the vehicle should have full fluids but no additional weight of passengers or instrumentation.
2. To properly measure ride height, pull the vehicle onto an alignment rack, place the transmission in park, and do not set the parking brake. Pull the pins constraining the wheel pads then bounce the vehicle four times with amplitude of two inches per bounce to neutralize the suspension. If you do not have an alignment rack with floating wheel pads, you must roll the vehicle (forward or backward) four feet before you bounce the vehicle. Measure the ride heights as defined in the following steps.

For rear ride heights:

a. Measure from the top of the axle tube to the underside of the frame (Figure 1).

b. The rear ride height measurement should be 5.2 inches (+/- .3) or 137 mm to 153mm.

c. If below specification, Replace rear springs with updated part D9AZ-5560-AE.

Follow the spring removal and installation procedure found in the Workshop Manual Section 204-02-29.

3. After completion, remeasure the ride height to verify repair.

PART NUMBER	PART NAME
D9AZ-5560-AE	Rear Spring

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 304000, 305000

Copyright © 2002 Ford Motor Company

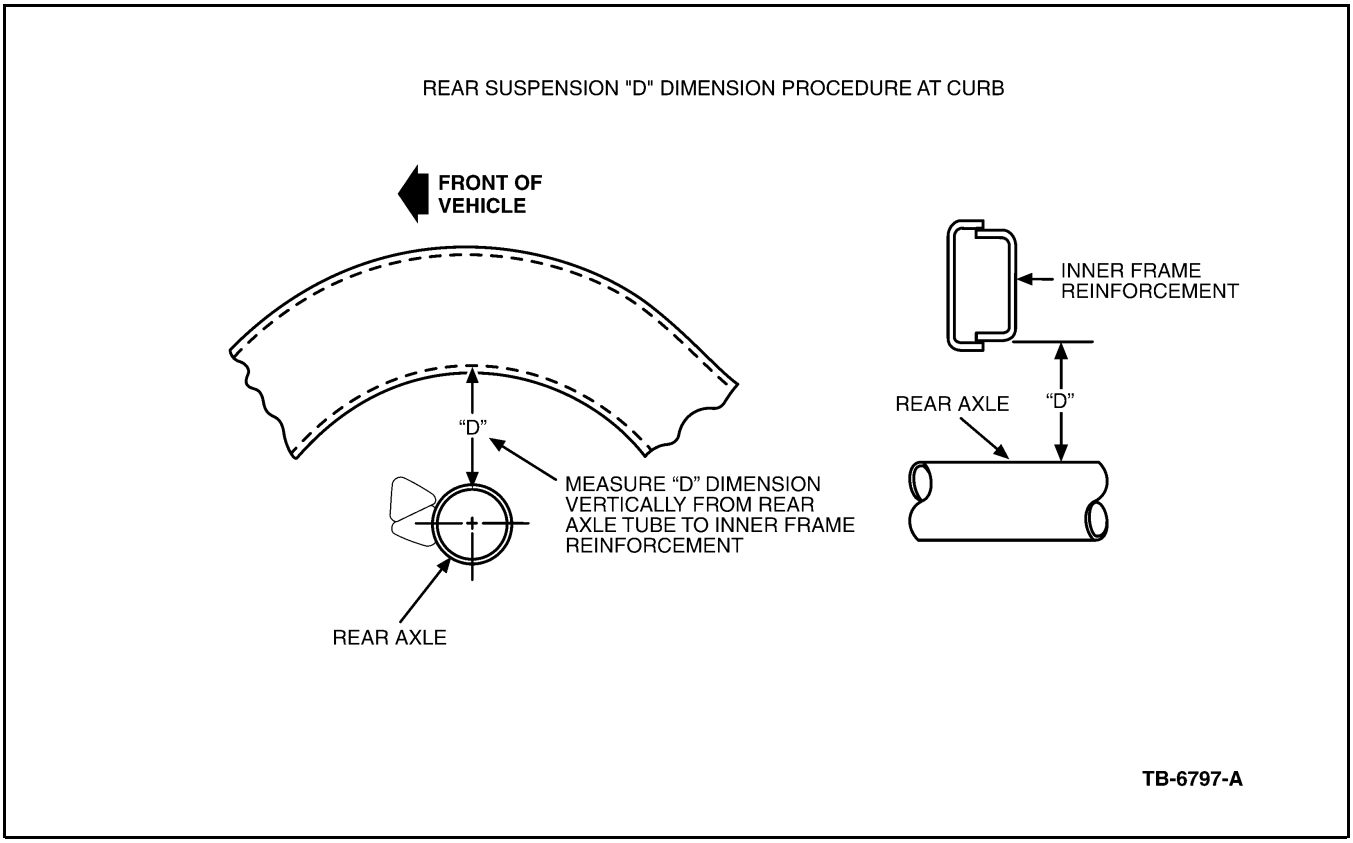

Figure 1 - Article 02-18-6

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.