CLUTCH—CLUTCH PEDAL GOES TO FLOOR— CLUTCH WILL NOT FULLY DISENGAGE	Article No. 02-6-1

FORD: 1999-2002 F-650, F-750

ISSUE

Some vehicles may exhibit a clutch that does not disengage, and/or clutch pedal sits on floor. This may be caused by the Clutch Pedal Return Spring and the Clutch Pedal adjustment.

ACTION

Inspect hydraulic clutch system for any hydraulic fluid leaks, and repair leaks prior to proceeding. Install new Clutch Spring 2C4Z-7523-AA and check and adjust Clutch freeplay adjustment. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

This is a two person procedure. One person is needed in the cab to depress the clutch, one person is needed to adjust the clutch return screw under the vehicle. This screw is located at the end of the fork lever on the left side of the transmission.

Inspect hydraulic clutch system for any hydraulic fluid leaks, and repair leaks prior to proceeding. If no leaks are found, then obtain 0.020 inch feeler gauge. Also obtain spring 2C4Z-7523-AA. Remove old clutch lever return spring YC3Z-7523-AA and measure free play gap between clutch pedal adjustment screw, and screw stop (gap when fork lever touches the throwout bearing). If this gap is 0.530 +/- 0.030 inch then install clutch pedal return spring 2C4Z-7523-AA. If this gap is not within specification, loosen nut and back out adjustment screw until it measures 0.530 +/- 0.030 inch (Figure. 1). Install clutch pedal return spring 2C4Z-7523-AA.

Remove transmission vent plate on bottom of transmission bell housing. Place a 0.020 inch feeler gauge between throwout bearing and transmission nose (Figure 2). Depress clutch pedal fully twice and hold to the positive down stop. If feeler gauge is still held firmly between throwout bearing and transmission nose, back out adjustment screw another 1/2 turn.

NOTE

IT IS CRITICAL TO ALIGN THE FEELER GAUGE SO IT IS PARALLEL TO THE BEARING FACE. FAILURE TO DO THIS WILL RESULT IN AN INCORRECT ADJUSTMENT.

If the feeler gauge is loose between bearing and trans nose, release the pedal, turn adjustment screw in (to the right) 1 (one) turn and depress clutch pedal fully to the positive down stop. Repeat this procedure until the gap is 0.020 +/- 0.005 inch between the bearing and the trans nose. Tighten nut on adjustment screw and reinstall transmission vent plate.

PART NUMBER	PART NAME
2C4Z-7523-AA	Clutch Spring

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 01-14-4
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
020601A	Replace Clutch Spring Then Check And Adjust Clutch Freeplay	0.5 Hr.

Copyright © 2002 Ford Motor Company

Article No. 02-6-1 Cont'd.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7523	42

OASIS CODES: 505000, 505200, 506000, 590000

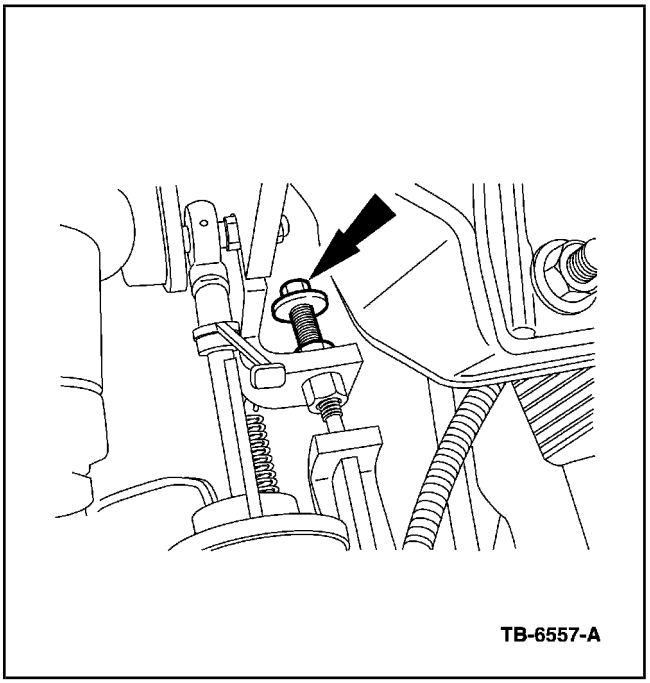


Figure 1 - Article 02-6-1

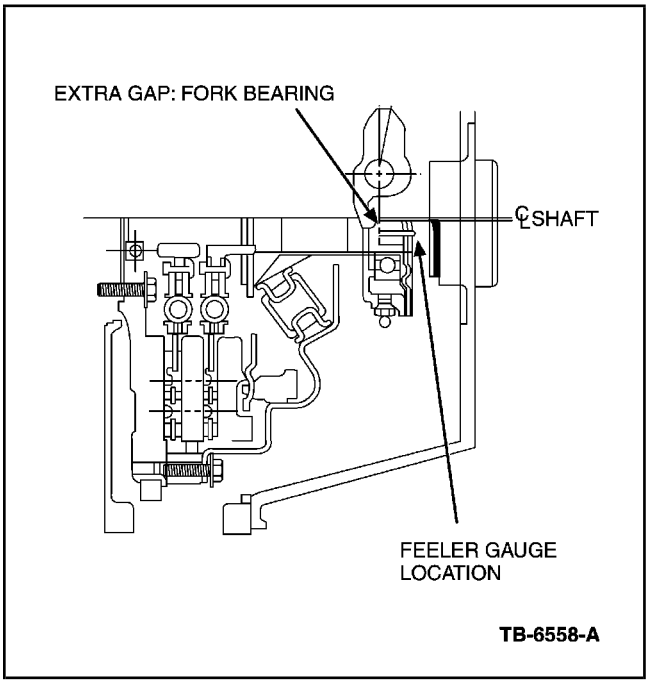


Figure 2 - Article 02-6-1