Ford Motor Company

March 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Safety Recall 01S02: Certain 1999 - 2000 Model Year Cougar Vehicles – Battery Cable Routing/Retention

AFFECTED VEHICLES

Certain 1999 - 2000 model year Cougar vehicles equipped with V6 engines and built at AAI from Job #1 1999 through September 18, 2000.

SAFETY CONCERN

Some of the affected vehicles may have been assembled with a misrouted battery cable, and/or a loose connection at the alternator B+ stud. These conditions create a risk of an electrical short, that may result in electrical system malfunction, and potentially an under hood fire.

SERVICE ACTION

Dealers must inspect the battery cable routing and the B+ terminal stud nut torque on the vehicles involved in this recall. Dealers are to torque and reroute the cable as necessary. If however, it is found that damage exists on the cable, the cable is to be replaced.

PLEASE NOTE

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to $5,000 per vehicle.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……..……...1-800-423-8851
Other (Dealer Only) Recall Questions:……..……...1-800-325-5621

Sincerely,

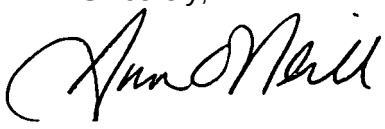

Ann O'Neill
Director
Vehicle Service and Programs

Safety Recall 01S02
Certain 1999 - 2000 model year Cougar vehicles equipped with V6 engines
Battery Cable Routing/Retention

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PROMPTLY CORRECT

Promptly correct all affected vehicles in your dealer Recall/ONP Involved Unit Listing available on QCDealer.com or in the Ford Dealer Consolidated Communicator (FDCC). Also, correct other eligible vehicles that are brought to your dealership.

DEALER-OWNER CONTACT

Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

REGIONAL CONTACT

Advise regional office if an owner:

- cannot be contacted.
- does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

RENTAL CARS

Rental vehicles are not approved for this program.

Safety Recall 01S02
Certain 1999 - 2000 model year Cougar vehicles equipped with V6 engines
Battery Cable Routing/Retention

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Inspect Battery Cable Routing/Retention	01S02A	0.3 Hours
Inspect Battery Cable Routing/Retention and Install Clip	01S02B	0.5 Hours
Re-route Battery Cable (Includes Inspect Battery Cable Routing/Retention and Install Clip)	01S02C	0.6 Hours
Replace Battery Cable	01S02D	1.4 Hours
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this recall. Order your parts requirement through normal order processing channels as noted below:

All Orders	Before April 2, 2001	Call 1-800-325-5621
All Orders	After April 2, 2001	Normal order process

Part Number	Description	Quantity
XS8Z-14300-KB	Cable – Battery to Starter Motor	1

PLEASE NOTE: IT IS ANTICIPATED THAT A MINIMUM NUMBER OF VEHICLES (LESS THAN 5%) WILL REQUIRE REPLACEMENT OF THE BATTERY CABLE OVER THE LIFETIME OF THE PROGRAM.

Safety Recall 01S02
Certain 1999 - 2000 model year Cougar vehicles equipped with V6 engines
Battery Cable Routing/Retention

DOR/COR NUMBER

DOR/COR Number 50219 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

March 2001

01S02

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that a defect which relates to motor vehicle safety exists in certain 1999 - 2000 model year Cougar vehicles equipped with V6 engines.

What the safety issue is …	Your vehicle may have been assembled with a misrouted battery cable, and/or a loose connection at the alternator B+ stud. These conditions create a risk of an electrical short, that may result in electrical system malfunction, and potentially an under hood fire.
What Ford Motor Company and your dealer will do ...	Dealers must inspect the battery cable routing and the B+ terminal stud nut torque on your vehicle. Dealers will re-torque the stud and reroute the cable as necessary. Damaged cables will be replaced. Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer to have this service performed.
How long will it take?	The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.
What we are asking you to do …	Call your dealer without delay. Ask for a service date and whether parts are in stock for Safety Recall 01S02. If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering. When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

If you've already paid for this service …

If you paid to have this service done before the date of this letter, Ford is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle …

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealerships Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8am - 11pm
Saturday: 9am - 6pm

or you may contact us through the Internet at:
www.ownerconnection.com
Our current response time to Internet inquiries is three business days.

You also may send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline 1-800-424-9393 or 1-888-327-4236.


Quality Care service is there for you all year round.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,

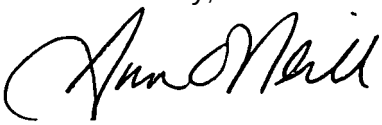

Ann O'Neill
Director
Vehicle Service and Programs