Service Recall Bulletin

March 2000

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: **Safety Recall 00S01:** Certain 2000 Model Year Ford Windstar Vehicles – Windshield and/or Liftgate Glass Replacement

AFFECTED VEHICLES

Certain 2000 Model Year Ford Windstar vehicles built between August 11, 1999 and September 19, 1999.

REASON FOR RECALL

In some of the affected vehicles, the urethane adhesive on the windshield and/or liftgate glass may not properly retain the glass. If the windshield or liftgate glass is not properly retained to the body, wind noise or water leaks may occur. In the event of an accident, an increased risk of personal injury may exist.

INSTRUCTION TO VEHICLE OWNERS

Vehicle owners have been instructed to call their dealer to establish a service appointment.

SERVICE ACTION

Dealers will replace the liftgate glass on all affected vehicles and the windshield glass on some affected vehicles. In all cases, the dealer will use Essex urethane installation kit # 59202 to adhere the glass to the vehicle.

The urethane adhesive used in this repair requires 24 hours cure time at 70 degrees F. (after application) before the vehicle can be driven.

ATTACHMENTS

Attachment I:	Administrative Information
Attachment II:	Labor Allowances and Parts Ordering Information
Attachment III:	Technical Information

QUESTIONS?

Claims Information:.....1-800-423-8851
Other (Dealer Only) Recall Questions:.....1-800-325-5621

Sincerely,

Ann O'Neill
Director
Vehicle Service and Programs

Safety Recall 00S01
Certain 2000 Model Year Ford Windstar Vehicles
Windshield and/or Liftgate Glass Replacement

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PLEASE NOTE

Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to $1,100 per vehicle.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII Manual for claims preparation and submission information.
- Refer to your Warranty and Policy Manual Section 3 for glass claims procedures
- Submit only one claim per vehicle repaired referencing program number 00S01

OWNER REFUNDS

Ford Motor will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer.) Refer to ACESII user manual for refund information.

RENTAL CARS

Car rental is approved for this program while the vehicle is being repaired. Vehicles repaired under this program must be kept inside at a temperature of at least 70 degrees F. for minimum 24 hours after the repair is completed to allow the urethane adhesive to cure. Ford Motor Company will pay for a rental car for up to two days, except for fuel, which will be at owner's expense. Enter the word "LOANER" plus the number of days the vehicle was used in the Miscellaneous Expense area. Follow ESP cost guidelines.

Safety Recall 00S01
Certain 2000 Model Year Ford Windstar Vehicles
Urethane Replacement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Replace liftgate glass only	00S01B	1.4 Hours
Replace windshield and liftgate glass	00S01C	2.7 Hours
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour

PARTS REQUIREMENTS

PLEASE NOTE:

- **This repair requires a unique urethane installation kit, Essex product # 59202 when replacing the windshield and/or liftgate glass.**
- **Do not use ordinary urethane for this Safety Recall program.**
- **The Essex urethane installation kit required for this program is not intended for use in any other application.**
- **Refer to the Process Flowchart on page two (2) of this attachment for ordering details.**

PARTS ORDER INSTRUCTIONS

You must order the Essex urethane installation kit and replacement glass through Carlite at 1-877-367-3452. Be prepared to provide the owner name and complete VIN of each affected vehicle that you wish to repair. Advise Carlite that you are calling in regard to Ford Safety Recall 00S01 for Windstar glass replacement. Carlite will validate the VIN and advise you if the vehicle requires both liftgate and windshield or liftgate glass only.

Please note the number of kits and pieces of glass that will be shipped. You will need this information later to confirm that all parts have arrived at your dealership before scheduling the vehicle for repair.

PARTS SHIPMENT

The appropriate quantity of Urethane Installation Kit(s) and glass will be shipped from separate locations to your dealership and will be delivered by different carriers. A label displaying the VIN of the affected vehicle and owner name will appear on each piece of glass and urethane kit shipped to assist you in tracking the parts at your dealership.

PARTS ARRIVAL AND SERVICE APPOINTMENT SCHEDULING

All parts should arrive approximately three to five business days from the date of order. Confirm that all parts have arrived at your dealership prior to calling Carlite to schedule an installation date. Typically, you can expect an authorized Carlite installer to schedule an appointment within two days of your request.


DEALER PRICE

Refer to your:

- DOES II
- Updated price book

Safety Recall 00S01
Certain 2000 Model Year Ford Windstar Vehicles
Windshield and/or Liftgate Glass Replacement

PROCESS FLOWCHART

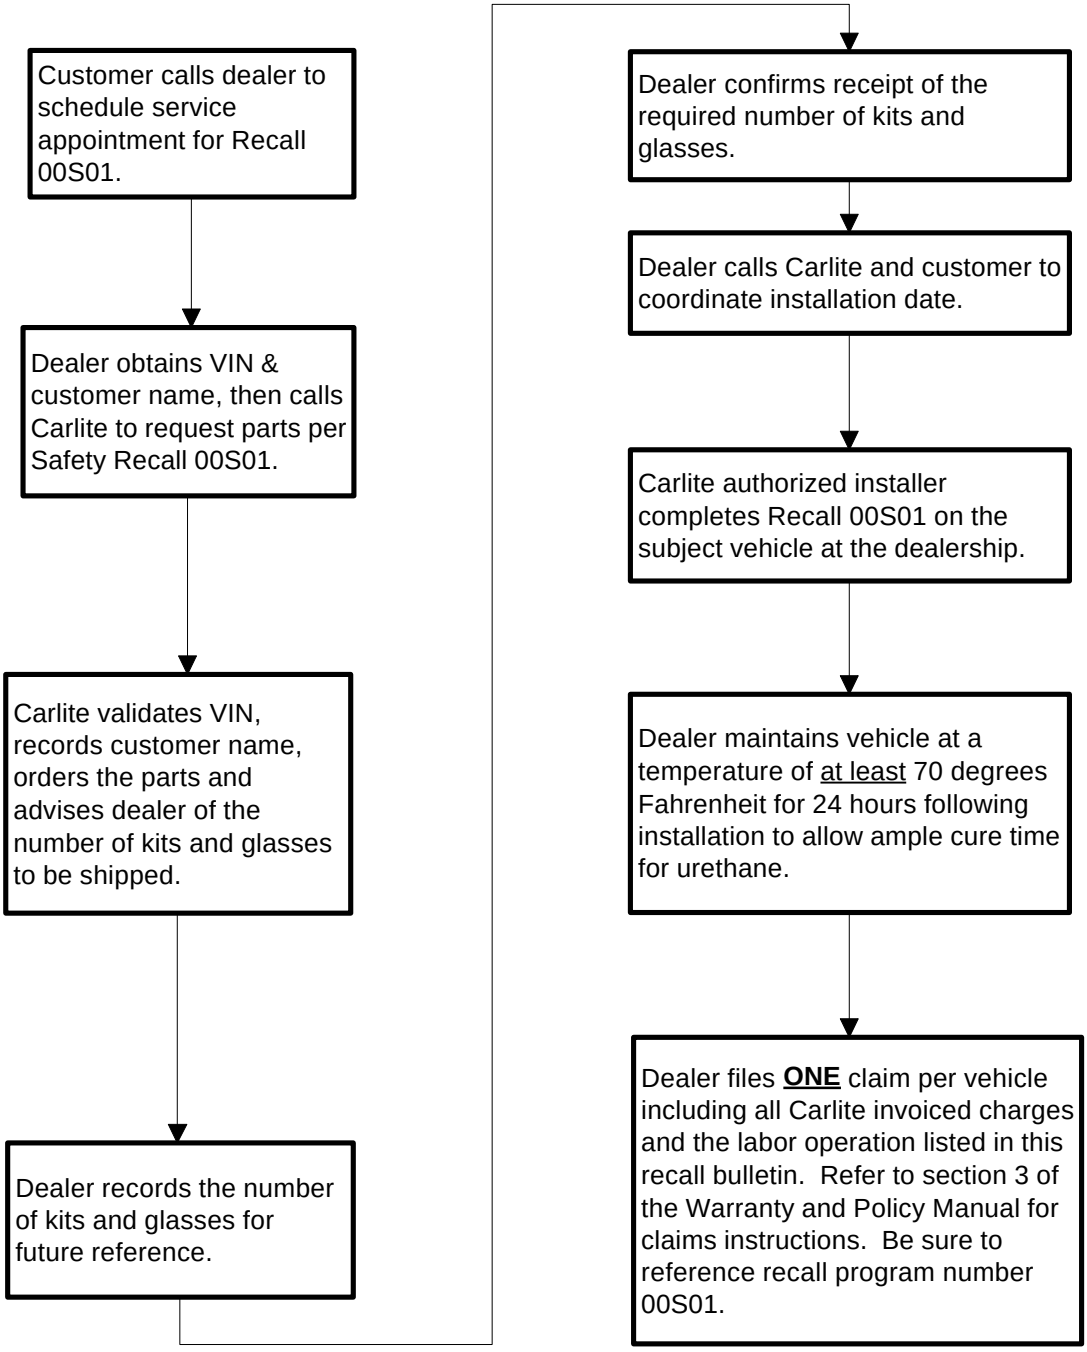

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673
www.ownerconnection.com

March 2000

Your Vehicle Identification Number: 12345678901234567
00S01

Dear Mr. John Sample:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that **a defect that relates to motor vehicle safety exists** in certain 2000 Model Year Ford Windstar vehicles.

We apologize for this situation and, want to assure you that with your assistance we will correct this condition. Our commitment, together with Ford and Lincoln Mercury dealers, is to provide you with the highest level of service and support possible.

What the issue is…	In some of the affected vehicles, the adhesive on the windshield and/or liftgate glass may not properly retain the glass to the body. If the windshield or liftgate glass is not properly retained to the body, wind noise or water leaks may occur. In the event of an accident, an increased risk of personal injury may exist.
What *Ford Motor Company* and your dealer will do…	***Ford Motor Company* will repair your Ford Windstar free of charge (parts and labor).** Dealers will install a new liftgate glass and windshield glass if necessary.
What we are asking you to do…	**Contact your dealer right away** to schedule a service appointment. Your dealer will need to order the parts before scheduling your service date. Actual work time to repair your vehicle is less than three hours. However, the adhesive used requires 24 hours (after application) to cure before your vehicle can be driven. **Please be prepared to leave your vehicle at the dealership overnight.**
Rental Cars	In order to minimize customer inconvenience, Ford Motor Company will provide or pay for a loaner or rental vehicle, except for fuel, which will be at the owner's expense, while having this service performed.
If you've already paid for this service…	If you have already paid for this service prior to the date of this letter, Ford Motor Company will provide you a full refund. *Please provide your receipt to your Ford or Lincoln Mercury dealer for refund processing*.
If you've changed address or sold the vehicle…	Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns…

If you have trouble getting your vehicle repaired promptly and without charge, please contact the Ford Motor Company North American Customer Assistance Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: 8am - 11pm (Monday-Friday) ET
9am - 6pm (Saturday) ET

OR

E-mail: *www.ownerconnection.com*
Current response time is three business days.

You may also send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S.W., Washington, D.C. 20590, or call the toll free Auto Safety Hotline at 1-800-424-9393 (Washington, D.C. area residents may call 1-202-366-0123).

Quality Care service is there for you all year round.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this recall notification, we stand committed with our Ford and Lincoln Mercury dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Again, we are sorry for the inconvenience. Thank you for your attention to this important matter.

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs