• **ENGINE—3.0L 2V (VULCAN)—REVISED OIL PAN GASKET REPLACEMENT PROCEDURE—SERVICE TIP** • **LEAK—ENGINE OIL FROM OIL PAN GASKET AREA PREVIOUSLY REPAIRED—3.0L VULCAN ENGINE ONLY—SERVICE TIP**	**Article No. 01-12-4**

FORD: 1986-2001 TAURUS
1990-1991 PROBE
1992-1994 TEMPO
1986-1997 AEROSTAR
1991-1998 RANGER
1995-1999 WINDSTAR

MERCURY: 1986-2001 SABLE
1992-1994 TOPAZ

This article is being republished in its entirety to update the service parts and the Service Procedure.

ISSUE

Engine oil may continue to leak from the engine oil pan gasket area after an engine oil pan gasket repair has been performed. The oil pan gasket may creep (move) sideways in one or more of four locations during an oil pan gasket installation, causing an improper oil pan-to-engine block seal. The Service or Workshop Manual procedure may, or in some cases may not, list an adhesive to attach the gasket to the engine block. The adhesive that is listed has poor adhesion qualities and may not keep the gasket in place during installation. Some of the oil pan bolts may also lose their torque retention over time.

ACTION

A revised engine oil pan gasket installation procedure is available. Refer to the following Service Procedure for details. Use the contact adhesive listed in the revised installation procedure. A step has been added to recheck the bolt torque after the last tightening procedure and then again after the engine has been run and has reached normal operating temperature. The Step to loosen the bolts one full turn has also been deleted.

NOTE

THE NEW SERVICE CONTACT ADHESIVE WAS DEVELOPED SPECIFICALLY TO HELP KEEP THE GASKET IN PLACE DURING IN-VEHICLE INSTALLATION AND IMPROVE SEALING QUALITY.

SERVICE PROCEDURE

Use the following revised oil pan gasket installation procedure.

1. Remove the oil pan as instructed in the appropriate model year Service or Workshop Manual.
2. Before installing the oil pan, carefully and thoroughly remove all traces of the old RTV sealant from the oil pan and engine block (Figure 1). Refer to the Workshop Manual for the correct metal surface cleaner.

NOTE

FOLLOW THE DIRECTIONS ON THE ADHESIVE TUBE FOR PROPER APPLICATION AND ADHESION. ALIGNMENT OF THE GASKET IS CRITICAL BECAUSE THE CONTACT ADHESIVE BONDS THE TWO SURFACES TOGETHER ON CONTACT.

3. To install the oil pan gasket, apply Motorcraft Gasket Adhesive TA-6 (US) or CTA-6 (Canada) meeting Ford Specification WSS-M2G408-A to the top of the gasket (the surface that mates to the engine block), and to the entire engine block sealing surface including the front cover and rear main bearing cap surfaces (Figure 1), but not the front cover-to-block and rear bearing cap-to-block parting lines (Figure 2).

Copyright © 2001 Ford Motor Company


4. Seal the front cover and rear bearing cap-to-block parting lines with a bead of Silicone Gasket and Sealant (F7AZ-19554-EA, or equivalent meeting Ford specification WSE-M4G323-A4) (Figure 2).
5. Install the oil pan gasket to the engine block by carefully lining up the bolt holes.
6. Install the oil pan and hand tighten the retaining bolts.
7. Tighten the four (4) corner bolts first to 12 N•m (106 lb-in) (Figure 1).
8. Tighten the remaining bolts, from back to front, to 12 N•m (106 lb-in).
9. Check all the bolts by retightening to the same torque specification.
10. Finish installing the oil pan per the Workshop Manual procedure.
11. Start the engine and allow it to reach operating temperature. The cooling fan should cycle at least one time.

NOTE
STEP 12 IS EXTREMELY IMPORTANT AND SHOULD NOT BE SKIPPED.

12. Stop the engine and again retighten (torque) the oil pan bolts to the correct specification of 12 N•m (106 lb-in).
13. Inspect the oil pan gasket for extreme shifting out of place. If the gasket has shifted, it will be necessary to replace the gasket again.


PART NUMBER	PART NAME
TA-6	Motorcraft Gasket Adhesive - U.S.
CTA-6	Motorcraft Gasket Adhesive - Canada (Available 7/23/2001)
F7AZ-19554-EA	Silicone Gasket and Sealant

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 99-18-3
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 401000, 490000, 499000, 510000

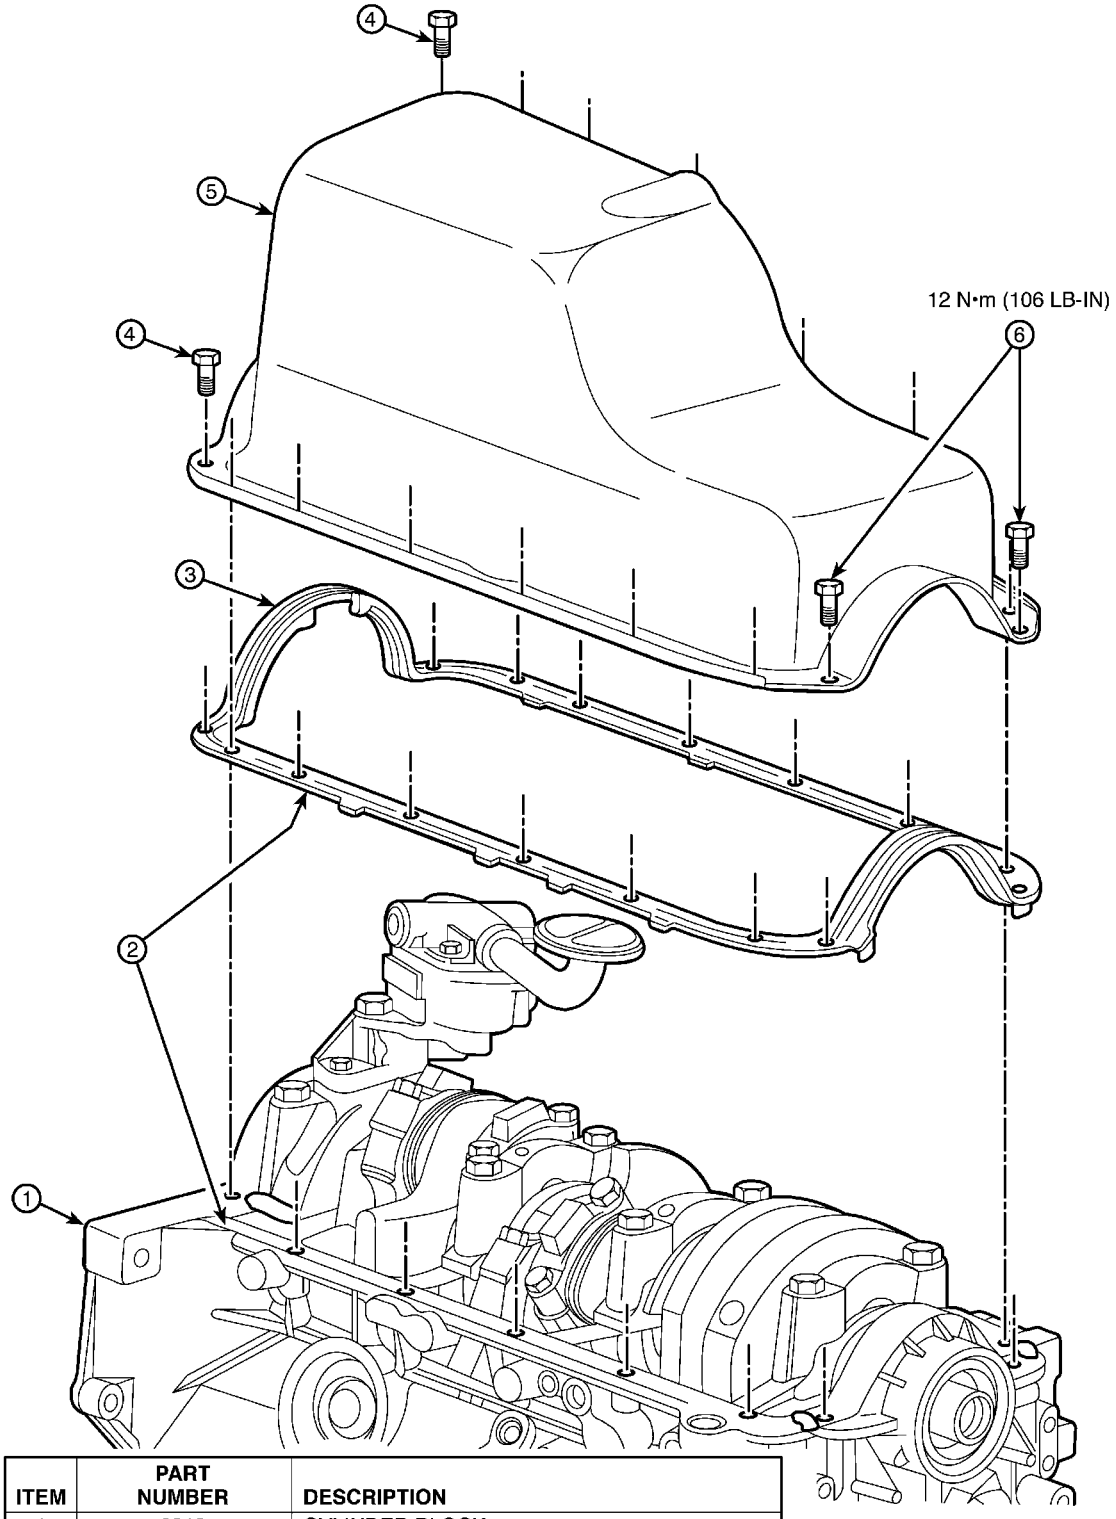

ITEM	PART NUMBER	DESCRIPTION
1	-6010-	CYLINDER BLOCK
2	TA-6 (U.S.) CTA-6 (Canada)	MOTORCRAFT GASKET ADHESIVE
3	-6710-	OIL PAN GASKET
4	M6x1x17	SCREW AND WASHER ASSEMBLY (14 REQ'D.)
5	-6675-	OIL PAN ASSEMBLY
6	M6x1x22	SCREW AND WASHER ASSEMBLY (2 REQ'D.)

Figure 1 - Article 01-12-4

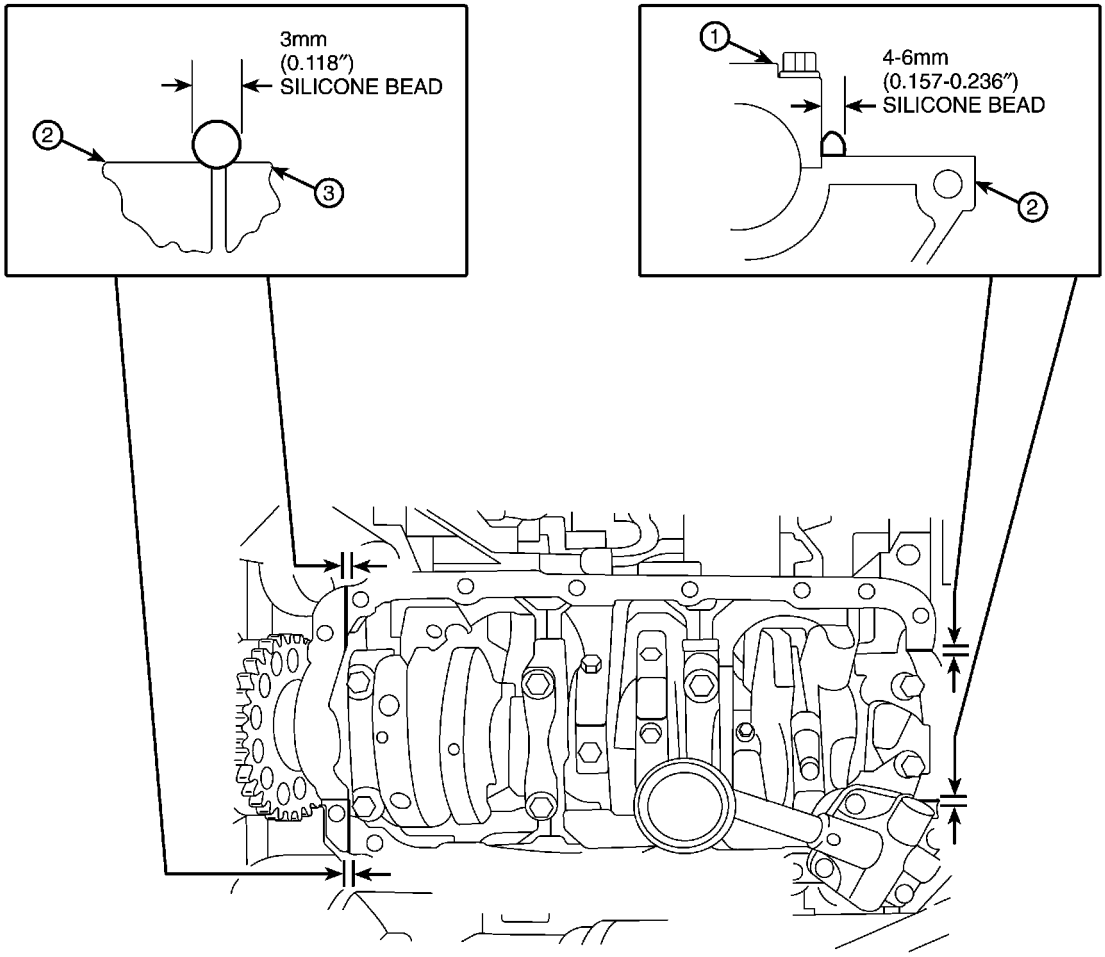

ITEM	PART NUMBER	DESCRIPTION
1		REAR MAIN BEARING CAP (PART OF -6010-)
2	-6010-	CYLINDER BLOCK
3	-6019-	ENGINE FRONT COVER

Figure 2 - Article 01-12-4