• BRAKES—STOPLAMPS INOPERATIVE—SERVICE REPAIR KIT FOR BRAKE PEDAL POSITION SWITCH WIRING CONNECTOR • ELECTRICAL—TRANSMISSION SHIFT INTERLOCK INOPERATIVE—SERVICE REPAIR KIT FOR BRAKE PEDAL POSITION SWITCH WIRING CONNECTOR	**Article No. 02-13-6**

FORD: 1998-2002 CROWN VICTORIA

LINCOLN: 1998-2002 TOWN CAR

MERCURY: 1998-2002 GRAND MARQUIS

ISSUE

The Brake Shift Interlock may be inoperative on some vehicles, not allowing the operator to move the shift lever from the Park position. Stop Lamp operation may also be affected. This may be caused by a deformed Brake Pedal Position Switch electrical connector.

ACTION

Restore Brake Pedal Position Switch operation by installing an updated electrical connector and pigtail. Refer to the following Service procedure for details.

SERVICE PROCEDURE

1. Verify the condition.
2. Remove LH instrument panel insulator. Refer to Workshop Manual Section 501-05.
3. Inspect the Brake Pedal Position Switch electrical connector (2000/2001 - C2002: 2002 - C278) for deformation. Refer to Wiring Diagrams, Section 90 for additional details.
4. If no deformation is found, refer to Workshop Manual, Sections 307-05 & 417-01, for normal diagnostic information.
5. If deformation is found, continue with the following procedure.
6. Disconnect the battery ground cable.
7. Disconnect the Brake Pedal Position Switch electrical connector.
8. Remove the deformed connector by cutting off 4 inches of wire from the harness.
9. Strip approximately 1/4″ from the remaining harness and twist the end of each wire.
10. Obtain the repair kit part number 2W1Z-14A411-AAA.
11. The repair kit pigtail wiring comes in 1 piece with connectors.
12. Strip approximately 1/4″ of insulation from the repair pigtail and twist the end of each wire.
13. Since the switch is polarity sensitive, match evenly the wire color (LG light green to LG, LG/RD light green with red strip with LG/RD).
14. Use crimp connectors that are found in the repair kit.
15. Evenly position the crimp connectors over the wire repair.
16. To crimp the connectors, use the proper wire crimp tool.
17. Use a heat gun to heat the repaired area until adhesive flows out of both ends of the heat shrink.
18. Reconnect the Brake Pedal Position Switch.
19. Replace the LH instrument panel insulator.
20. Reconnect battery ground cable.
21. Test and verify the Brake Pedal Position Switch operates properly.

PART NUMBER	PART NAME
2W1Z-14A411-AAA	Repair Kit - Brake Pedal Position Switch Electrical Connector

Copyright © 2002 Ford Motor Company

Article No. 02-13-6 Cont'd.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
021306A	Replace Brake Pedal Position Switch Electrical Connector	0.4 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14A005	01

OASIS CODES: 201000, 201200, 203000, 203200, 503300

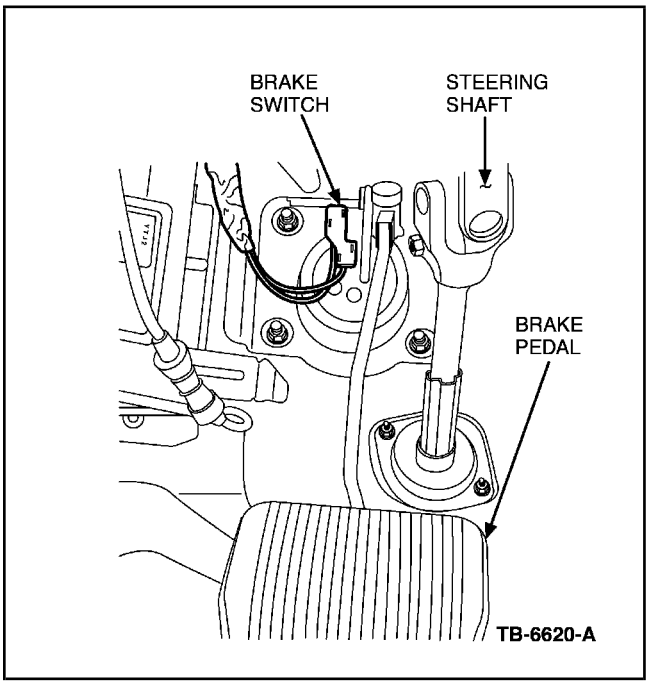


Figure 1 - Article 02-13-6