- **DRIVEABILITY—DIAGNOSTIC TROUBLE CODE (DTC)—P0118 STORED IN MEMORY—VEHICLES EQUIPPED WITH 2.0L SPI ENGINE—VEHICLES PRODUCED BEFORE 1/9/2001**
- **MALFUNCTION INDICATOR LAMP (MIL)—MIL ILLUMINATED—DIAGNOSTIC TROUBLE CODE (DTC)—P0118 STORED IN MEMORY—VEHICLES EQUIPPED WITH 2.0L SPI ENGINE—VEHICLES PRODUCED BEFORE 1/9/2001**
- **LAMP—MALFUNCTION INDICATOR LAMP (MIL) ILLUMINATED—DIAGNOSTIC TROUBLE CODE (DTC)—P0118 STORED IN MEMORY—VEHICLES EQUIPPED WITH 2.0L SPI ENGINE—VEHICLES PRODUCED BEFORE 1/9/2001**

Article No. 01-1-13

FORD: 2001 FOCUS

ISSUE

Some vehicles built prior to 1/9/2001 may exhibit a Malfunction Indicator Lamp (MIL) along with a Diagnostic Trouble Code (DTC) P0118 stored in memory with no driveability symptoms. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

If no other failures are observed during normal diagnosis, Engine Coolant Temperature (ECT) sensor or related wiring, reprogram the PCM with the latest level calibration in the application chart. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

PCM reprogramming should be performed before any hardware is replaced. If the vehicle already has the latest calibration, proceed with normal diagnostics related to the DTC. Refer to the following PCM Calibration Information Chart.

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001 Focus 2.0L SPI	1M5F-MA	QOW0	1M5Z-MB	1AK1AS0515	1AK1AS0516	WDS Release B11_3
2001 Focus 2.0L SPI	1M5F-NA	IBE0	1M5Z-NB	1AK1AS0A15	1AK1AS0A16	WDS Release B11_3
2001 Focus 2.0L SPI	1S4F-JE	SYL4	1S4Z-JF	1AK2AS0510	1AK2AS0511	WDS Release B11_3
2001 Focus 2.0L SPI	1S4F-AAD	PLN3	1S4Z-AAE	1AK2AS0A10	1AK2AS0A11	WDS Release B11_3
2001 Focus 2.0L SPI	1S4F-LE	BVP4	1U7Z-CA	1AK1AS0510	1AK1AS0510	WDS Release B11_3
2001 Focus 2.0L SPI	1SF4-ACD	RXV3	1U7Z-DAA	1AK1AS0A10	1AK1AS0A10	WDS Release B11_3

Copyright © 2001 Ford Motor Company

Article No. 01-1-13 Cont'd.

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

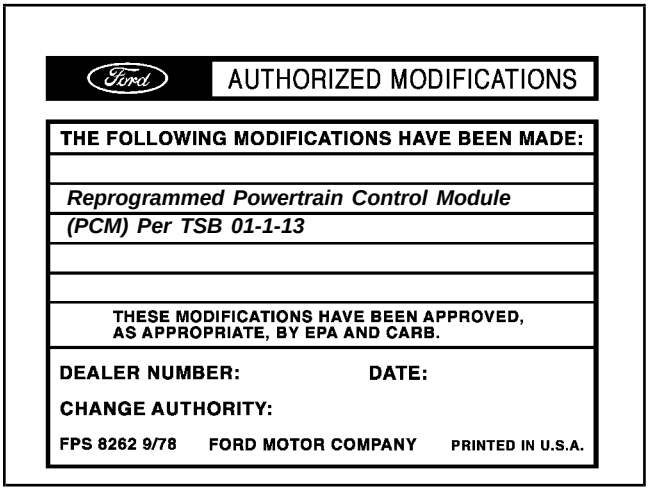

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage And Emissions Warranty Coverage

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECALEM	42

OASIS CODES: 698298