NOISE—"BUZZ" COMING FROM CENTER OR RIGHT SIDE OF INSTRUMENT PANEL—HEARD AT IDLE OR LOW SPEED DRIVING	Article No. 01-4-10

FORD: 2001 EXPLORER

ISSUE

Some Sport and Sport Trac vehicles built between 7/1/2000 and 2/28/2001 may exhibit a "buzz" coming from the center or right side of the instrument panel at idle and/or low speed driving with rpm range between base idle and 1800 rpm. This may be caused by the Powertrain Control Module (PCM) resonating against the heat shield that is located inside the PCM.

ACTION

Verify buzz. Insulate the PCM from the heat shield with hard foam tape. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Remove the PCM from the vehicle. Refer to the 2001 Explorer Workshop Manual, Section 303-14 for removal procedure.
2. Cut a piece of Urethane Tape (hard foam), Rotunda part number 164-R4902, to the following dimensions: 20mm width, 3mm thickness, and 45mm length. The urethane tape is located in the Rotunda Squeak and Rattle Kit, part number 164-R4900.
3. Lay the PCM flat on a table. After removing the adhesive backing, place the foam tape on the top surface of the module at the rear center of the module. This will dampen the buzz noise from the PCM outer case. (Figure 1).
4. Reinstall the PCM. Refer to the Workshop Manual, Section 303-14 for installation procedure.
5. Test drive vehicle to verify that the noise is corrected.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
010410A	Install Insulating Foam To Powertrain Control Module (PCM)	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
12A650	42

OASIS CODES: 702000, 702100, 702300

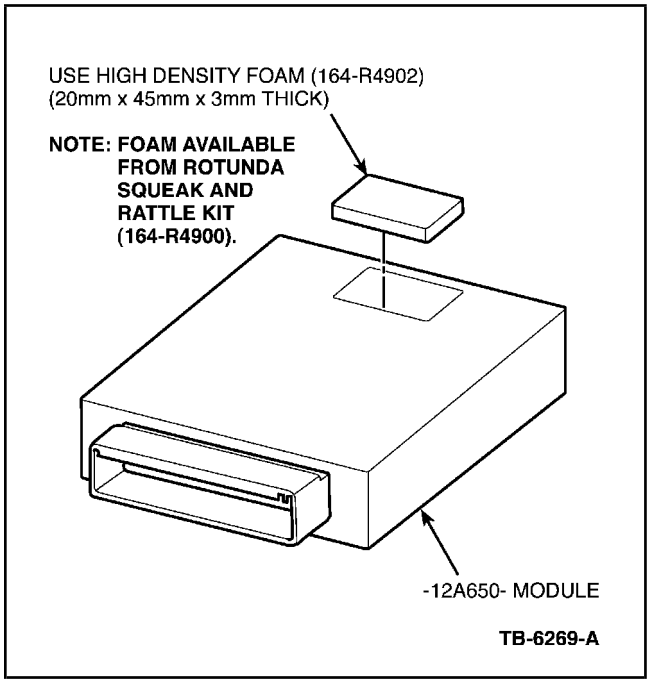

Figure 1 - Article 01-4-10

Copyright © 2001 Ford Motor Company