AXLE—FLUID LEAK FROM REAR AXLE PINION SEAL—4X4 VEHICLES ONLY	Article No. 01-7-7

FORD: 2001 ESCAPE

ISSUE

Some 4X4 equipped vehicles may exhibit a rear axle pinion seal leak at the Rotary Blade Coupling (RBC). This may be caused by the design of the pinion seal.

ACTION

Replace the pinion seal at the RBC. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

NOTE

THE CLUTCH ASSEMBLY IS A BALANCED UNIT. IF THE FOLLOWING INDEXING PROCEDURE IS NOT UTILIZED, A VIBRATION MAY OCCUR.

1. Index mark the driveshaft and end yoke before removing.
2. Remove driveshaft (Refer to Workshop Manual Section 205-01).
3. Remove pinion nut.
4. Using a punch, mark one of the splines on the yoke (Figure 1).
5. Mark the corresponding spline on the pinion gear (Figure 2).

NOTE

A SMALL PUNCH THAT CAN BE INSERTED BETWEEN THE END YOKE SPLINE AND PINION GEAR IS REQUIRED.

6. Remove end yoke.
7. Remove pinion seal.
8. Install new Pinion Seal (YL8Z-4N046-AA) using seal installer tool. SPECIAL TOOL PART NUMBER T80T-4000-C (205-137).
9. Assemble end yoke to pinion gear spline. Align the marks made during disassembly.
10. Install pinion nut and torque to 217-271 N•m (160-200 lb-ft) (Figure 3).
11. Assemble driveshaft to end yoke (Figure 4) and torque to 23 N•m (17 lb-ft). Refer to Workshop Manual Section 205-01.

PART NUMBER	PART NAME
YL8Z-4N046-AA	Pinion Seal

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
010707A	Replace Pinion Seal (4X4 Only)	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
4N046	42

OASIS CODES: 509000, 510000, 590000

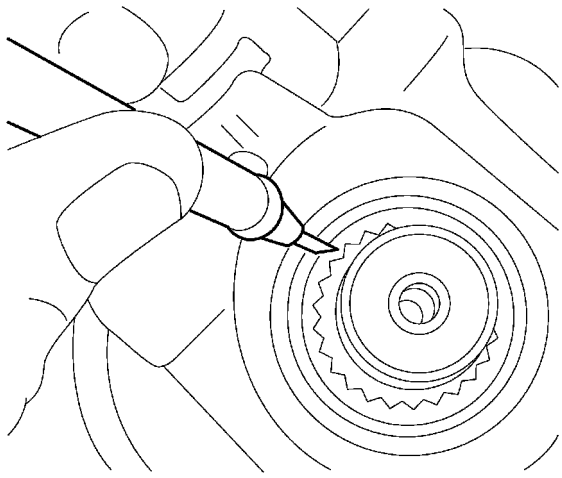

Figure 1 - Article 01-7-7

Copyright © 2001 Ford Motor Company

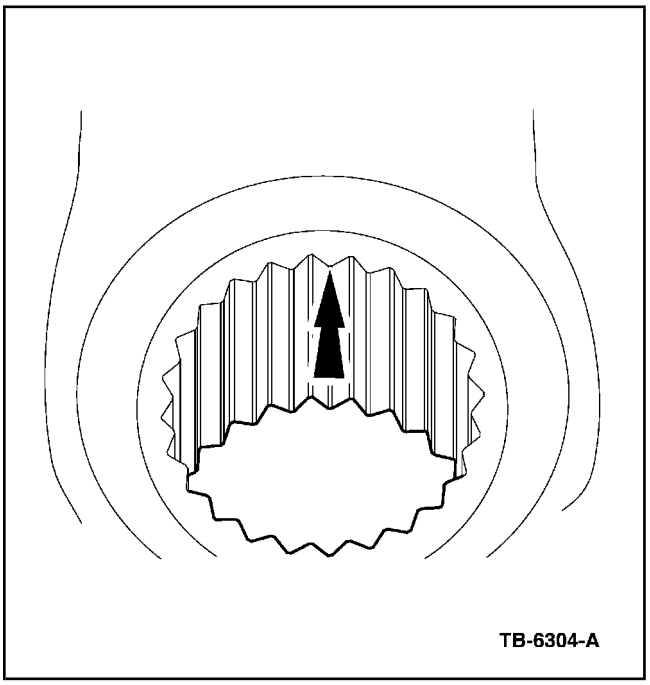

Figure 2 - Article 01-7-7

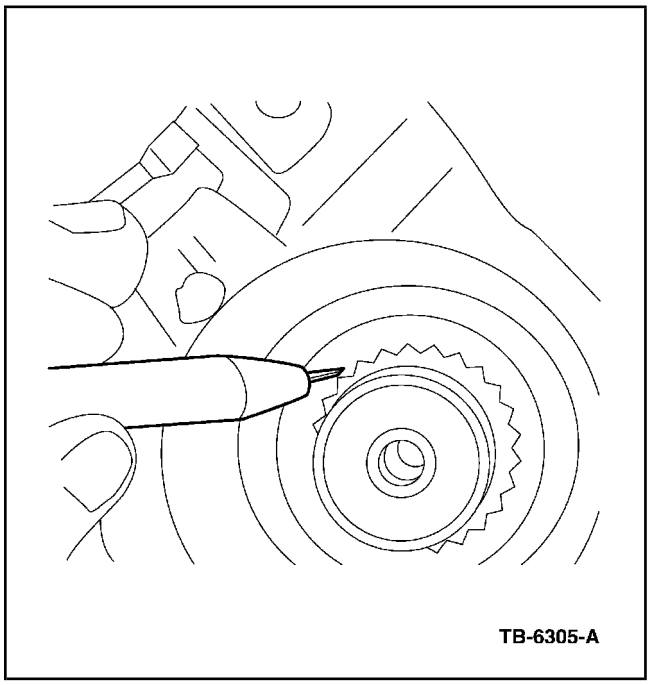

Figure 3 - Article 01-7-7

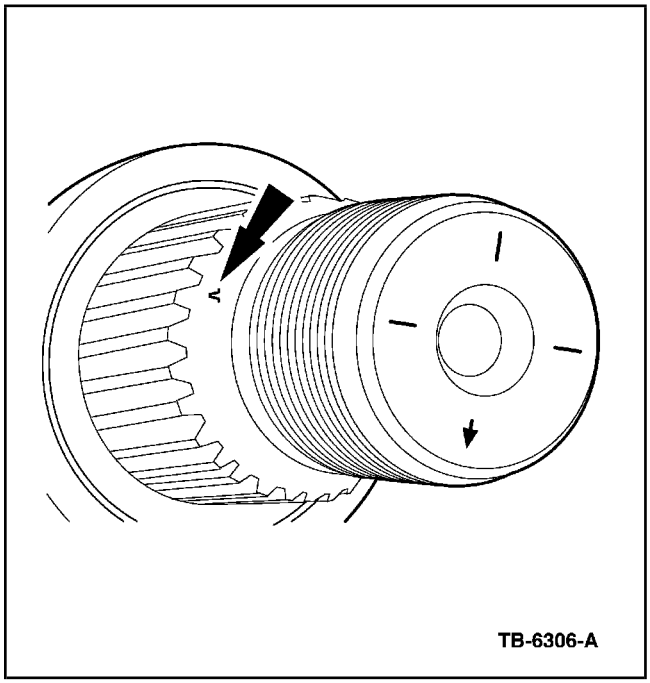

Figure 4 - Article 01-7-7