• CLIMATE CONTROL—"WHISTLING" NOISE HEARD FROM HEATER PLENUM • NOISE—"WHISTLING" HEARD FROM HEATER PLENUM	**Article No. 00-6-7**

FORD: 2000 FOCUS

ISSUE

A "whistling" noise from the heater plenum near the blower motor resistor may be heard on some vehicles. This may be due to air leaking between the top leading edge of the blower motor resistor and the case.

ACTION

Seal the top leading edge of the blower motor resistor. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Remove the blower motor resistor from the heater plenum (Figure 1).

CAUTION
DO NOT ALLOW THE TAPE AND/OR ROPE SEALER TO COME INTO CONTACT WITH THE METAL CONTACTS OF THE RESISTOR.

2. Place a 35mm x 8mm piece of electrical tape along the top leading edge of the resistor block.
3. Place a 35mm length of rope sealer on top of the tape on the leading edge of the resistor block (Figure 2).
4. Reinstall the blower motor resistor and verify the repair.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
000607A	Reseal Blower Motor Resistor	0.3 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
18B647	33

OASIS CODES: 208000, 208300, 208999, 702300

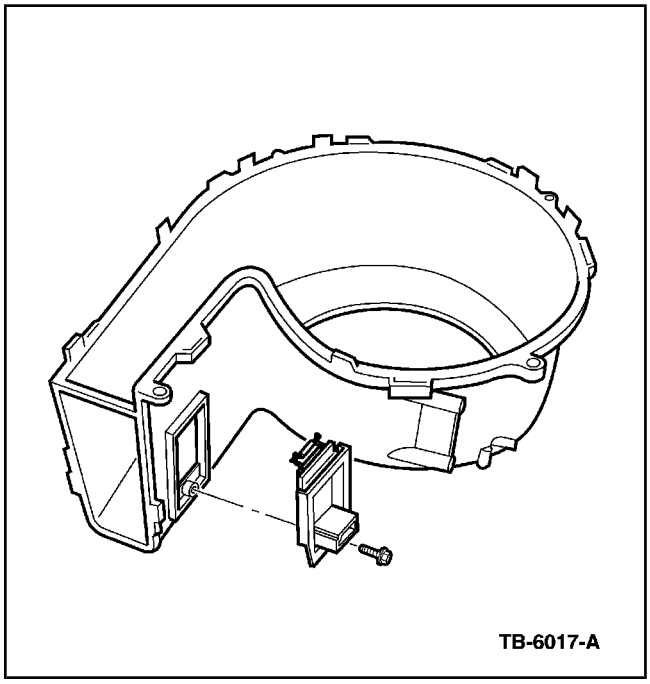

Figure 1 - Article 00-6-7

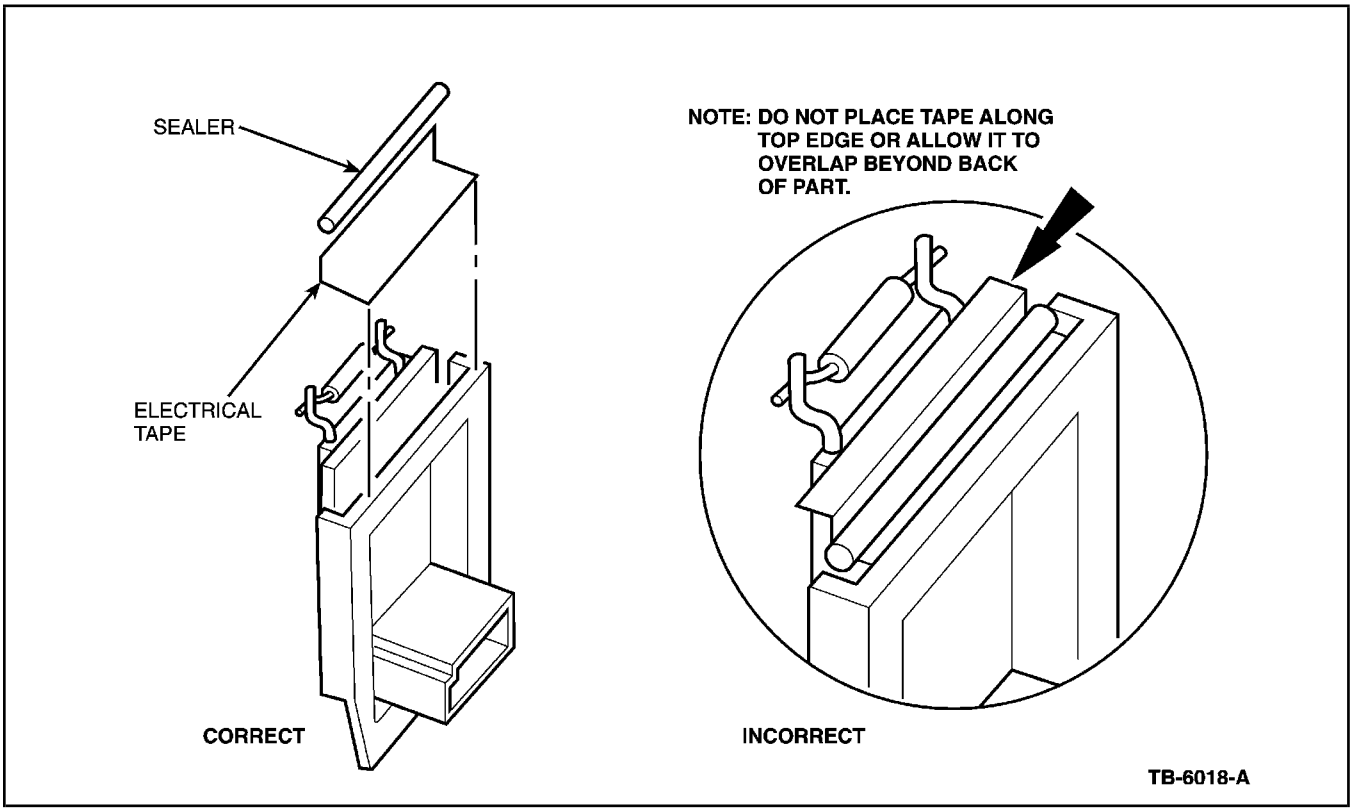

Figure 2 - Article 00-6-7