BRAKES—REDUCED POWER ASSIST DURING OPERATION IN FREEZING AMBIENT TEMPERATURES—LIGHTNING MODELS ONLY	Article No. 01-25-5

FORD: 1999-2001 F-150

ISSUE

Some Lightning model vehicles may exhibit a reduced power assist after the first two or three brake applications during operation in freezing ambient temperatures. This may be caused by current production routing of the brake booster vacuum hose allowing water to collect in the hose which can freeze in cold ambient temperatures.

ACTION

Verify condition only occurs during freezing ambient temperatures. Replace existing brake booster hose with a new design service part. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Remove existing brake booster hose and discard.
2. Install new brake booster hose (1L3Z-9C482-AA). Secure new hose by inserting retainer (included) into the upper hole on the driver's side of the cowl trim panel (Figure 1).
3. Road test and verify brake effectiveness.

PART NUMBER	PART NAME
1L3Z-9C482-AA	Brake Booster Hose

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
012505A	Replace Brake Booster Vacuum Supply Line	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9C482	55

OASIS CODES: 301000

Copyright © 2001 Ford Motor Company

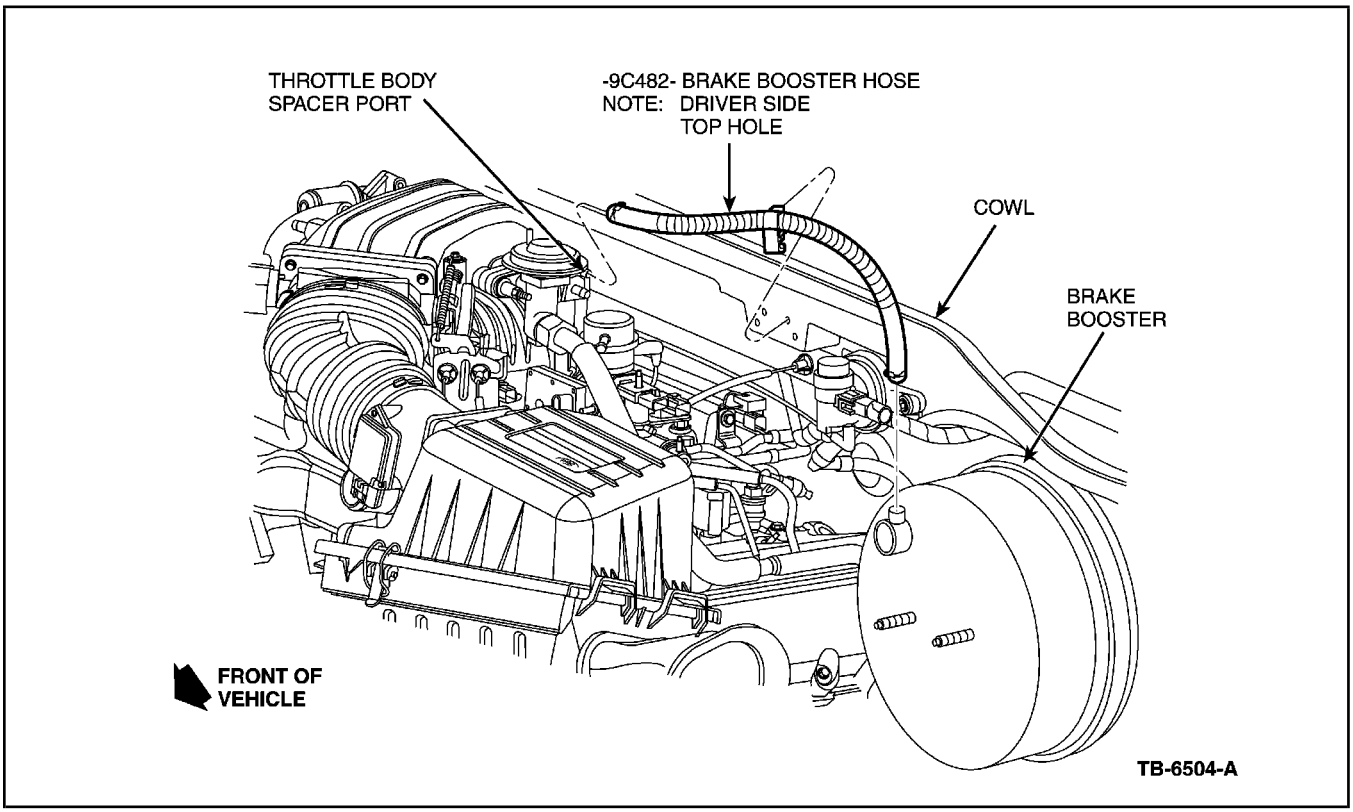

Figure 1 - Article 01-25-5