F-150 LIGHTNING SUPERCHARGER INTERCOOLER

AFFECTED VEHICLES: CERTAIN 1999 AND 2000 MODEL YEAR F-150 LIGHTNING

OVERVIEW

Replace the supercharger intercooler subassembly and top-off the supercharger intercooler system with coolant.

SERVICE TIPS

1. For this program, the supercharger intercooler is serviced with the upper intake manifold as an assembly. DO NOT separate the intercooler from the upper intake manifold during the installation process.
2. For a proper and long-lasting repair, all of the gaskets provided in the repair kit must be used.

SERVICE PROCEDURE

1. Install the new supercharger intercooler/upper intake manifold assembly. Refer to the Charge Air Cooler–Lightning Replacement Procedure in Section 303-12 of the 2000 model year Workshop Manual.
2. Make sure the lower intake is free of debris or fluid prior to installing the new intercooler assembly.
3. For proper gasket alignment, the dowels must be located in the new upper intake manifold (See Figure 1) and the lower intake manifold (See Figure 2) as illustrated.

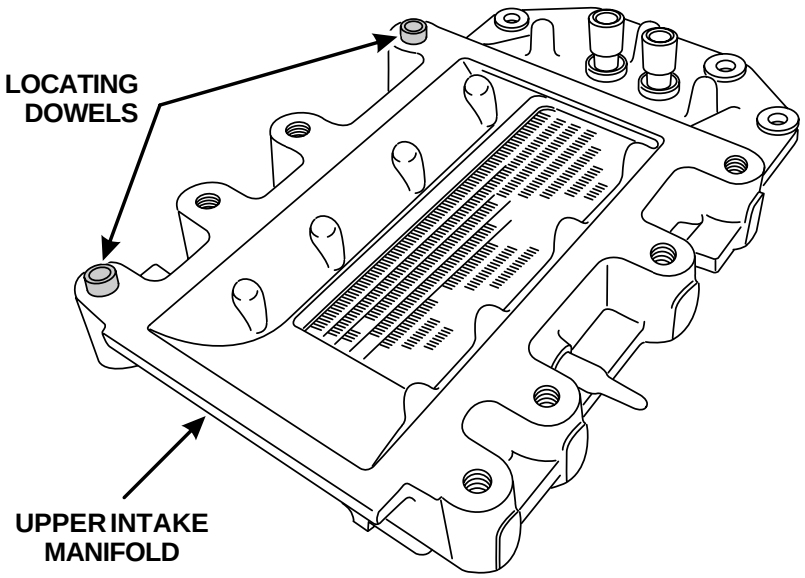


FIGURE 1

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/01

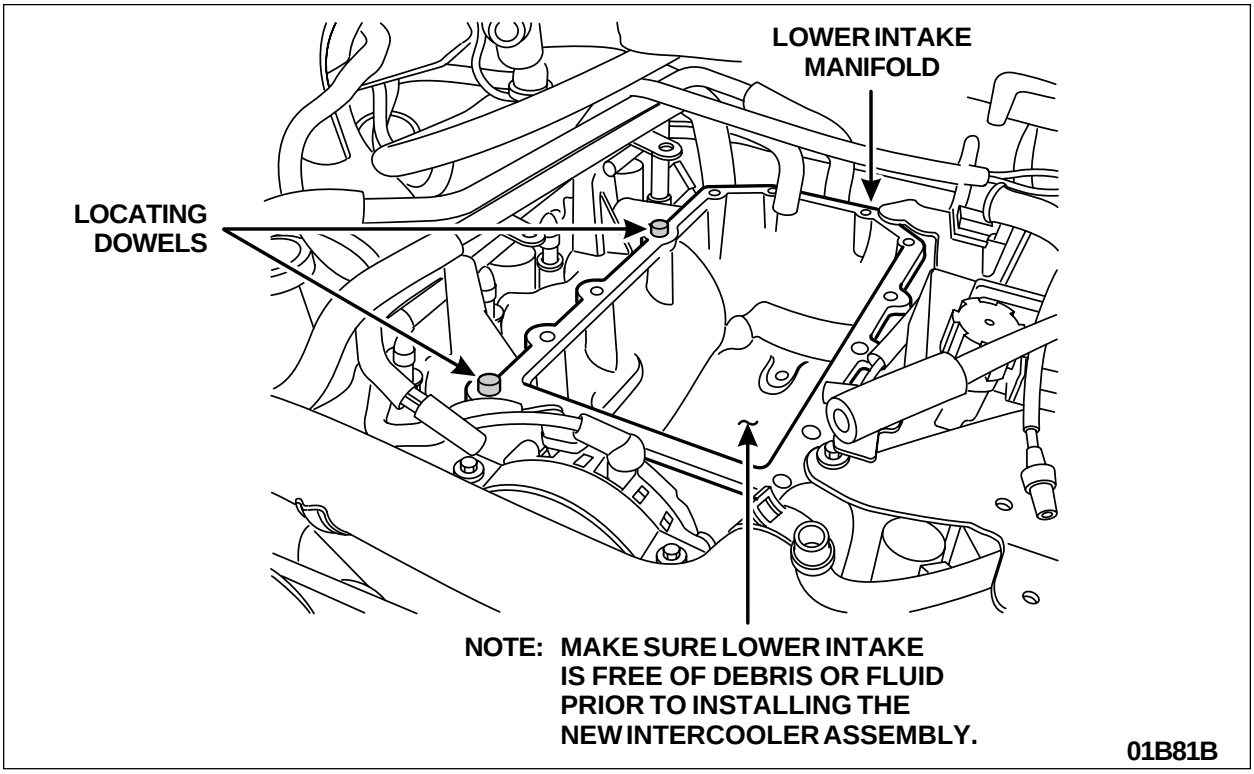


FIGURE 2

SYSTEM PRESSURE TEST

1. After filling the supercharger intercooler system with coolant, pressure test the system per Section 303-03B, Supercharger Cooling, Diagnosis and Testing in the 2000 model year Workshop Manual.
2. If the system does not hold pressure, check all hoses and connections and perform necessary repairs.

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/01