• **DRIVEABILITY—IDLE—LOW ENGINE RPM DURING INITIAL COLD START OR LOSS OF ENGINE POWER AFTER CLUTCH DISENGAGEMENT OR ON DECELERATION—VEHICLES EQUIPPED WITH 4.0L SOHC ENGINE ONLY** • **DRIVEABILITY—STALL—LOSS OF ENGINE POWER AFTER CLUTCH DISENGAGEMENT OR ON DECELERATION—VEHICLES EQUIPPED WITH 4.0L SOHC ENGINE ONLY**	**Article No. 01-23-2**

FORD: 2001 RANGER

ISSUE

Some vehicles equipped with the 4.0L SOHC engine may exhibit a low engine RPM during initial cold start and/or loss of engine power upon clutch disengagement or during deceleration. This may be caused by a loose PVC Closure Tube at the valve cover and/or the calibration of the Powertrain Control Module (PCM).

ACTION

Reprogram the PCM and add a clamp to the PCV Closure Tube at the valve cover. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Perform normal diagnostics as outlined in the 2001 Powertrain Control/Emissions Diagnosis (PC/ED) Workshop Manual and service as required.
2. If the condition is still present, install one hose clamp, part W527209-S301, to the PCV Closure Tube, where the elbow mates to the valve cover. This closure tube goes from the clean air tube to valve cover.
3. Reprogram the PCM using the Worldwide Diagnostic System (WDS), or New Generation Star (NGS) Tester. Refer to the following PCM Calibration Information Chart.

Copyright © 2001 Ford Motor Company

Article No. 01-23-2 Cont'd.

PCM CALIBRATION INFORMATION						
Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001 Ranger - M/T	1L5A-BCA	ETF1	1L5Z-BCC	1R32A40516	1R32A40516	WDS B15.8 Release or Later
2001 Ranger - M/T	1L5A-BEB	AYI1	1L5Z-BEC	1R32B40516	1R32B40516	WDS B15.8 Release or Later
2001 Ranger - M/T	1L5A-BAB	YBK1	1L5Z-BAC	1R32C40516	1R32C40516	WDS B15.8 Release or Later
2001 Ranger - A/T	1L4A-BBB	MEA1	1L5Z-BBC	1R3AC40516	1R31C40516	WDS B15.8 Release or Later
2001 Ranger - A/T	1L5A-BDB	HJG1	1L5Z-BDC	1R31A40516	1R31A40516	WDS B15.8 Release or Later
2001 Ranger - A/T	1L5A-BFB	VQP1	1L5Z-BFC	1R31B40516	1R31B40516	WDS B15.8 Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

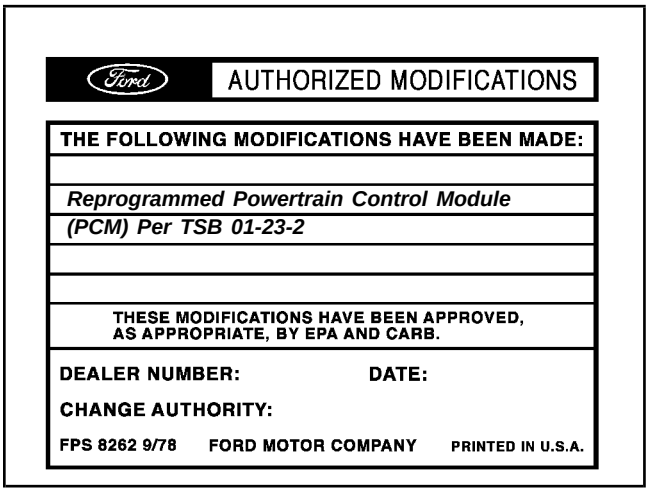

PART NUMBER	PART NAME
W527209-S301	Clamp

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage And Emissions Warranty Coverage

OPERATION	DESCRIPTION	TIME
012302A	Install Clamp On PCV Closure Tube Then Reprogram Powertrain Control Module	0.4 Hr.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECALEM	42

OASIS CODES: 607000, 607700