ELECTRICAL—TRAILER TOW WIRING—DIFFICULT TO LOCATE AT INSTRUMENT PANEL—VEHICLES BUILT 9/1/1999 THROUGH 10/4/2000—RELOCATION PROCEDURE	Article No. 01-5-3

FORD: 2000-2001 SUPER DUTY F SERIES

ISSUE

On some vehicles the trailer tow brake connector C210 (part of wiring loom -14401-) may be hard to find in the instrument panel. This may be due to the trailer tow connector being installed in the wrong location in the instrument panel.

ACTION

Locate and reposition the connector to the proper location at the instrument panel central bracket. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Locate and remove the trailer tow connector C210 from the incorrect position in the instrument panel (Figure 1).
2. Remove the connector pin-push from its position.
3. Install the connector at the correct position (Figures 2 and 3).

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
010503A	Relocate Trailer Tow Connector As Per Procedure	0.2 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14401	42

OASIS CODES: 201000, 201200, 203000, 203200, 205000, 301000

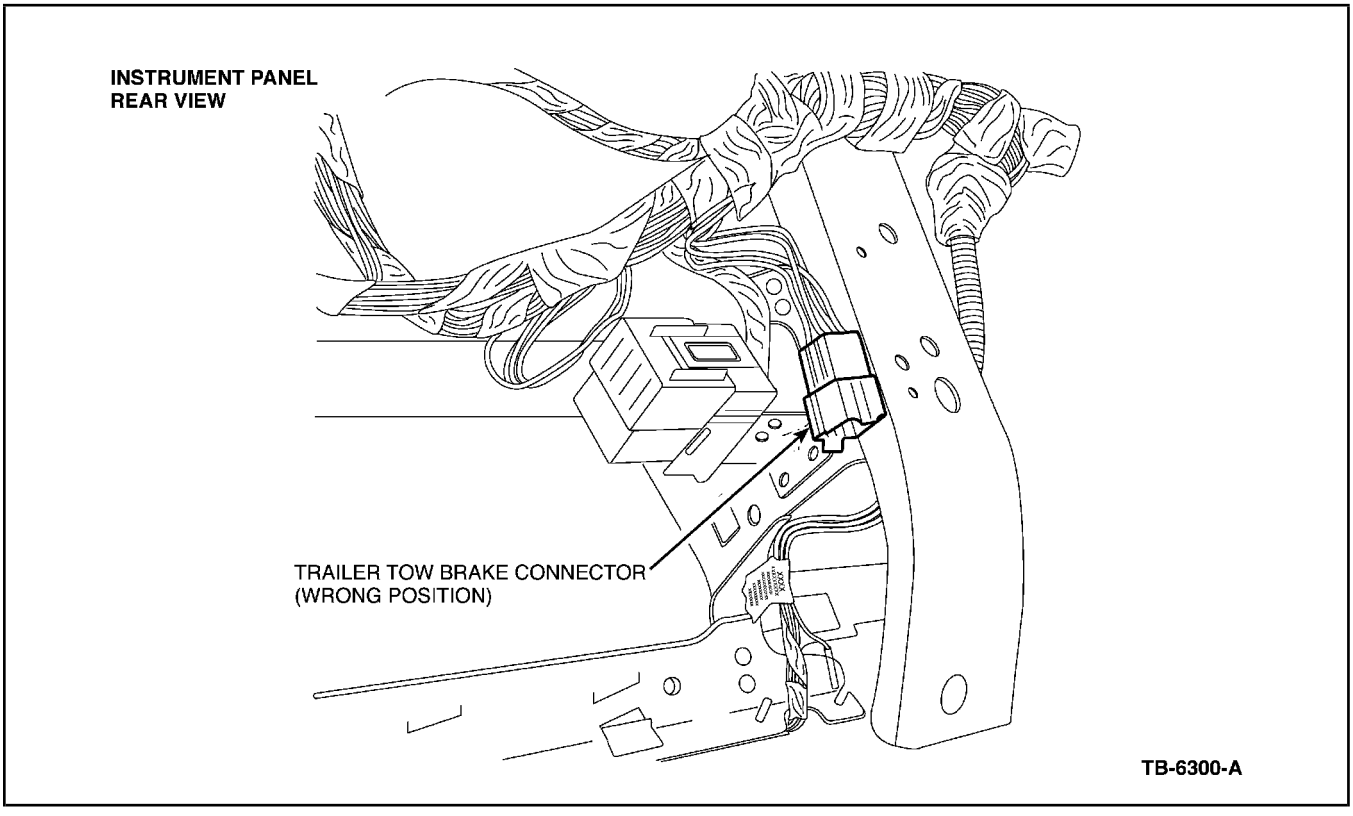


Figure 1 - Article 01-5-3

Copyright © 2001 Ford Motor Company

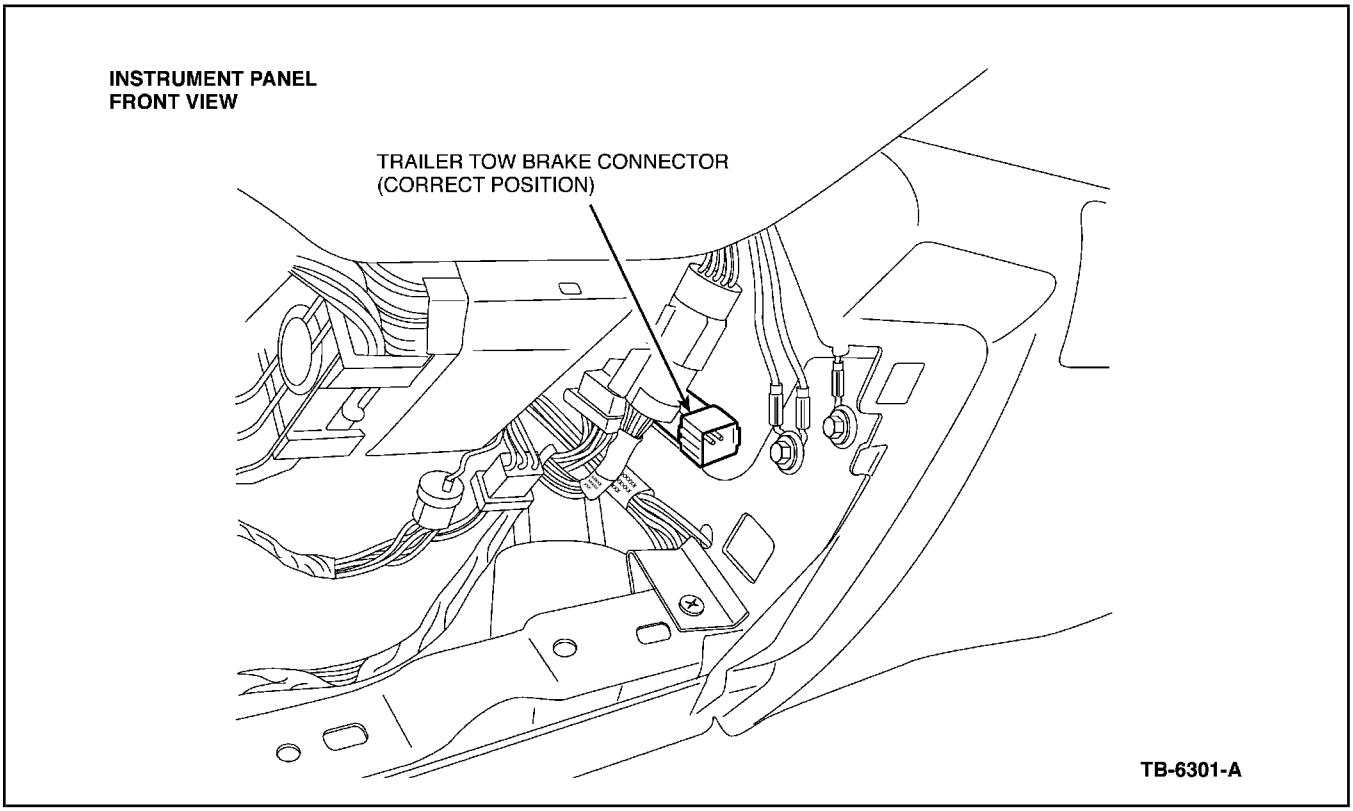


Figure 2 - Article 01-5-3

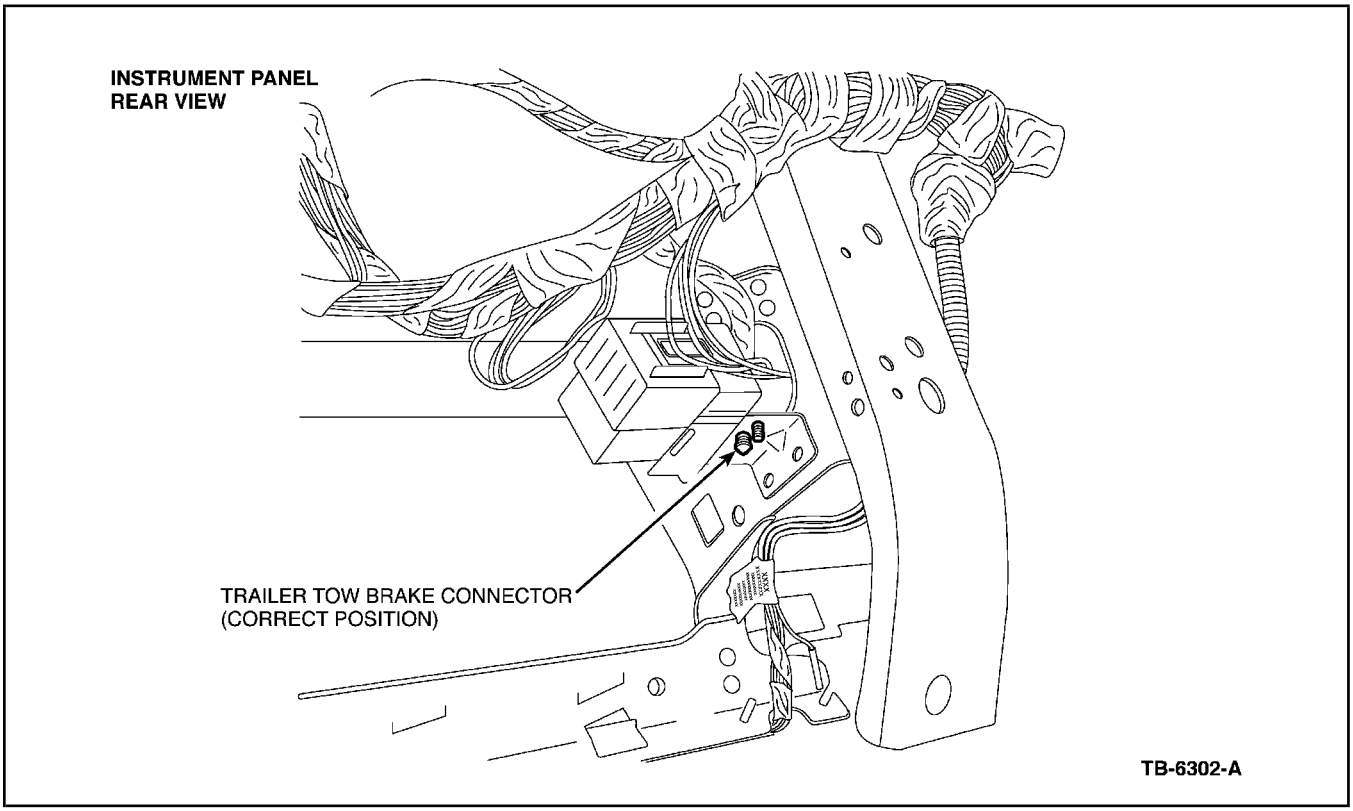


Figure 3 - Article 01-5-3