• **ELECTRICAL—LAMP—TRANSMISSION CONTROL INDICATOR LAMP (TCIL) ILLUMINATED—DIAGNOSTIC TROUBLE CODE (DTC) P0741 AND/OR P1728—VEHICLES EQUIPPED WITH 5.0L ENGINE AND 4R70W TRANSMISSION ONLY** • **TRANSMISSION—4R70W—TRANSMISSION CONTROL INDICATOR LAMP (TCIL) ILLUMINATED—DIAGNOSTIC TROUBLE CODE (DTC) P0741 AND/OR P1728—VEHICLES EQUIPPED WITH 5.0L ENGINE AND 4R70W TRANSMISSION ONLY**	**Article No. 01-5-4**

FORD: 1998-2001 EXPLORER

MERCURY: 1998-2001 MOUNTAINEER

ISSUE

Some vehicles may exhibit a flashing Transmission Control Indicator Lamp (TCIL) accompanied by a Diagnostic Trouble Code (DTC) P0741 and in some cases P1728. This may be caused by the Output Shaft Speed Sensor (OSS) signal being improperly processed by the Powertrain Control Module (PCM).

ACTION

Retrieve DTCs. Verify DTC P0741 and in some cases P1728. Diagnose and reprogram the PCM if necessary. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Verify transmission fluid levels (and transfer case level if equipped).
2. Verify that DTC P0741 and in some cases P1728 are present. If other DTCs are present, repair them first.
3. Follow the Output State Control (OSC) procedures for both bench and drive modes as listed in the appropriate model year Workshop Manual (Section 307-1A) to verify transmission and solenoid operation. While in OSC drive mode, monitor OSS Sensor - OSS PID for proper signal as stated in the Workshop Manual. This will verify OSS operation. If the solenoids or transmission fail to perform properly, follow normal diagnosis and repair procedures.
4. Reprogram the PCM following the procedures found in the Powertrain Control/Emissions Diagnosis (PC/ED) Workshop Manual. Refer to the following PCM Calibration Information Chart.
5. Verify the repair following the Transmission Drive Cycle test as written in the appropriate model year Workshop Manual. (Section 307-1A).

NOTE

THE TRANSMISSION DRIVE CYCLE TEST MUST BE PERFORMED EXACTLY AS WRITTEN. DO NOT SHORT CUT OR MISS ANY STEPS OR THE PROCEDURE WILL NOT BE ABLE TO VALIDATE THE REPAIR.

Copyright © 2001 Ford Motor Company

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
1998 49-State Explorer/Mountaineer	F87F-AVA	NRT0	F8PZ-DNB	8-54G-R00	8-54G-R05	WDS B11_10 or B12_1 release
1998 49-State Explorer/Mountaineer	F87F-AVB	NRT1	F8PZ-DNB	8-54G-R05	8-54G-R05	WDS B11_10 or B12_1 release
1998 49-State Explorer/Mountaineer	F87F-DNA	NRT1	F8PZ-DNB	8-54G-R05	8-54G-R05	WDS B11_10 or B12_1 release
1998 California Explorer/Mountaineer	F87F-AXA	PCC0	F8PZ-DPB	8-54U-R00	8-54U-R05	WDS B11_10 or B12_1 release
1998 California Explorer/Mountaineer	F87F-AXB	PCC1	F8PZ-DPB	8-54U-R05	8-54U-R05	WDS B11_10 or B12_1 release
1998 California Explorer/Mountaineer	F8PF-DPA	EDS0	F8PZ-DPB	8-54U-R05	8-54U-R05	WDS B11_10 or B12_1 release
1999 Explorer/Mountaineer	XL2F-PA	EQE0	XU7Z-AFA	9VAA-BAA	9VAA-BAJ	WDS B11_10 or B12_1 release
1999 Explorer/Mountaineer	XL2F-PB	EQE1	XU7Z-AFA	9VAA-BAB	9VAA-BAJ	WDS B11_10 or B12_1 release
1999 Explorer/Mountaineer	XL2F-PC	EQE2	XU7Z-AFA	9VAA-BAF	9VAA-BAJ	WDS B11_10 or B12_1 release
1999/2000 Explorer/Mountaineer	XL2F-PD	EQE3	XU7Z-AFA	9VAA-BAG	9VAA-BAJ	WDS B11_10 or B12_1 release
2001 Explorer/Mountaineer	XL2F-PE	EQE4	XU7Z-AFA	9VAA-BAH	9VAA-BAJ	WDS B11_10 or B12_1 release
2001 Explorer/Mountaineer	XL2F-PF	EQE5	XU7Z-AFA	9VAA-BAJ	9VAA-BAJ	WDS B11_10 or B12_1 release

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

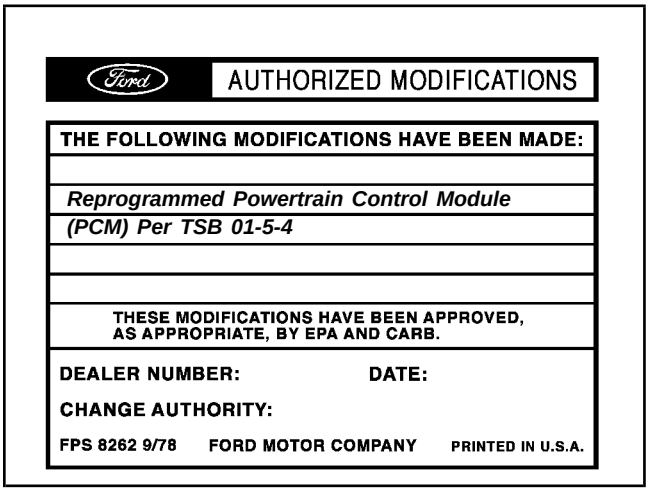

AUTHORIZED MODIFICATIONS

THE FOLLOWING MODIFICATIONS HAVE BEEN MADE:

Reprogrammed Powertrain Control Module (PCM) Per TSB 01-5-4

THESE MODIFICATIONS HAVE BEEN APPROVED, AS APPROPRIATE, BY EPA AND CARB.

DEALER NUMBER: DATE:

CHANGE AUTHORITY:

FPS 8262 9/78 FORD MOTOR COMPANY PRINTED IN U.S.A.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 204000, 206000, 504000