BRAKES—ABS/ATS (ANTILOCK BRAKING SYSTEM/ADVANCE TRAC SYSTEM) DTCS B1288/B1289 DIAGNOSIS—SERVICE TIPS

Article No. 02-22-5

LINCOLN: 2000-2002 LS

ISSUE

Some vehicles may exhibit an illuminated ABS/ATS (Advance Trac System) warning lamp with both DTCs C1288 & C1289 stored. The Workshop Manual may not provide complete diagnostic information for these DTCs in some cases.

ACTION

Use the following flow chart to diagnose and repair the vehicle. The ATS Module Recalibration Procedure has been included in the service procedure for use as needed during service.

SERVICE INFORMATION

ATS Module Recalibration Procedure:

1. Place vehicle on level ground.
2. Start engine.
3. With the WDS, use the following procedure:
   a. Brake pedal released.
   b. Select the Guided Diagnostic Icon.
   c. Select Chassis.
   d. Select Braking.
   e. Select IVD (Interactive Vehicle Dynamics).
   f. Select IVD Initialization Sequence.
   g. Each item/sensor must be selected, and then follow any additional instructions given.
4. With the NGS, use the following procedure:
   a. Brake pedal released.
   b. Use the latest level NGS Service Card.
   c. Select Service Bay Functions.
   d. Select ABS.
   e. Select IVD Calibration.
   f. Select 00-02 Lincoln LS & Press TRIGGER.
   g. Rotate the Steering Wheel Lock to Lock.
   h. When “BOOSTER LEARN” & “SWA LOCK TO LOCK” display “COMPLETE”, press TRIGGER to continue.
   i. Wait for “YAW RATE INIT” & “LATERAL ACCEL SENSOR” to display “COMPLETE”.
   j. Press the “CANCEL” button

PART NUMBER	PART NAME
XW4Z-2140-CA	Master Cylinder IVD
XW4Z-2B674-AA	Transducer/Sensor
1W4Z-2C219-CA	ABS ECU IVD - 2000-2001 Built to 7/17/2000
YW4Z-2C219-DA	ABS ECU IVD - 2001 Built From 7/18/2000, All 2002

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 206000, 301000

Copyright © 2002 Ford Motor Company

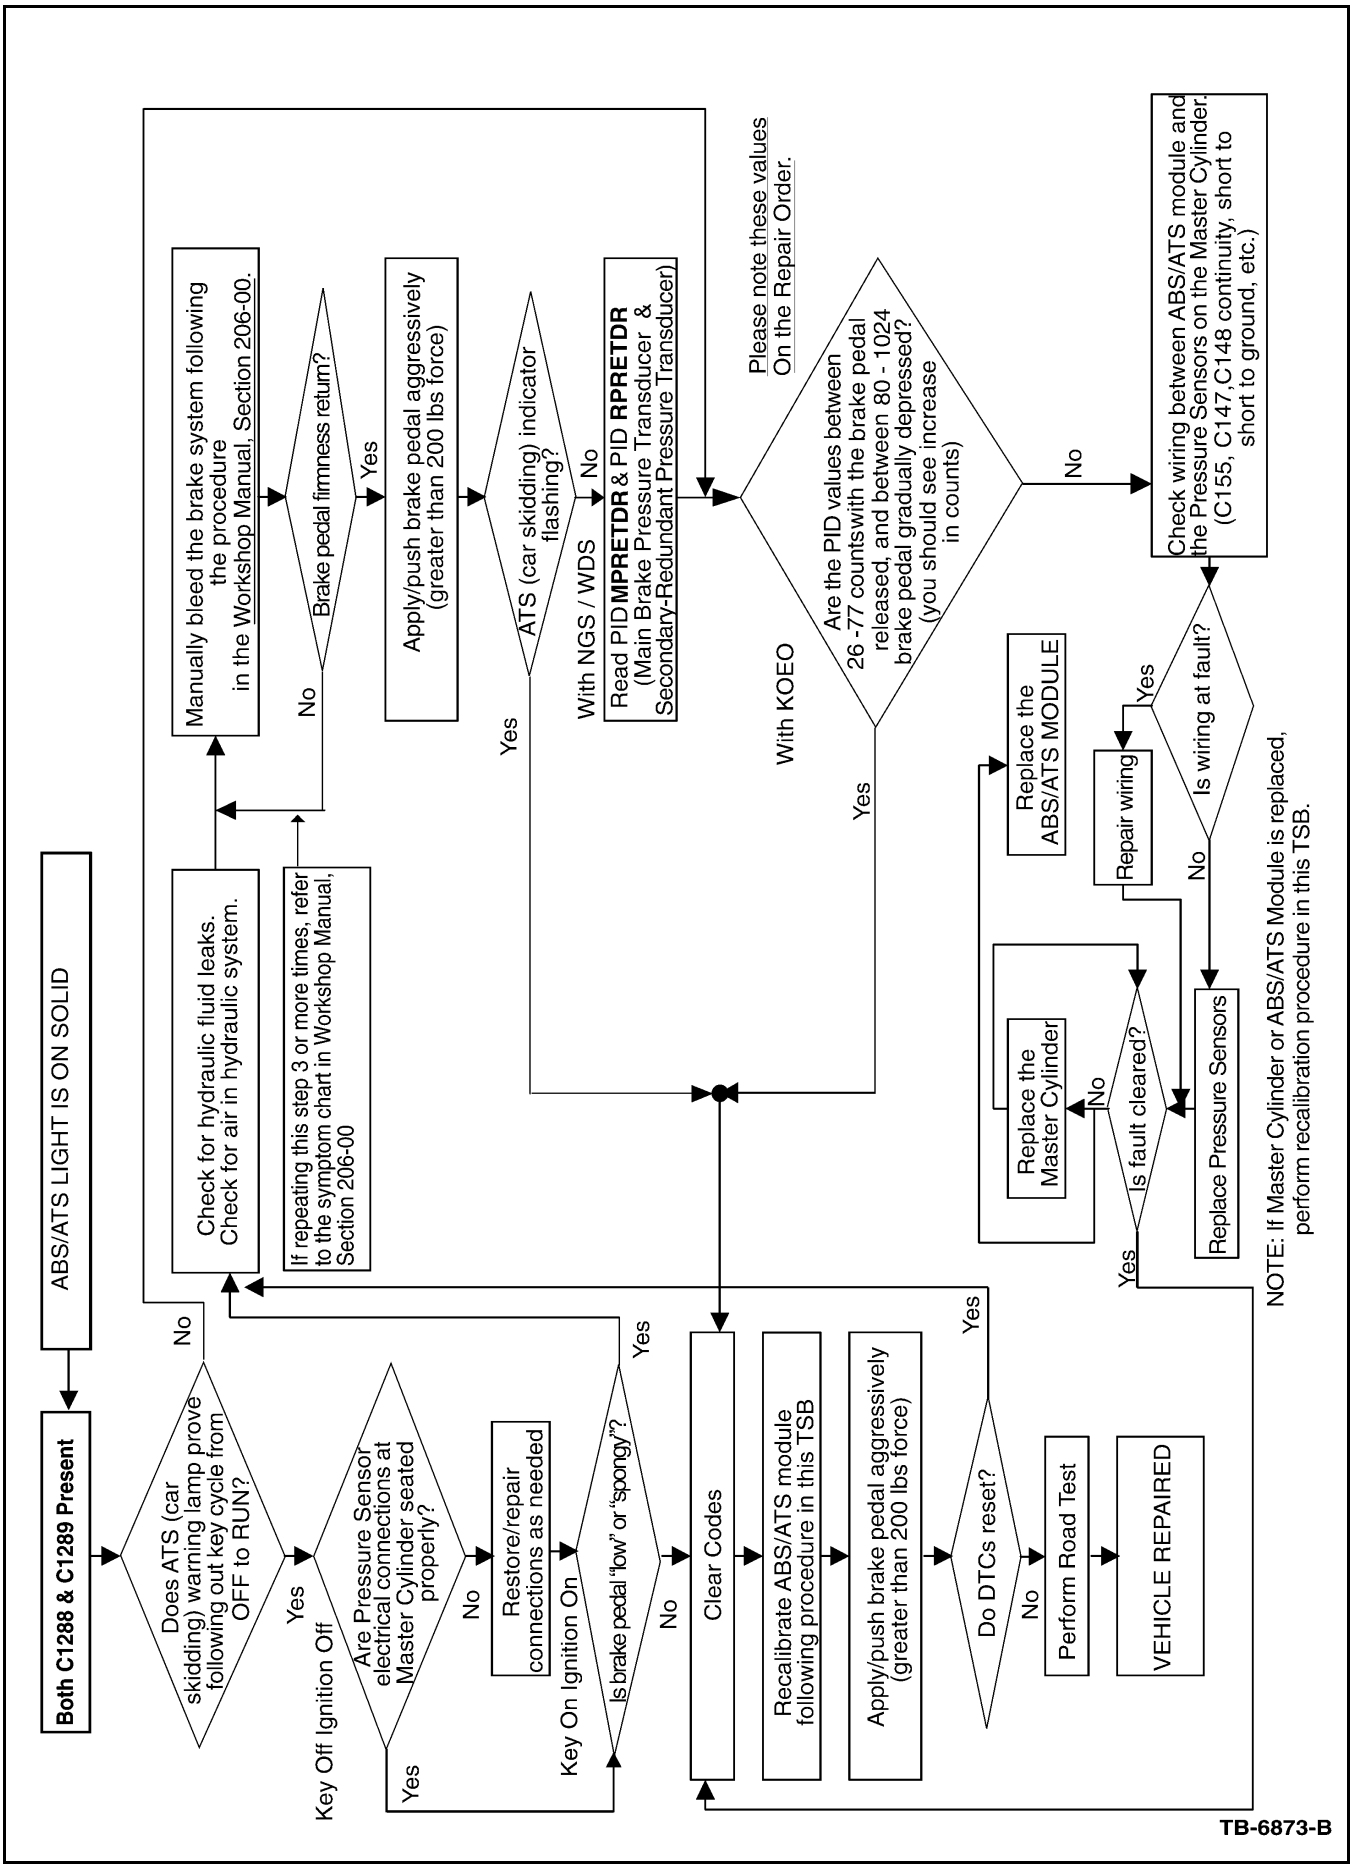


Figure 1 - Article 02-22-5

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by “do-it-yourselfers”. Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.