FOCUS SONY SUBWOOFER SPEAKER REPLACEMENT

AFFECTED VEHICLES: CERTAIN 2001 FOCUS SONY EDITION MODELS

OVERVIEW

This procedure will instruct you to check and restore the subwoofer connections at the back of the radio. Both RCA jacks may have been disconnected intentionally per an earlier OASIS/SSM message. After these connections are restored, the subwoofer speaker will be replaced with one of a higher wattage rating.

SERVICE PROCEDURE

1. Using two (2) pick tools or other suitable radio removal tools, remove the radio.
2. Check and if necessary, reconnect both RCA jacks at the back of the radio, then secure the jacks in the holder and reinstall the radio. See Figure 1.

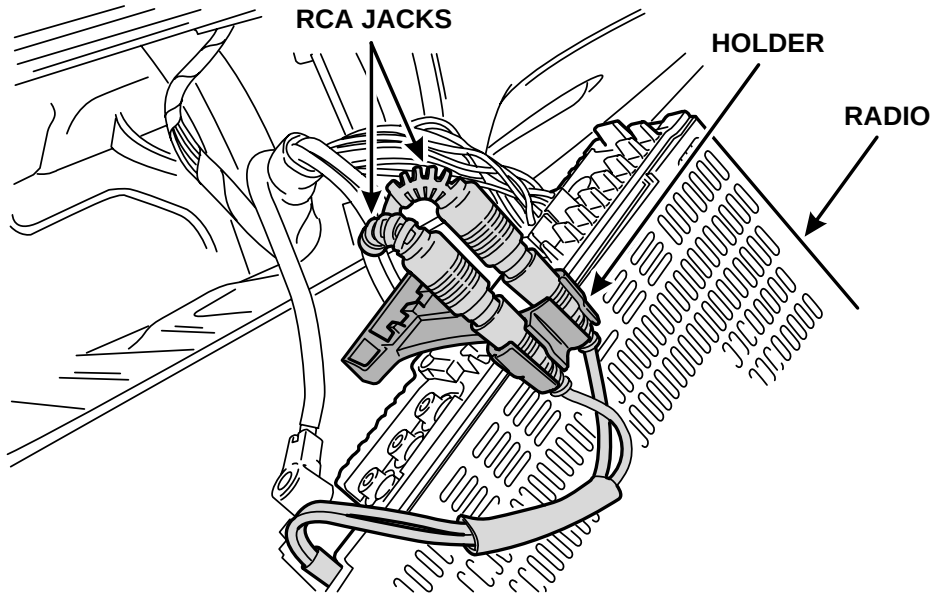


FIGURE 1

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
04/01

3. Open the decklid and pull out the speaker grille from the right side of the subwoofer cabinet.
4. Remove the eight (8) subwoofer speaker retainer screws, then disconnect and remove the speaker.

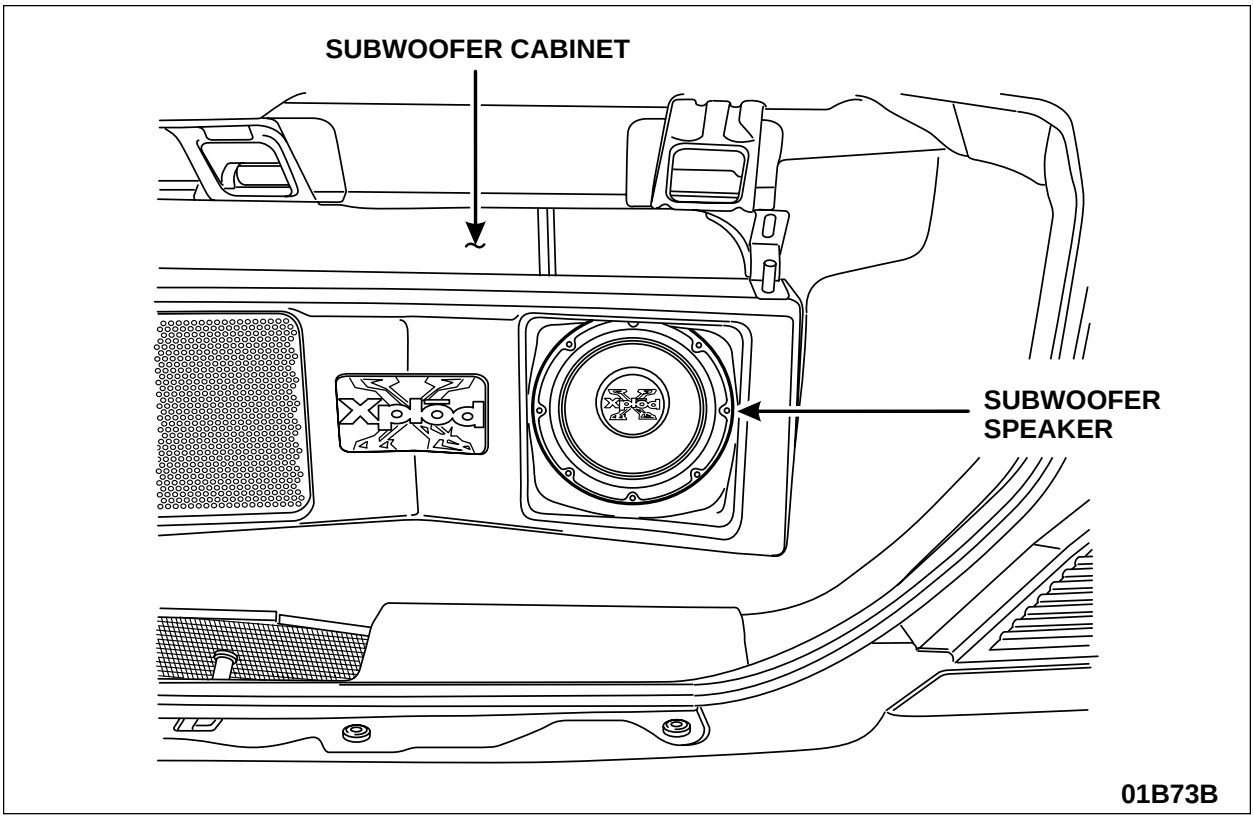


FIGURE 2

5. Connect the new subwoofer speaker matching the wire colors to the color coded connectors.
6. Reinstall the subwoofer speaker with the eight (8) retaining screws.
7. Reinstall the speaker grille then close the decklid.
8. Check radio and subwoofer operation.

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
04/01