| | |
|---|---|
| • **CLIMATE CONTROL—CLICKING NOISE FROM TEMPERATURE BLEND DOOR ACTUATOR—VEHICLES PRODUCED 11/13/2000 THROUGH 4/1/2001**<br>• **NOISE—CLICKING NOISE FROM CLIMATE CONTROL TEMPERATURE BLEND DOOR ACTUATOR—VEHICLES PRODUCED 11/13/2000 THROUGH 4/1/2001** | **Article No. 01-12-6** |

**FORD:** 2002 EXPLORER

**MERCURY:** 2002 MOUNTAINEER

## ISSUE

Some vehicles equipped with the manual A/C system may exhibit a continuous clicking noise from the blend door actuator when the blower speed is set at the #2 position and the temperature control knob is set between the 12:00 and 2:00 position. This may be caused by separate power sources to the blower motor & blend door actuator counteracting each other resulting in a clicking or fluttering noise.

## ACTION

Verify clicking or fluttering noise from the blend door actuator. If normal diagnostics cannot pinpoint the condition, perform the following wiring harness modifications. Refer to the following Service Procedure for details.

### SERVICE PROCEDURE

1. Locate junction box (fuse panel) under instrument panel driver side.
2. Remove 3 attaching screws from the junction box bracket. The junction box will drop down.
3. On the upper side of the junction box (relay locations), locate the 16-way green connector on the outboard side of the junction box (Figure 1).
4. Remove the green connector from the junction box.
5. Remove spacer from the engagement side of the connector.
6. Locate cavity 15 (gray/yellow wire), remove terminal from connector, and cut off terminal (Figure 2).
7. On the gray/yellow wire, strip the wire insulation away and prepare for a splice. This wire will be used later in the procedure.
8. Reinstall the spacer on the engagement end of the green connector and install connector in the junction box (Figure 1).
9. Locate the 10-way gray connector on the inboard side of the junction box (Figure 1).
10. Remove the gray connector from the junction box.
11. Locate cavity #2, light green/purple wire (Figure 2).
12. Center splice into this wire by spreading the insulation apart.
13. Locate the gray/yellow wire from Step 7.
14. Attach the gray/yellow wire to the light green/purple wire. Crimp a wire splice onto the two wires, solder the splice and cover with electrical tape.
15. Install the gray connector in to the junction box (Figure 1).
16. Reposition the junction box under the instrument panel and reinstall the 3 attaching screws. Torque to 2.4 ± 0.4 N•m (21 lb-in ± 3.5 lb-in.)
17. Verify proper functionality of the manual A/C system and that the clicking/fluttering noise condition has been corrected.

Copyright © 2001 Ford Motor Company

## Article No. 01-12-6 Cont'd.

**OTHER APPLICABLE ARTICLES:** NONE

**WARRANTY STATUS:** Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

| OPERATION | DESCRIPTION | TIME |
|---|---|---|
| 011206A | Perform Wiring Harness Modifications | 0.5 Hr. |

**DEALER CODING**

| BASIC PART NO. | CONDITION CODE |
|---|---|
| 14401 | 42 |

**OASIS CODES:** 208000, 208999, 702000, 702300

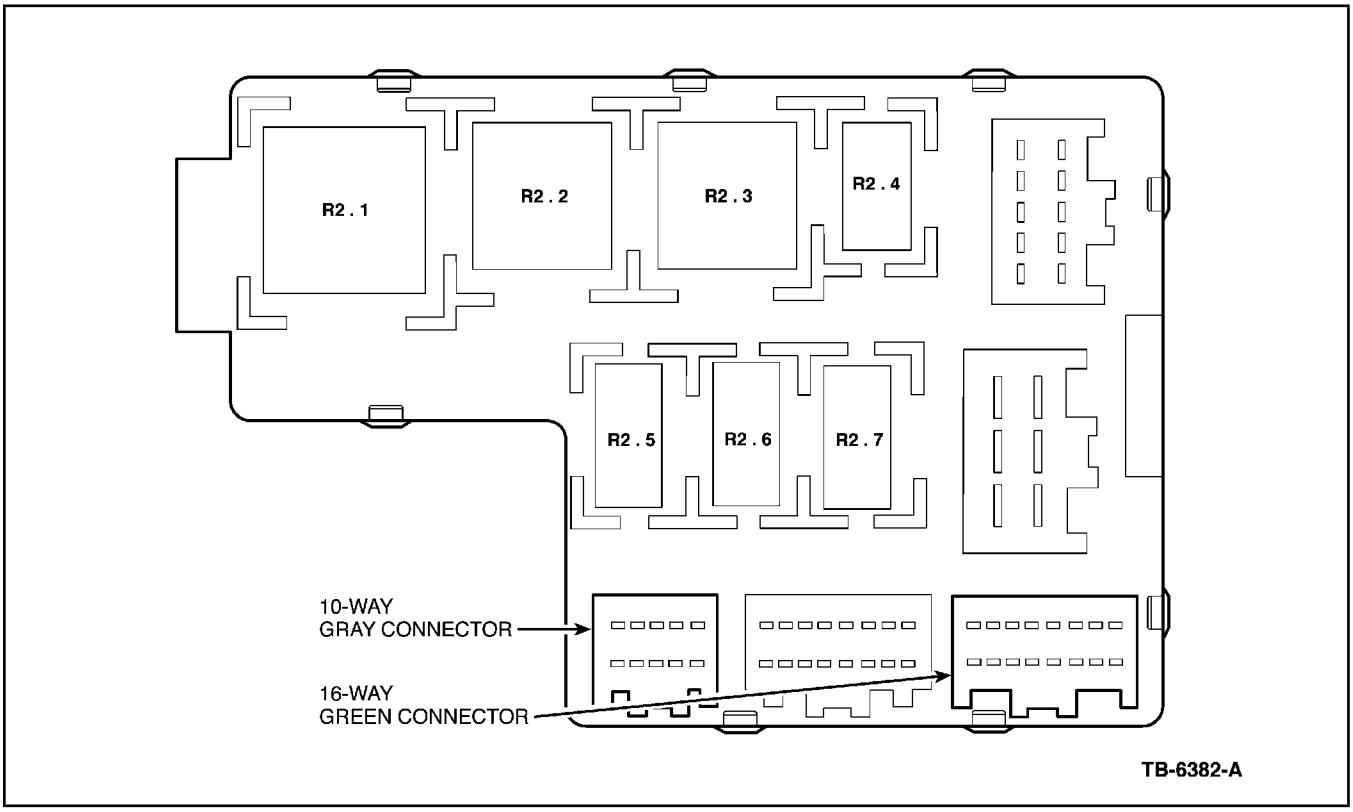


Figure 1 - Article 01-12-6

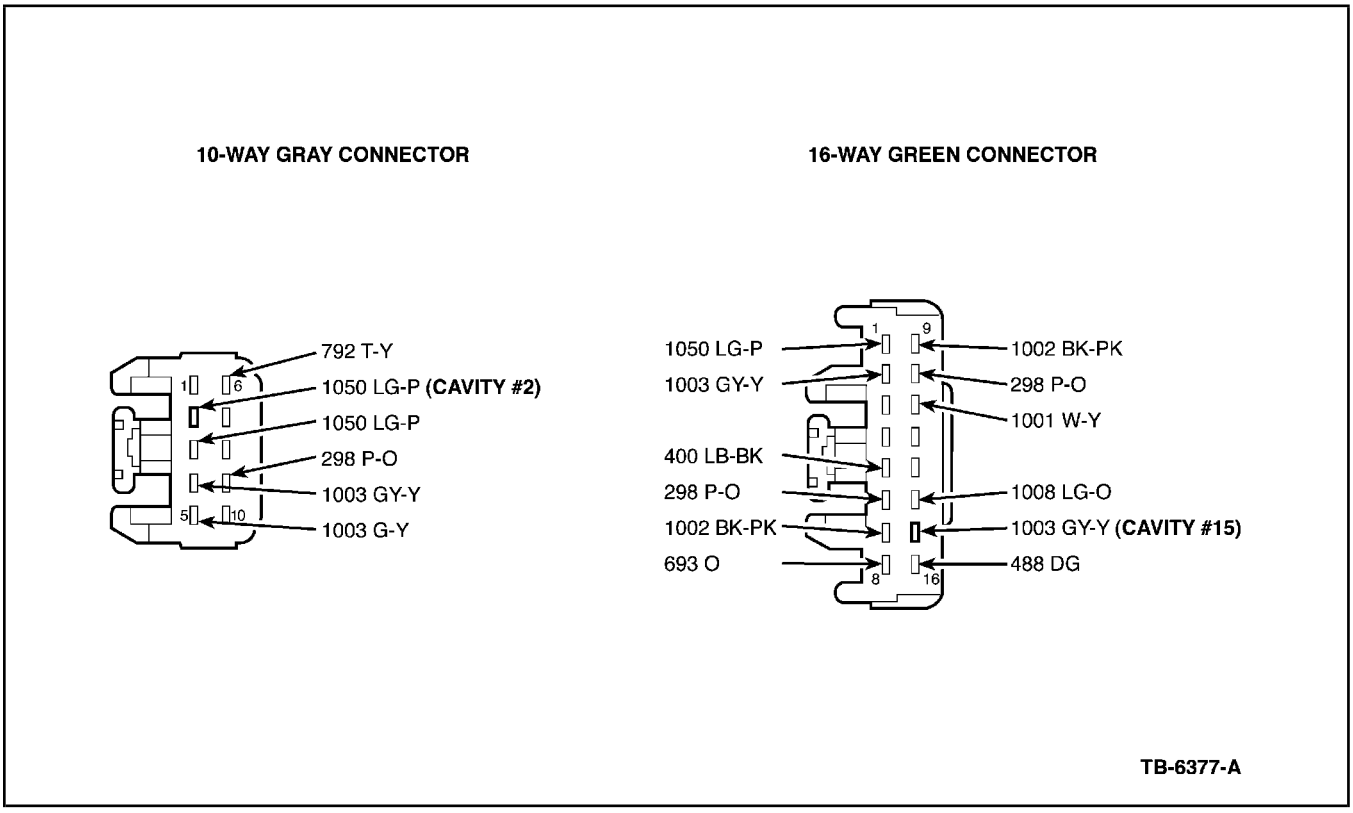


Figure 2 - Article 01-12-6