AIR CONDITIONING—LACK OF COOLING FROM DRIVER AND/OR PASSENGER SIDE VENTS—VEHICLES EQUIPPED WITH DUAL AUTOMATIC TEMPERATURE CONTROL (DATC) ONLY	Article No. 00-15-3

LINCOLN: 2000 LS

This TSB is being republished in its entirety to revise the Service Procedure.

ISSUE

There may be no A/C cooling from either the driver or passenger side vents on vehicles with Dual Automatic Temperature Control (DATC) on some vehicles. This may be caused by debris trapped in the coolant valve, a faulty coolant valve, a faulty DATC module, or faulty electrical circuits.

ACTION

Refer to the following Service Procedure to aid in diagnostics and repair.

NOTE

VERIFY CONCERN. IF NO A/C COOLING IS ON BOTH DRIVER AND PASSENGER SIDE VENTS, REFER TO THE 2000 LS WORKSHOP MANUAL TO VERIFY PROPER A/C OPERATION. IF NO A/C COOLING IS ONLY ON THE DRIVER OR PASSENGER SIDE VENTS, PROCEED WITH DIAGNOSTICS LISTED BELOW.

SERVICE PROCEDURE

1. Open the hood and remove the right side cowl cover to gain access to the heater hoses at the heater core inlets/outlet.
2. Clamp off the three (3) heater hoses going into and out of the heater core, as close to the heater core as possible (Figure 1).
3. Start engine and set the DATC to 15°C (60°F). If A/C cooling is restored, remove the clamps from the heater hoses and proceed to next step. If A/C cooling is not restored, concern is not caused by the coolant valve function/controls. Remove the clamps from the heater hoses, restore the vehicle to original condition and refer to the appropriate Workshop Manual diagnostics.

CAUTION

DO NOT SHORT THE ENGINE COMPARTMENT WIRING HARNESS CONNECTOR C134 PINS 3 OR 6 TO PINS 1 OR 4. DAMAGE TO THE DATC MODULE CAN RESULT IF THIS OCCURS.

4. Verify voltage to the coolant valve. Disconnect connector C134 (Figure 2). With the engine running and the DATC set to 15°C (60°F), measure the voltage between the engine compartment harness connector C134 Pin 4 (Figure 3) and ground. If voltage is less than 10 volts, repair circuit 30-FBs. If voltage is greater than 10 volts, proceed to Step 5.
5. Verify reference voltage. Measure the voltage between the auxiliary junction box fuse terminal F124 (30-KA23) and ground. If voltage is greater than 10 volts, proceed to Step 6. If voltage is less than 10 volts, repair circuit 30-KA23, and then proceed to Step 6.
6. Verify the first DATC ground circuit. With connector C134 disconnected, engine running and the DATC set to 15°C (60°F), measure the voltage between engine compartment harness C134 Pin 6 (Figure 3) and the auxiliary junction box fuse terminal F124 (circuit 30-KA23). If voltage is greater than 10 volts, proceed to Step 7. If voltage is less than 10 volts, inspect circuit 91S-FB4 for high resistance or an open circuit between connector C134 Pin 6 and connector C228b Pin 6 at the DATC module. Repair as required. If circuit 91S-FB4 is OK, install a new DATC module.
7. Verify the second DATC ground circuit. With connector C134 disconnected, engine running and the DATC set to 15°C (60°F), measure the voltage between engine compartment harness C134 Pin 3 (Figure 3) and the auxiliary junction box fuse terminal F124 (circuit 30-KA23). If voltage is greater than 10 volts, proceed to Step 8. If voltage is less than 10 volts, inspect circuit 91S-FB3 for high resistance or an open circuit between connector C134 Pin 3 and connector C228b Pin 5 at the DATC module. Repair as required. If circuit 91S-FB3 is OK, install a new DATC Module (XW4Z-19980-CA).

8. Attempt to flush the coolant control valve. Reconnect connector C134, and with engine running, DATC set to 32°C (90°F), run the engine at 2000 rpm for 5 minutes maximum. Set the DATC to 15°C (60°F) and check to see if A/C cooling has been restored. If not restored, with engine running and DATC set at 15°C (60°F), cycle the coolant valve by rapidly disconnecting and connecting in-line connector C134. This should clear the valve within a few minutes. If A/C cooling is still not restored, replace the Coolant Valve (XW4Z-18495-AA).

PART NUMBER	PART NAME
XW4Z-18495-AA	Coolant Valve
XW4Z-19980-CA	Dual Automatic Temperature Control (DATC) Module

NOTE

BE ADVISED THAT WHEN INSTALLING A NEW DATC MODULE ON VEHICLES BUILT BEFORE OCTOBER 1999, THE NEW DATC MODULE WILL HAVE A REVISED OPERATION STRATEGY THAT WILL NO LONGER MATCH THE OWNER'S GUIDE OPERATION DESCRIPTION. REFER TO TSB 00-8-8 FOR THE REVISED OPERATION DESCRIPTION.

OTHER APPLICABLE ARTICLES: 00-8-8
SUPERSEDES: 00-6-5
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
001503A	Replace Dual Automatic Temperature Control (DATC) Module	0.5 Hr.
001503B	Replace Coolant Valve (3.9L Engine)	2.1 Hrs.
001503C	Replace Coolant Valve (3.0L Engine)	1.7 Hrs.
001503D	Perform Coolant Flushing Procedure	0.3 Hr.
001503E	For Diagnostics, Use Actual Time Per The Warranty And Policy Manual	

DEALER CODING

BASIC PART NO.	CONDITION CODE
6010	49

OASIS CODES: 208000, 208200, 208999

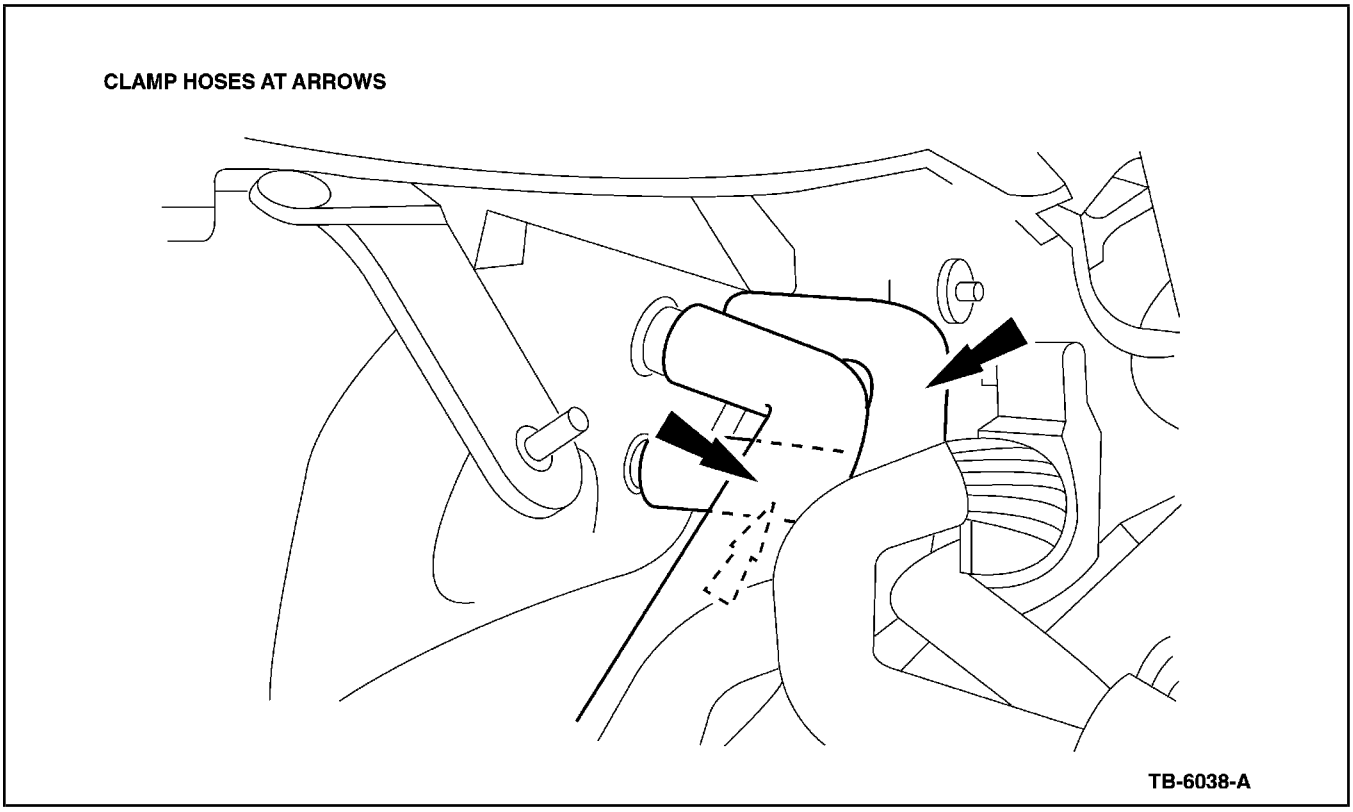

Figure 1 - Article 00-15-3

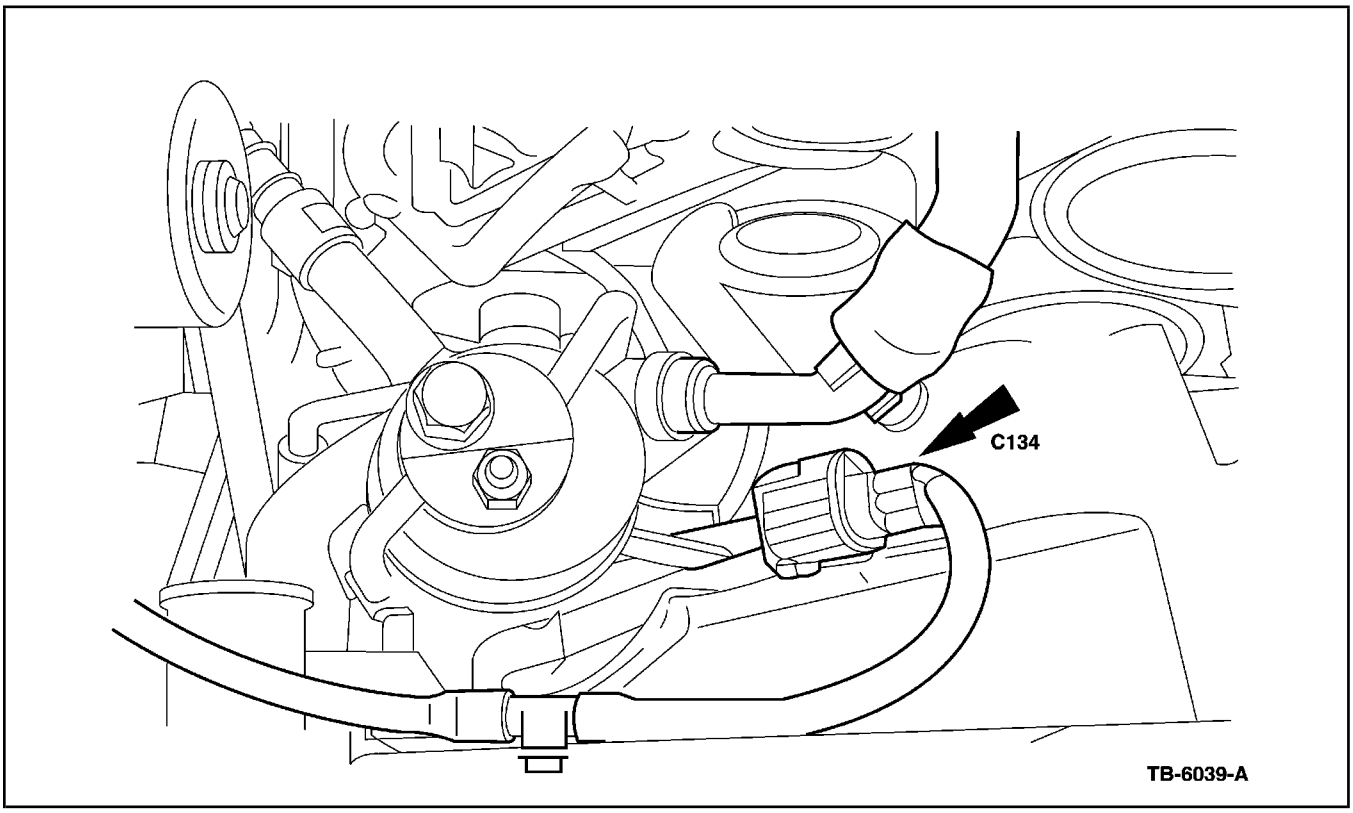

Figure 2 - Article 00-15-3

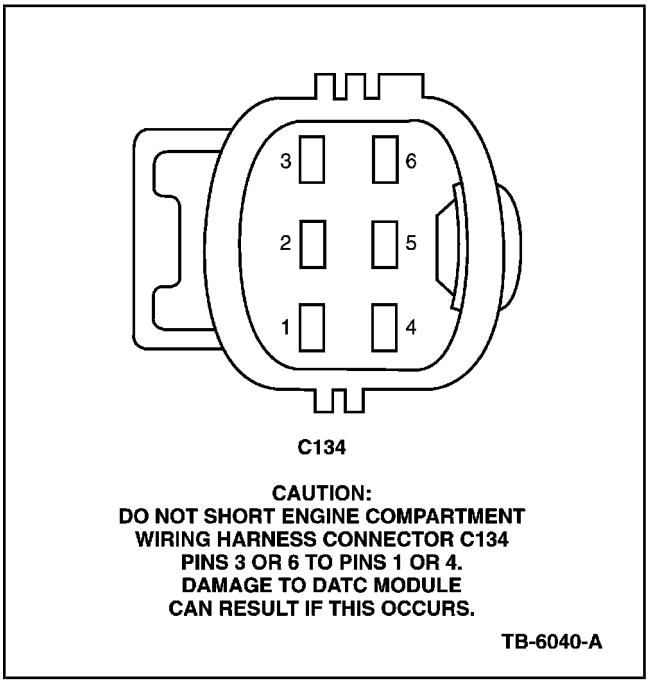

Figure 3 - Article 00-15-3