NOISE—SQUEAK/CREAK NOISE COMING FROM DOOR HINGE AREA	Article No. 02-7-4

FORD: 2000-2002 CROWN VICTORIA

MERCURY: 2000-2002 GRAND MARQUIS

ISSUE

Some vehicles may exhibit a squeak/creak noise coming from the left front or right front door hinge area. This may be caused by the door reinforcement tapping plate edges rubbing against the door reinforcement (Figure 1). This tapping plate may contact the door reinforcement bridge, located on the inside door, across from the hinge.

ACTION

Verify condition. Apply Ford Long Life Lubricating Grease, part number F5AZ-19G209-AA, on the hinges in the area specified. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Follow these steps to correct a squeak caused by the tapping plate:

1. Open the door.
2. Apply Ford Long Life Lubricating Grease (F5AZ-19G209-AA) on the hinges to the outside surface while the door is open.
3. Open and close the door several times. If the squeak/creak is still present:
4. Remove the door inner panel. Refer to Section 501-05 of the Crown Victoria/Grand Marquis Work Shop Manual.
5. Remove the speaker.
6. Reach inside and apply Ford Long Life Lubricating Grease (F5AZ-19G209-AA) on the top and bottom inside hinge reinforcements (sheet metal and tapping plate).
7. Re-install the door panel and speaker. Refer to Section 501-05 of the Crown Victoria/Grand Marquis Work Shop Manual.
8. Verify the repair.

PART NUMBER	PART NAME
F5AZ-19G209-AA	Ford Long Life Lubricating Grease

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
020704A	Lubricate One Front Door, Check Operation	0.2 Hr.
020704B	Lubricate Two Front Doors, Check Operation	0.3 Hr.
020704C	Lubricate One Front Door, Check Operation, Remove Door Trim Panel And Lubricate Inner Door Hinge	0.5 Hr.
020704D	Lubricate Both Front Doors, Check Operation, Remove Door Trim Panel And Lubricate Inner Door Hinges	0.8 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
5422810	91

OASIS CODES: 112000, 702000, 702100

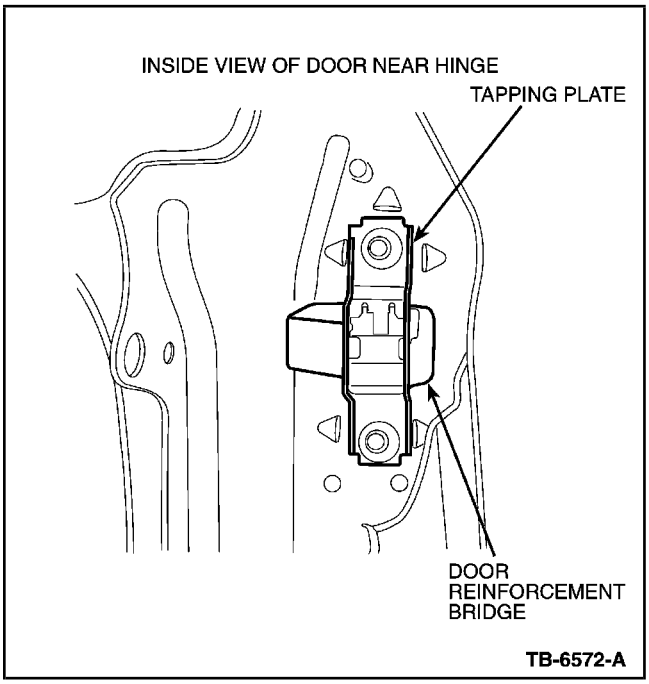


Figure 1 - Article 02-7-4

Copyright © 2002 Ford Motor Company