Ford Motor Company

A.R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

August 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Safety Recall 01S24: Certain 2000 and 2001 Model Year Cars and Trucks -- Wiper Motor Gear Cover Replacement

AFFECTED VEHICLES

Certain 2000 and 2001 model year:

- Focus vehicles built at:
  -- Wayne Assembly Plant from February 25, 2000 through August 15, 2000
  -- Hermosillo Assembly Plant from February 28, 2000 through July 25, 2000
- Taurus/Sable vehicles built at:
  -- Atlanta Assembly Plant from February 11, 2000 through July 31, 2000
  -- Chicago Assembly Plant from February 14, 2000 through August 4, 2000
- F-150 vehicles built at:
  -- Ontario Truck Plant from February 17, 2000 through August 3, 2000
  -- Norfolk Assembly Plant from February 21, 2000 through July 27, 2000
  -- Kansas City Assembly Plant from February 26, 2000 through September 4, 2000
  -- Cuautitlan Assembly Plant from March 3, 2000 through August 7, 2000
- F-250/350/450/550 vehicles built at:
  -- Cuautitlan Assembly Plant from February 25, 2000 through August 2, 2000
  -- Kentucky Truck Assembly Plant from February 18, 2000 through August 31, 2000
- Expedition and Navigator built at:
  -- Michigan Truck Plant from February 23, 2000 through August 3, 2000
- F-650/F750 Series vehicles built at:
  -- Cuautitlan Assembly Plant from February 25, 2000 through August 2, 2000
- Continental vehicles built at the Wixom Assembly Plant from March 9, 2000 through August 8, 2000
- Town Car vehicles built at the Wixom Assembly Plant from February 15, 2000 through July 20, 2000
- Excursion vehicles built at:
  -- Kentucky Truck Assembly Plant from February 18, 2000 through August 31, 2000

SAFETY CONCERN

In some of the affected vehicles the wiper motor park switch (located in the wiper motor) may malfunction and cause one of the following conditions:

- Loss of wiper intermittent or park function (low and high speeds still operate)
- Complete loss of all wiper function
- Complete or partial loss of wiper function, and the melting of the plastic wiper motor cover, potentially resulting in smoke and/or localized fire.

SERVICE ACTION

Dealers will inspect the wiper motor build date following instructions in Attachment III. If the wiper motor fails inspection, a new wiper motor gear cover assembly will be installed.

FORDSTAR BROADCAST

Ford Motor Company will be providing dealers with a special Fordstar Broadcast that explains this repair in detail. The broadcast will air three times per week, once per day, for four weeks, starting on August 16, 2001. Since the schedule is not published in the Star Guide, please refer to the on-line Campaign Connection Newsletter for specific broadcast times and dates.

PLEASE NOTE

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to $5,000 per vehicle.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……...……....1-800-423-8851
Other (Dealer Only) Recall Questions:……..……...1-800-325-5621

Sincerely,

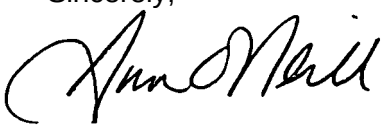

Ann O'Neill
Director
Vehicle Service and Programs

Safety Recall 01S24
Certain 2000 and 2001 Model Year Cars and Trucks
Wiper Motor Gear Cover Replacement

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer on-line Involved Unit Listings available on QCDealer.com. Also, correct other eligible vehicles which are brought to your dealership.

DEALER-OWNER CONTACT

Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

REGIONAL CONTACT

Advise regional office if an owner:

- cannot be contacted.
- does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

RENTAL CARS

Rental cars are not authorized for this program.

Safety Recall 01S24
Certain 2000 and 2001 Model Year Cars and Trucks
Wiper Motor Gear Cover Replacement

LABOR ALLOWANCES

Inspect for wiper motor build date code.	**Labor Operation**	**Labor Time**
Focus	01S24A	0.3 Hours
Taurus/Sable, and Continental	01S24K	0.4 Hours
F-150, Expedition and Navigator	01S24L	0.5 Hours
Town Car, Excursion, F-250 through F-550	01S24M	0.6 Hours
F-650 and F-750	01S24N	0.7 Hours

Replace wiper motor gear cover (includes inspection).	**Labor Operation**	**Labor Time**
Taurus/Sable and Continental	01S24B	0.6 Hours
Focus, F-150, Expedition and Navigator	01S24C	0.7 Hours
Town Car, Excursion, and F-250 through F-550	01S24D	0.8 Hours
F-650 and F-750	01S24E	0.9 Hours

Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour

Safety Recall 01S24
Certain 2000 and 2001 Model Year Cars and Trucks
Wiper Motor Gear Cover Replacement

PARTS REQUIREMENTS FOR ALL INVOLVED VEHICLES EXCEPT FOCUS

Parts Ordering Information

Parts will be seed stocked for this recall the week following the publication of this bulletin. Stock orders for initial quantities will be 18 to 72 pieces, based on dealer size. Order additional quantities of wiper motor covers after utilization of seed stock, through normal order processing channels as noted below:

Stock & Interim Orders	Effective immediately	Normal order process
Emergency Orders	First 30 days after launch	Call 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

Part Number	Description	Availability	Quantity
1F2Z-17D532-CA	Wiper Motor Gear Cover - All except Focus	ALL PDCs NOW	1

PARTS REQUIREMENTS FOR FOCUS

Parts Ordering Information

Parts will be seed stocked for this recall beginning September 14. Stock orders for initial quantities will be 2 to 10 pieces, based on dealer size. Order additional quantities of wiper motor covers after utilization of seed stock, through normal order processing channels as noted below:

Stock & Interim Orders	Effective 9/14/01	Normal order process
Emergency Orders	9/14/01 to 10/14/01	Call 1-800-325-5621
Emergency Orders	After 10/15/01	Normal order process

Part Number	Description	Availability	Quantity
XS4Z-17D532-BA	Wiper Motor Gear Cover - Focus vehicles	9-14-2001	1

ORDER INFORMATION

DOR/COR number 50253 identifies parts ordered for this campaign.

DEALER PRICE

For latest prices, refer to DOES II or your updated price book.

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

August 2001

01S24

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that a defect which relates to motor vehicle safety exists in certain 2000 and 2001 model year cars and trucks.

What the safety issue is …

In some of the affected vehicles the wiper motor park switch (located in the wiper motor) may malfunction and cause one of the following conditions:

- Loss of wiper intermittent park function (low and high speeds still operate)
- Complete loss of all wiper function
- Complete or partial loss of wiper function, and the melting of the plastic wiper motor cover, potentially resulting in smoke and/or localized fire.

What Ford Motor Company and your dealer will do …

Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer for replacement of the wiper motor cover assembly, if inspection of the wiper motor build date code determines that it was built within the suspect period.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.

What we are asking you to do …

Call your dealer without delay. Ask for a service date and whether parts are in stock for Safety Recall 01S24.

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

Important: Before repairs are made, you may reduce the likelihood for this condition to occur by not using the intermittent function of the wiper system, and by clearing the windshield (during winter months) of packed snow or ice.

If you've already paid for this service …

If you paid to have this service done before the date of this letter, Ford is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle …

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you still have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager for assistance. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

Call: (866) 436-7332

Office Hours: (Eastern Standard Time)

Monday-Friday:	8am - 11pm
Saturday:	9am - 6pm

Hearing impaired call (800) 232-5952
TDD for the hearing impaired.

Or you may contact us through the Internet at …

www.ownerconnection.com


If you are still having trouble getting your vehicle repaired and without charge, you may write to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline at 1-888-327-4236 or 1-800-424-9393.

Quality Care service is there for you all year long.

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,

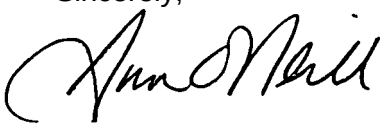

Ann O'Neill
Director
Vehicle Service and Programs