ELECTRICAL—HEAVY STATIC OR SIGNAL LOSS ON TWO WAY RADIO COMMUNICATION—BI-FUEL LPG VEHICLES ONLY

Article No. 02-21-5

FORD: 2001-2002 F-150

ISSUE

Some 2001-2002 Bi-Fuel F-150's may exhibit heavy static and possible loss of signal on customer installed two-way radios operating in the range of 47 MHz. Operation of HVAC blower motor and windshield wipers may increase severity of symptoms. This may be caused by the Compuvalve and Blower Motor Harness.

ACTION

Install a replacement Compuvalve and a replacement HVAC blower motor harness. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Replace the Compuvalve 2L3Z-9F954-AE. Refer to Section 303-04D in Workshop Manual.
2. Replace HVAC blower harness 3L3Z-18B574-AA (Figure 1).
   a. Remove connector from blower motor behind dash, right hand side of vehicle.
   b. Unplug the two connectors and remove short (8 inch) harness containing the blower connector.
   c. Install blower connector to blower motor.
   d. Reconnect remaining two connectors.

PART NUMBER	PART NAME
2L3Z-9F954-AE	Compuvalve
3L3Z-18B574-AA	HVAC Blower Harness

OTHER APPLICABLE ARTICLES: 01-10-6
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 203000, 203200, 207000

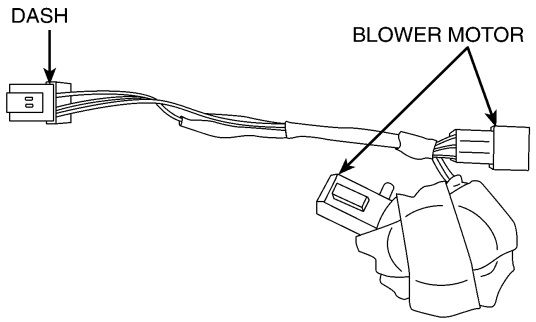

Figure 1 - Article 02-21-5

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Copyright © 2002 Ford Motor Company