TRIM—DIP IN CENTER OF INSTRUMENT PANEL	Article No. 02-1-7

FORD: 2001 ESCAPE

ISSUE

Some vehicles may exhibit a dip in the center of the Instrument Panel. This may be caused by the Instrument Panel having a low attachment point with the steel body bracket.

ACTION

To service the condition, add a spacer/washer to the body bracket center bolt to raise the Instrument Panel up at the center attachment. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Identify the dip condition (Figure 1).

1. Remove center attachment cover (Figure 2).
2. Remove center attachment bolt (Figure 3).
3. Remove radio (Figure 4).
4. Add/slide washer into place between the Instrument Panel and steel body bracket attachment (Figures 5 and 6). This will raise the instrument panel in the center.

NOTE

BASED ON SEVERITY OF I/P DIP, ADD SHIMS AS REQUIRED (NOT TO EXCEED 4MM). PART NUMBER 9995 20800 IS 1.6MM THICK WASHER AND 9995 10818 IS 2.3MM. THE WASHERS CAN BE COMBINED TO GET 3.9MM.

5. Once spacer/washer is in place, reinstall radio, secure center attachment bolt, and replace top instrument panel attachment cover. Verify dip condition is corrected (Figure 7).

PART NUMBER	PART NAME
9995 20800	Washer - 1.6 mm Thick - 3 Per Package
9995 10818	Washer - 2.3 mm Thick - 10 Per Package

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
020107A	Inspect And Install Spacer In Dash Center Support	0.4 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7804320	07

OASIS CODES: 107000

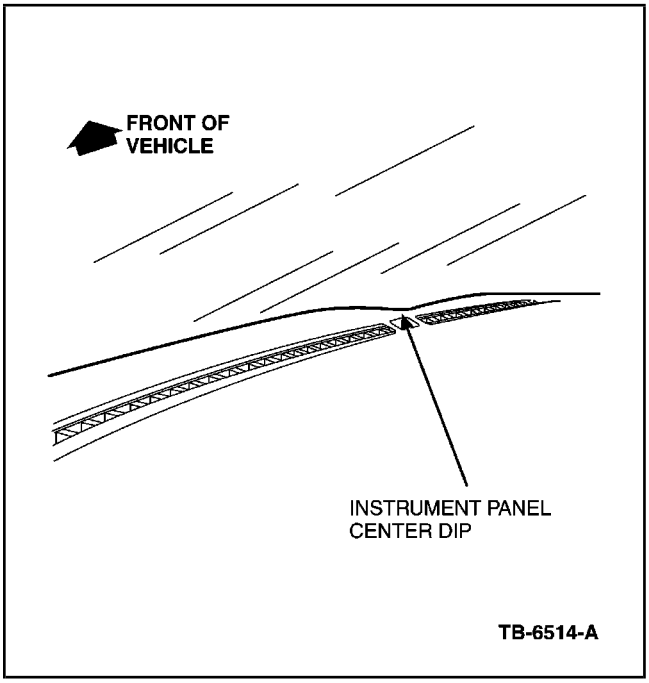

Figure 1 - Article 02-1-7

Copyright © 2002 Ford Motor Company

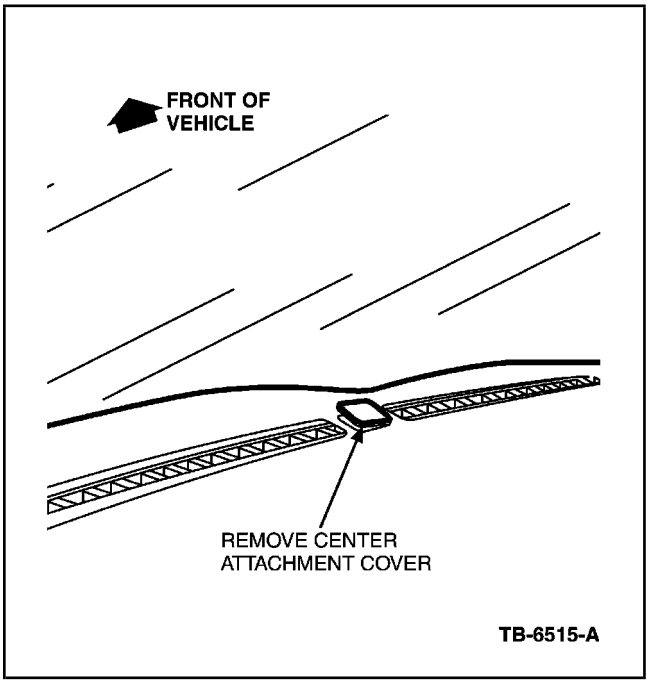

Figure 2 - Article 02-1-7

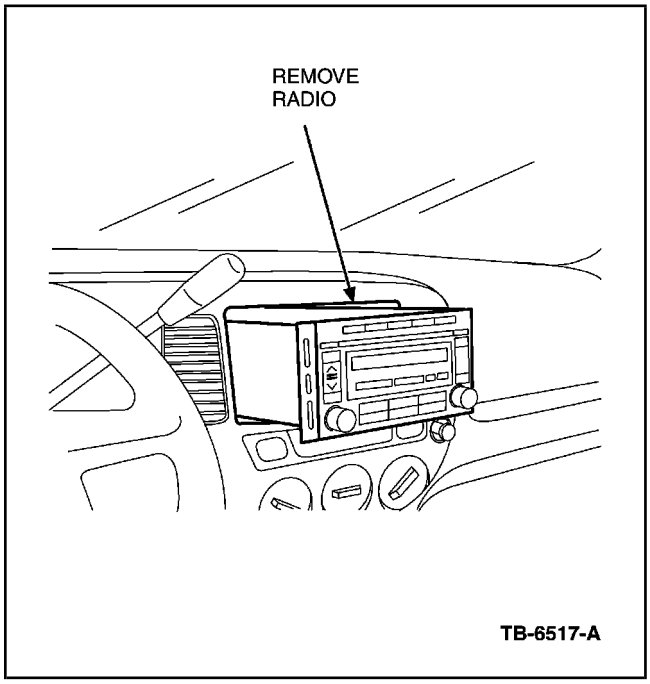

Figure 4 - Article 02-1-7

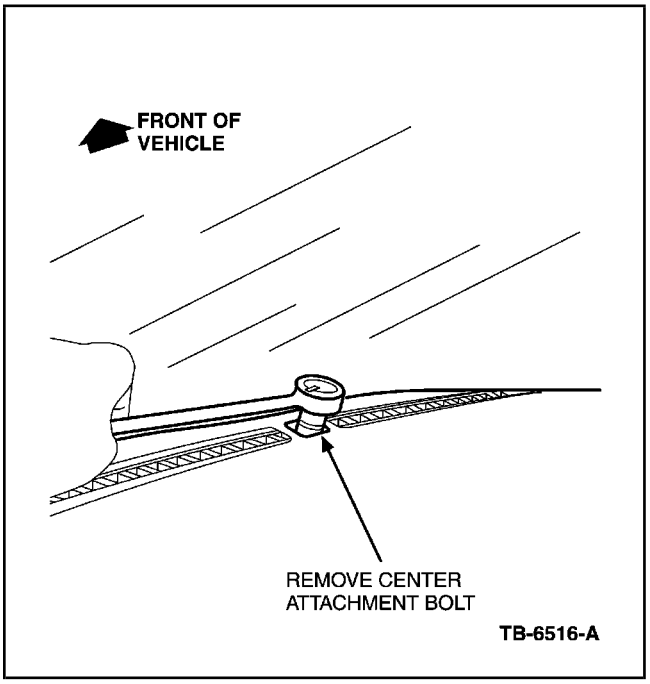

Figure 3 - Article 02-1-7

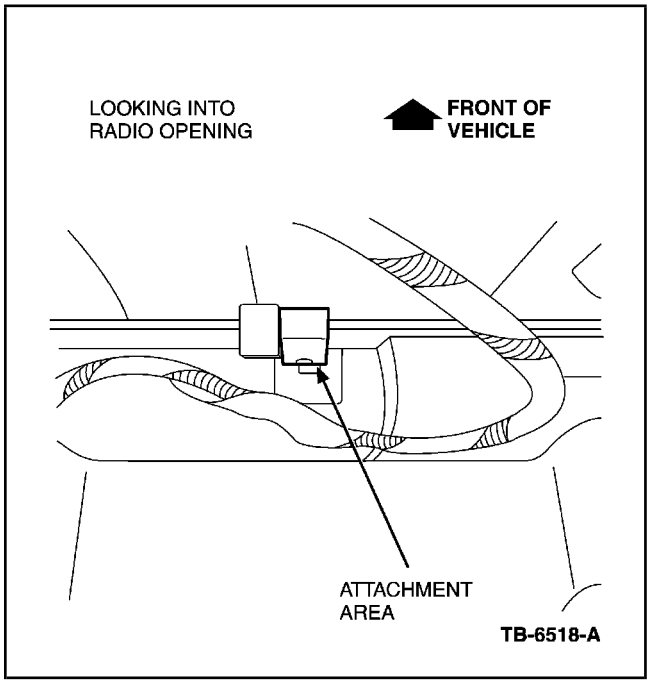

Figure 5 - Article 02-1-7

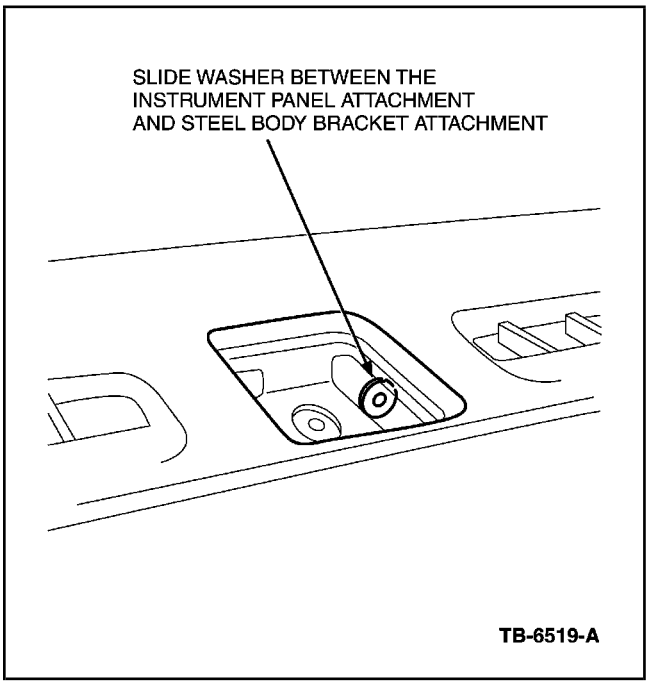

Figure 6 - Article 02-1-7

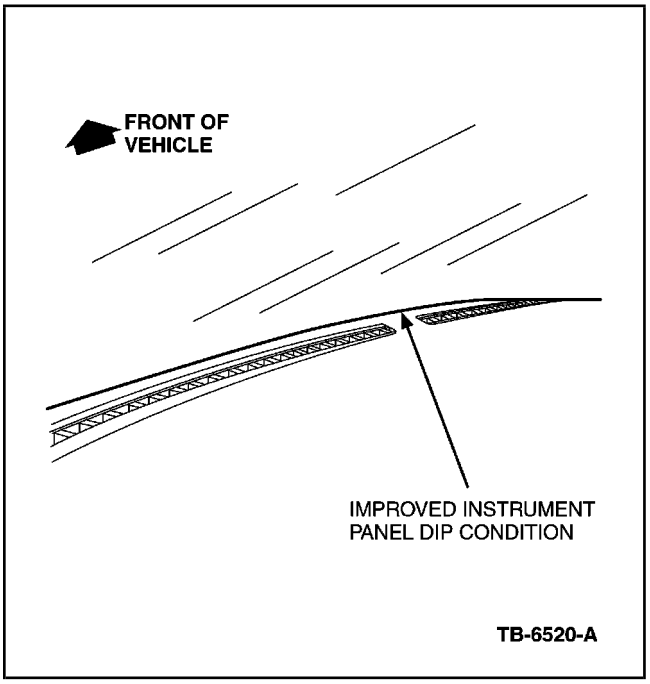

Figure 7 - Article 02-1-7