DRIVEABILITY—HESITATION ON ACCELERATION WHEN COLD—VEHICLES PRODUCED BEFORE 3/5/2001 EQUIPPED WITH 3.0L DURATEC ENGINE ONLY

Article No. 02-1-1

FORD: 2001 ESCAPE

ISSUE

Some vehicles built before 3/5/2001 equipped with a 3.0L Duratec engine may exhibit a hesitation on cold start drive away only between the ambient temperatures of 10-32°C (50-90 °F). This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify condition. If normal diagnostics cannot pinpoint the condition, reprogram the PCM to the latest level calibration. Refer to the following PCM Calibration Information chart.

SERVICE INFORMATION

Use the following chart to determine the latest level calibration needed for the vehicle.

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001 Escape 3.0L	1L8U-AC	ATF0	1U7Z-AXA	0M11A30511	0M11A30512	WDS Release B16.2 or Later
2001 Escape 3.0L	1L8U-FC	ESG0	1U7Z-AZA	0M11B30511	0M11B30512	WDS Release B16.2 or Later
2001 Escape 3.0L	1L8U-HC	SJA0	1U7Z-AYA	0M11C30511	0M11C30512	WDS Release B16.2 or Later
2001 Escape 3.0L	1L8U-DB	RIL0	1U7Z-BEA	0M11A30X10	0M11A30X11	WDS Release B16.2 or Later

THE FOLLOWING PCM'S CANNOT BE REPROGRAMMED AND MUST BE REPLACED WITH CORRECT LEVEL PART:

- YL8F-12A650-CA,CC,CD,CE = 1U7Z-12A650-AXA
- YL8F-12A650-ZA,ZB,ZC,ZD = 1U7Z-12A650-AYA
- YL8F-12A650-NA,NB,NC,ND = 1U7Z-12A650-AZA
- YL8F-12A650-XA,XB,XC = 1U7Z-12A650-BEA

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

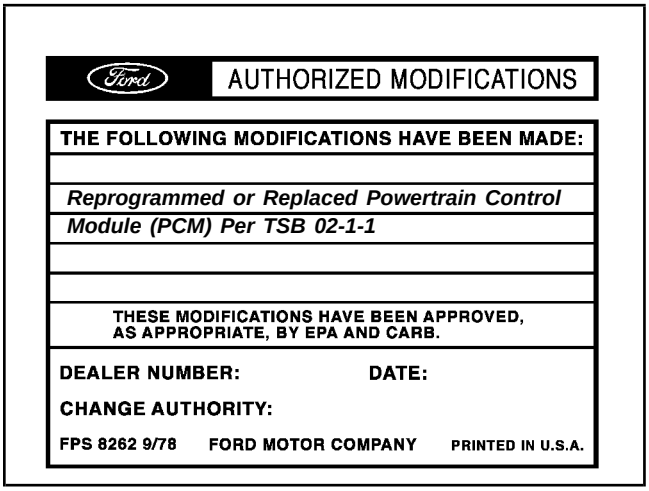

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 611000, 611500

Copyright © 2002 Ford Motor Company