TRANSMISSION—4R70W—NO FORWARD OR DELAYED ENGAGEMENT	Article No. 01-11-7

FORD: 2001 ECONOLINE, EXPEDITION, F-150

ISSUE

Some vehicles equipped with a 4R70W automatic transmission exhibiting a no forward or a delayed engagement may have a damaged forward clutch. This may be caused by rapid, Drive (D) to Reverse (R) engagements before the automatic transmission fluid reaches a normal operating temperatures and by Powertrain Control Module (PCM) calibration causing a lack of Forward Clutch pressure and insufficient lubrication.

ACTION

Verify forward clutch failure. In order to prevent reoccurrence, the (PCM) should be reprogrammed to the latest level calibration as part of the forward clutch repair procedure. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Follow normal diagnostic procedures and verify the condition.

1. If the condition is valid, first repair all diagnostic trouble codes (DTCs) that may be present
2. Then repair all internal transmission components as required.
3. Clear all DTCs and validate the repair.
4. Follow the procedures found in the Powertrain Control/ Emissions Diagnosis (PC/ED) Workshop Manual and reprogram the PCM to the latest level calibration. Refer to the following PCM Calibration Information chart.

Copyright © 2001 Ford Motor Company

Article No. 01-11-7 Cont'd.

PCM CALIBRATION INFORMATION						
Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001 F-150 4.2L	1L3F-DC	XAZ4	1L3Z-DE	1F512C0506	1F512C0511	WDS B12.13 Release or Later
2001 F-150 4.2L	1L3F-EC	1BR3	1L3Z-ED	1F512D0506	1F512D0510	WDS B12.13 Release or Later
2001 F-150 4.6L	1L3F-AVB	WIZ3	1L3Z-AVB	1F516M0A05	1F516M0A11	WDS B12.13 Release or Later
2001 F-150 4.6L	1L3F-AXB	YSC3	1L3Z-AXD	1F516N0A05	1F516N0A11	WDS B12.13 Release or Later
2001 F-150 4.6L	1L3F-KB	EME3	1L3Z-KD	1F516D0B05	1F516D0B11	WDS B12.13 Release or Later
2001 F-150 4.6L	1L3F-LB	XSX3	1L3Z-LD	1F516E0B05	1F516E0B11	WDS B12.13 Release or Later
2001 F-150 5.4L	1L3F-ASB	SVB2	1L3Z-ASC	1F514F0A05	1F514F0A10	WDS B12.13 Release or Later
2001 F-150 5.4L	1L3F-ARB	CML2	1L3Z-ARC	1F514E0B05	1F514E0B10	WDS B12.13 Release or Later
2001 Expedition 4.6L	1L1A-CA	HZS1	1L1Z-CBB	1B316D0505	1B316D0510	WDS B12.13 Release or Later
2001 Econoline 4.2L	1C2F-DC	HEA3	1C2Z-DD	1E412G0A06	1E412G0A10	WDS B12.13 Release or Later
2001 Econoline 4.2L	1C2F-EC	PZM3	1C2Z-ED	1E412H0B06	1E412H0B10	WDS B12.13 Release or Later
2001 Econoline 4.2L	1C2F-GC	WXI3	1C2Z-GD	1E412K0B06	1E412K0B10	WDS B12.13 Release or Later
2001 Econoline 4.2L	1C2F-FC	DZG3	1C2Z-FD	1E412J0B06	1E412J0B10	WDS B12.13 Release or Later
2001 Econoline 4.2L	1C2F-HC	EHA3	1C2Z-HD	1E412L0B06	1E412L0B10	WDS B12.13 Release or Later
2001 Econoline 4.6L	1C2F-JB	FQT2	1C2Z-JC	1E416D0A05	1E416D0A10	WDS B12.13 Release or Later
2001 Econoline 4.6L	1C2F-KB	RWW2	1C2Z-KC	1E416E0A05	1E416E0A10	WDS B12.13 Release or Later
2001 Econoline 5.4L	1C2F-LB	FQM2	1C2Z-LC	1E414E0505	1E414E0510	WDS B12.13 Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

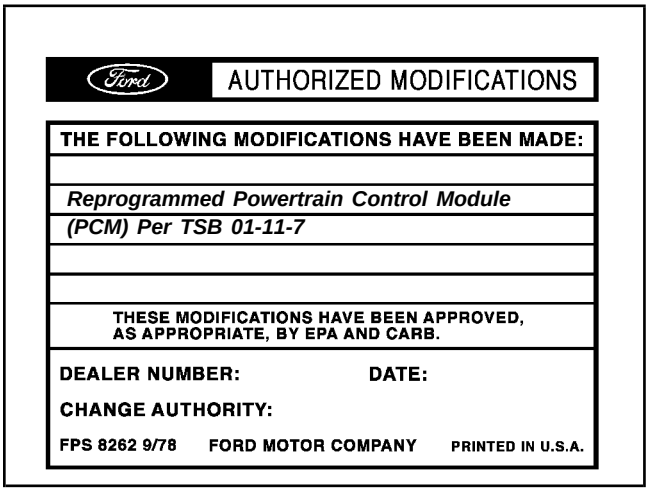

AUTHORIZED MODIFICATIONS

THE FOLLOWING MODIFICATIONS HAVE BEEN MADE:

Reprogrammed Powertrain Control Module (PCM) Per TSB 01-11-7

THESE MODIFICATIONS HAVE BEEN APPROVED, AS APPROPRIATE, BY EPA AND CARB.

DEALER NUMBER: DATE:

CHANGE AUTHORITY:

FPS 8262 9/78 FORD MOTOR COMPANY PRINTED IN U.S.A.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 501000, 502000, 503000