• **BRAKES—LONGER THAN EXPECTED PEDAL TRAVEL WITHOUT ADDITIONAL PEDAL EFFORT—VEHICLES BUILT FROM 3/1/1999 THROUGH 8/9/1999 AND WITH V-6 ENGINE** • **BRAKES—REDUCED POWER BRAKE ASSIST—DURING RAPID, REPEATED BRAKE APPLICATIONS—HIGH ALTITUDE OPERATION—VEHICLES BUILT FROM 3/1/1999 THROUGH 8/9/1999 AND WITH V-6 ENGINE**	**Article No. 99-23-3**

LINCOLN: 2000 LS

ISSUE

Customers may encounter one or both of the following:

- Reduced power brake assist during rapid, repeated brake applications when operating the vehicle at high altitudes
- Longer than expected brake pedal travel without additional pedal effort when the vehicle is stopped and engine is running.

These may be due to insufficient manifold vacuum volume under these conditions.

ACTION

Replace the brake supply vacuum manifold assembly with a revised assembly. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

REMOVAL OF MANIFOLD VACUUM SUPPLY ASSEMBLY

1. Remove the engine appearance cover and Vapor Management Valve (VMV) cover (located on the LH shock tower). The push pins that retain the engine cover and VMV cover can be released by depressing the center of the push pin until a “click” is heard.
2. Disconnect the vacuum line to the brake booster at the in-line connector. The vacuum line is located at the end of the convolute covering of the vacuum line.
3. Disconnect the vacuum line from the supply manifold assembly at the VMV black connector.
4. Disconnect the vacuum line from the supply manifold assembly-to-engine air inlet tube.
5. Disconnect the vacuum line from the engine throttle body. The vacuum line runs from the throttle body to the Y-connector of the supply manifold assembly.

INSTALLATION OF NEW MANIFOLD VACUUM SUPPLY ASSEMBLY (YW4Z-9C490-AB)

1. Connect the vacuum line to the brake booster in-line connector (Figure 1, View A).
2. Connect the vacuum line to the VMV (Figure 1, View B).
3. Connect the vacuum line to the air inlet tube (Figure 1, View E).
4. Route the vacuum line to the throttle body between the intake manifold runners and plenum and connect the vacuum line to the throttle body (Figure 1, View D and View F).
5. Insert the supply manifold assembly locator clip to the bracket on the engine (Figure 1, View C).
6. Verify that all vacuum lines are routed correctly and do not interfere with the throttle or speed control linkages.
7. Reinstall the engine appearance cover and VMV cover.

NOTE

TO INSERT THE PUSH PINS, PUSH THE CENTER OF THE PUSH PIN UP UNTIL THE CENTER OF THE PUSH PIN IS ABOVE THE PUSH PIN FLANGE. INSERT PUSH PIN IN ITS PROPER LOCATION AND LOCK BY PRESSING THE CENTER OF THE PUSH PIN FLUSH WITH THE PUSH PIN FLANGE.

Article No. 99-23-3 Cont'd.

PART NUMBER	PART NAME
YW4Z-9C490-AB	Manifold Vacuum Supply Assembly

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
992303A	Replace Brake Manifold Vacuum Supply Assembly (Includes Time To Road Test)	0.5 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9C490	42

OASIS CODES: 301000

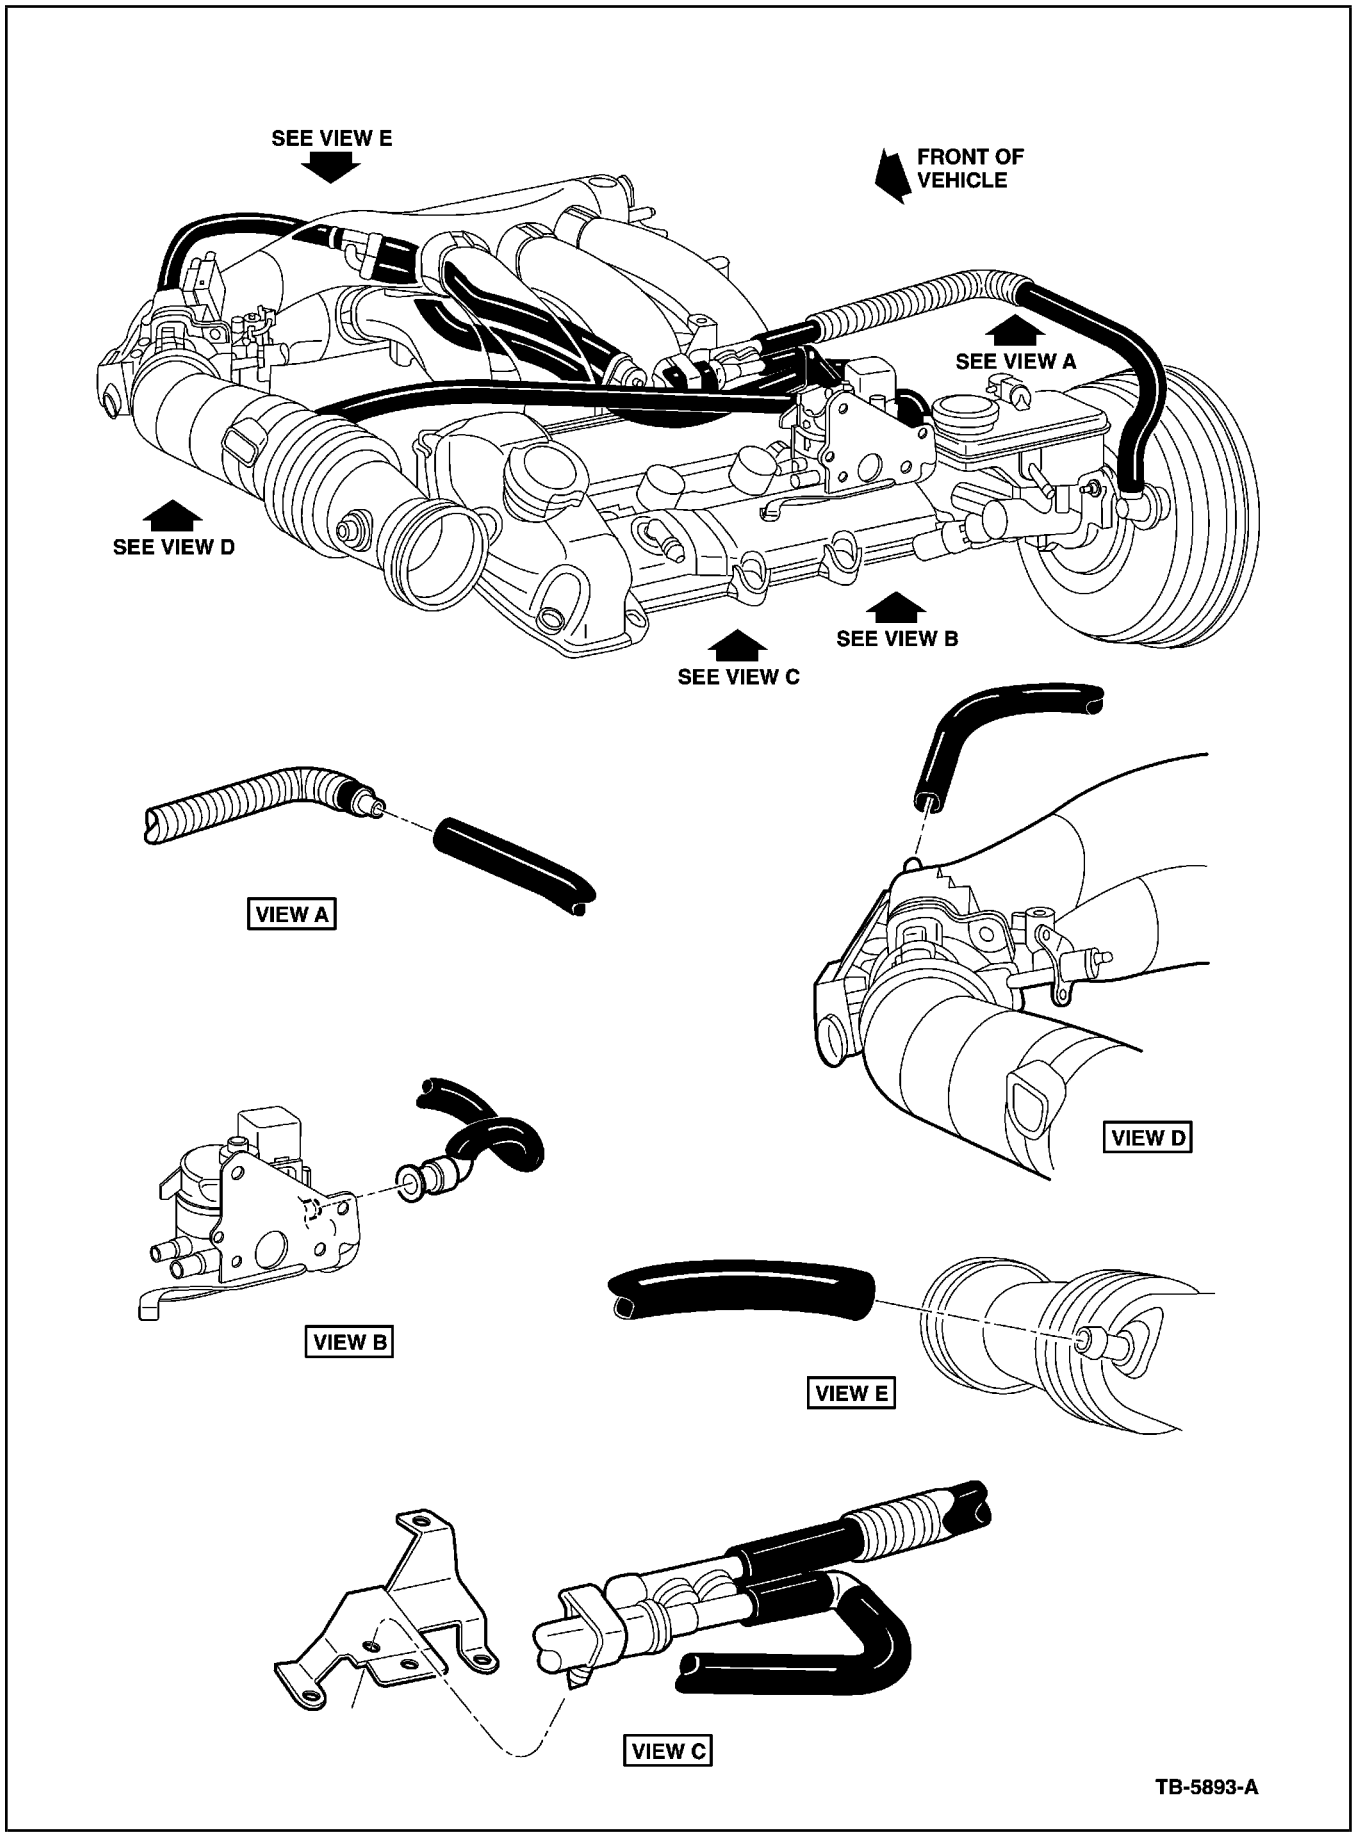

Figure 1 - Article 99-23-3