Ford Motor Company

A. R. O'Neill
Director
Vehicle Service and Programs
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

March 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Special Field Action 01L02: Certain 1999 through 2001 F-450, F-550 Super Duty, and F-Super Duty Stripped Chassis Trucks Equipped with 19.5-inch Commercial Truck Tires with Steel Cord Sidewalls – Owner's Guide Supplement and Information Labels

OASIS: No – Labels will be mailed directly to owners
OWNER LIST: No
PARTS RETURN: No
PROGRAM TERMS: This program will be in effect until September 30, 2001, regardless of mileage.

AFFECTED VEHICLES

The following vehicles are affected under this program:

- Certain 1999 through 2001 model year F-450 and F-550 trucks built at the Kentucky Truck Plant from the beginning of production for the 1999 model year through February 16, 2001
- Certain 1999 through 2001 model year F-450 and F-550 trucks built at the Cuautitlan Assembly Plant from the beginning of production for the 1999 model year through February 26, 2001
- Certain 1999 through 2000 model year F-Super Duty Stripped Chassis trucks built at the Industrias Metalicas de Monterrey, South America (IMMSA) Assembly Plant from beginning of production for the 1999 model year through the end of production 2000 model year
- Certain 2000 through 2001 model year F-Super Duty Stripped Chassis trucks built at the Detroit Chassis Assembly Plant from the beginning of production 2000 model year through February 16, 2001

REASON FOR THIS ACTION

To update the Owner's Guide for the affected vehicles with additional important information regarding the proper servicing and maintenance of 19.5-inch steel cord sidewall tires.

SERVICE ACTION

Owners of the affected vehicles will be sent either two (2) or three (3) labels; based on the build date of the vehicle. The labels include:

- Inflation Awareness Label
  - F-450 and F-550 built through August 14, 2000
  - F-Super Duty Stripped Chassis built through February 5, 2000
- Inflation Procedure Label
  - F-450 and F-550 built at Kentucky Truck Plant through February 16, 2001
  - F-450 and F-550 built at Cuautitlan Assembly Plant through February 26, 2001
  - F-Super Duty Stripped Chassis built at Detroit Chassis Assembly Plant through February 16, 2001
- Owner's Guide Supplement
  - F-450 and F-550 built at Kentucky Truck Assembly Plant through February 16, 2001
  - F-450 and F-550 built at Cuautitlan Assembly Plant through February 26, 2001
  - F-Super Duty Stripped Chassis built at Detroit Chassis Assembly Plant through February 16, 2001

On F-450 and F-550 trucks the Inflation Awareness Label will be installed on the drivers door to re-emphasize the importance of properly maintaining tire inflation pressure. The Inflation Procedure Label will be installed on the driver's side rocker panel in the door opening. The Owner's Guide Supplement Label, will be installed into the inside face of Owner's Guide cover page. The owner may install the labels themselves, or take the vehicle to a Ford or Lincoln Mercury dealership to have the labels installed (See Attachment III for Installation Instructions).

NOTE: Due to the wide variability in body configurations for F-Super Duty Stripped Chassis trucks, owners will be advised to install the Inflation Awareness Label and Inflation Procedure Label near the vehicle point of entry.

ADDITIONAL LABELS

To assist customers who prefer to have this service completed at the dealership and arrive without the label, please call the Recall Hotline at 1-800-325-5621 to obtain more labels.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……..1-800-423-8851
Other Recall Questions:……..1-800-325-5621

Sincerely,

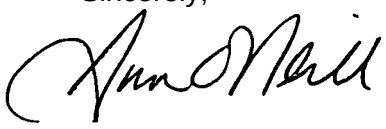

Ann O'Neill
Director
Vehicle Service and Programs

Special Field Action 01L02

Certain 1999 through 2001 F-450, F-550 Super Duty, and F-Super Duty Stripped Chassis Trucks Equipped with 19.5-inch Commercial Truck Tires with Steel Cord Sidewalls
Owner's Guide Supplement and Information Labels

OASIS

OASIS will not be activated for this program.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

An owner list will not be provided.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

Special Field Action 01L02
Certain 1999 through 2001 F-450, F-550 Super Duty, and F-Super Duty Stripped Chassis Trucks Equipped with 19.5-inch Commercial Truck Tires with Steel Cord Sidewalls
Owner's Guide Supplement and Information Labels

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Install (**3 Labels**) Inflation Awareness Label (if applicable), Inflation Procedure Label, and Owner's Guide Supplement Label to dealer in-stock units, or for customers (if requested)	01L02B	0.2 Hours
Install (**2 Labels**) Inflation Procedure Label, and Owner's Guide Supplement Label to dealer in-stock units, or for customers (if requested)	01L02C	0.2 Hours

PARTS REQUIREMENTS

Ordering Instructions for Additional Labels

The labels for this program are being sent directly to owners of the affected vehicles. Additional labels may be ordered by calling the Recall Hotline at 1-800-325-5621. Inform the operator you are calling in regard to Special Field Action 01L02. Be prepared to provide:

- Dealership P/A code
- Dealership address
- VIN number of the vehicle(s) that need labels

DEALER PRICE

Dealers will not be charged for the labels ordered under this program.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673

www.ownerconnection.com

March 2001

Your Vehicle Identification Number: 1234567890

01L02
Kit BB

Mr. John Sample:

As part of our emphasis on tire maintenance and safety, Ford Motor Company is providing additional important information regarding the proper servicing and maintenance of the original equipment 19.5-inch commercial truck tires with steel cord sidewalls installed on your vehicle.

Important Safety Information

The 19.5-inch steel cord sidewall tires equipped on your truck are made of an **all steel** radial construction, which operate at inflation pressures of up to 95 psi. As such, they are NOT light truck tires and must be serviced with the same safety considerations that are used with other medium/heavy truck all-steel radial tires. Personnel trained, supervised, and equipped according to OSHA Standard 29 CFR –1910.177, must perform tire service, including adjusting tire pressure. For example, during any procedure involving tire inflation, a technician or individual must use a remote inflation device, and keep all persons clear of the trajectory area.

What Ford Motor Company is asking you to do…

In order to provide you with this information we have included a total of three (3) labels to install on your vehicle. The labels are intended to increase your awareness of the unique safety and maintenance requirements specific to steel cord sidewall tires. We are asking that you install the enclosed labels using the illustrated instructions shown on the last page of this letter. The following labels are included:

- **Inflation Warning Label** – label describes the importance of maintaining inflation pressures on steel cord sidewall tires
- **Inflation Procedure Label** - illustrates the proper way to adjust tire inflation pressure on a steel cord sidewall tire
- **Owner's Guide Supplement Label** - provides a description of safety and maintenance information specific to the steel cord sidewall tires used on your vehicle

What *Ford Motor Company* and your dealer will do…

If you wish to have your dealer install the labels (free of charge); contact your dealer and ask for a service date to have Special Field Action 01L02 completed on your vehicle. Please bring this letter and the enclosed labels with you on your service date. If you misplace the labels before your service date, please contact your dealer in advance so they can order replacement labels for your vehicle.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns…

If you have questions or need assistance, please contact the Ford Motor Company North American Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: 8am - 11pm (Monday-Friday) ET
9am - 6pm (Saturday) ET

OR

You may contact us through the Internet at:
www.ownerconnection.com


Our current response time to Internet inquiries is three business days.

Quality Care service is there for you all year round.

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this notification, we stand committed with our Ford and Lincoln Mercury dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.


Sincerely,

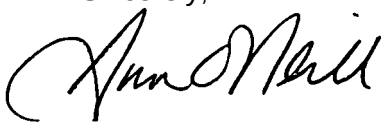

Ann O'Neill
Director
Vehicle Service and Programs

TIRE SERVICE WARNING LABEL INSTALLATION

NOTE: The illustration shown here represents F-450 and F-550 model vehicles. Due to the wide variety of body styles produced by different body manufacturers on the F-Super Duty Stripped Chassis frame, your vehicle may not be equipped with a driver side door as illustrated. On these vehicles, install the enclosed labels so they are visible at the vehicle point of entry.

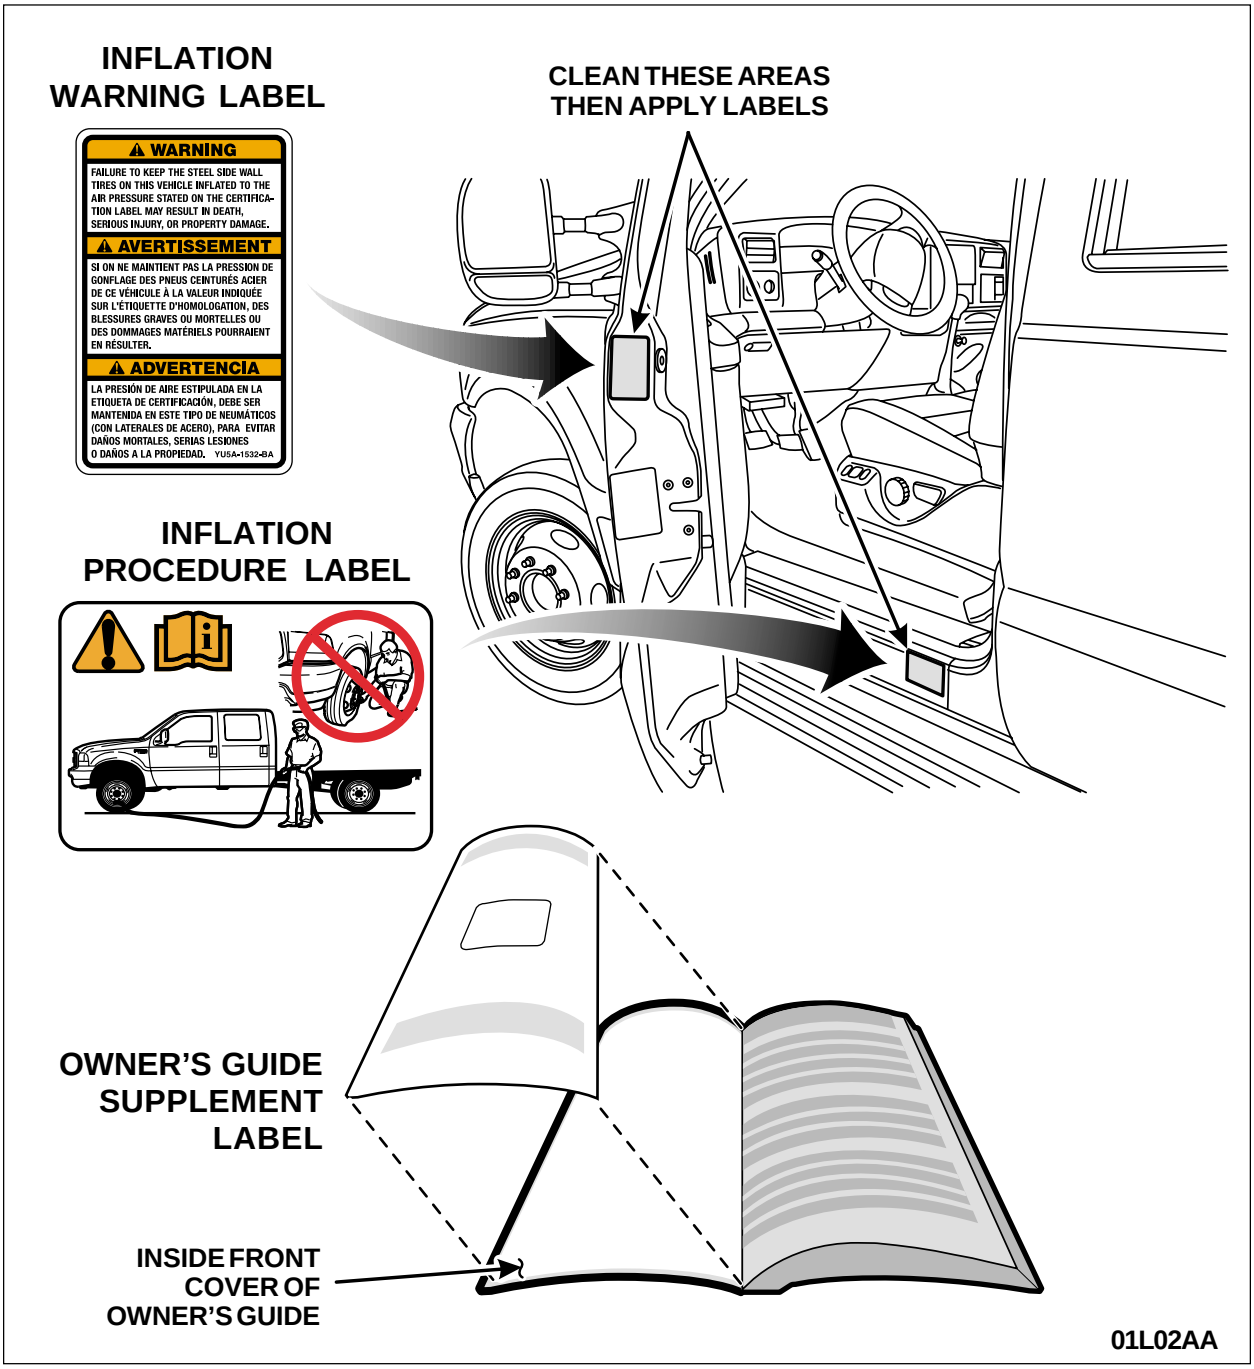

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
03/01

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
1-800-392-3673

www.ownerconnection.com

March 2001

Your Vehicle Identification Number: 1234567890

01L02
Kit DD

Mr. John Sample:

As part of our emphasis on tire maintenance and safety, Ford Motor Company is providing additional important information regarding the proper servicing and maintenance of the original equipment 19.5-inch commercial truck tires with steel cord sidewalls installed on your vehicle.

Important Safety Information

The 19.5-inch steel cord sidewall tires equipped on your truck are made of an **all steel** radial construction, and which operate at inflation pressures of up to 95 psi. As such, they are NOT light truck tires and must be serviced with the same safety considerations that are used with other medium/heavy truck all-steel radial tires. Personnel trained, supervised, and equipped according to OSHA Standard 29 CFR –1910.177, must perform tire service, including adjusting tire pressure. For example, during any procedure involving tire inflation, a technician or individual must use a remote inflation device, and keep all persons clear of the trajectory area.

What Ford Motor Company is asking you to do…

In order to provide you with this information we have included two (2) labels to install on your vehicle. The labels are intended to increase your awareness of the unique safety and maintenance requirements specific to steel cord sidewall tires. We are asking that you install the enclosed labels using the illustrated instructions shown on the last page of this letter. The following labels are included:

- **Inflation Procedure Label** - illustrates the proper way to adjust tire inflation pressure on a steel cord sidewall tire
- **Owner's Guide Supplement Label** - provides a description of safety and maintenance information specific to the steel cord sidewall tires used on your vehicle

What *Ford Motor Company* and your dealer will do…

If you wish to have your dealer install the labels (free of charge); contact your dealer and ask for a service date to have Special Field Action 01L02 completed on your vehicle. Please bring this letter and the enclosed labels with you on your service date. If you misplace the labels before your service date, please contact your dealer in advance so they can order replacement labels for your vehicle.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns…

If you have questions or need assistance, please contact the Ford Motor Company North American Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: 8am - 11pm (Monday-Friday) ET
9am - 6pm (Saturday) ET

OR

You may contact us through the Internet at:
www.ownerconnection.com


Our current response time to Internet inquiries is three business days.

Quality Care service is there for you all year round.

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this notification, we stand committed with our Ford and Lincoln Mercury dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.


Sincerely,

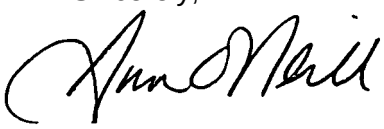

Ann O'Neill
Director
Vehicle Service and Programs

TIRE SERVICE WARNING LABEL INSTALLATION

NOTE: The illustration shown here represents F-450 and F-550 model vehicles. Due to the wide variety of body styles produced by different body manufacturers on the F-Super Duty Stripped Chassis frame, your vehicle may not be equipped with a driver side door as illustrated. On these vehicles, install the enclosed labels so they are visible at the vehicle point of entry.

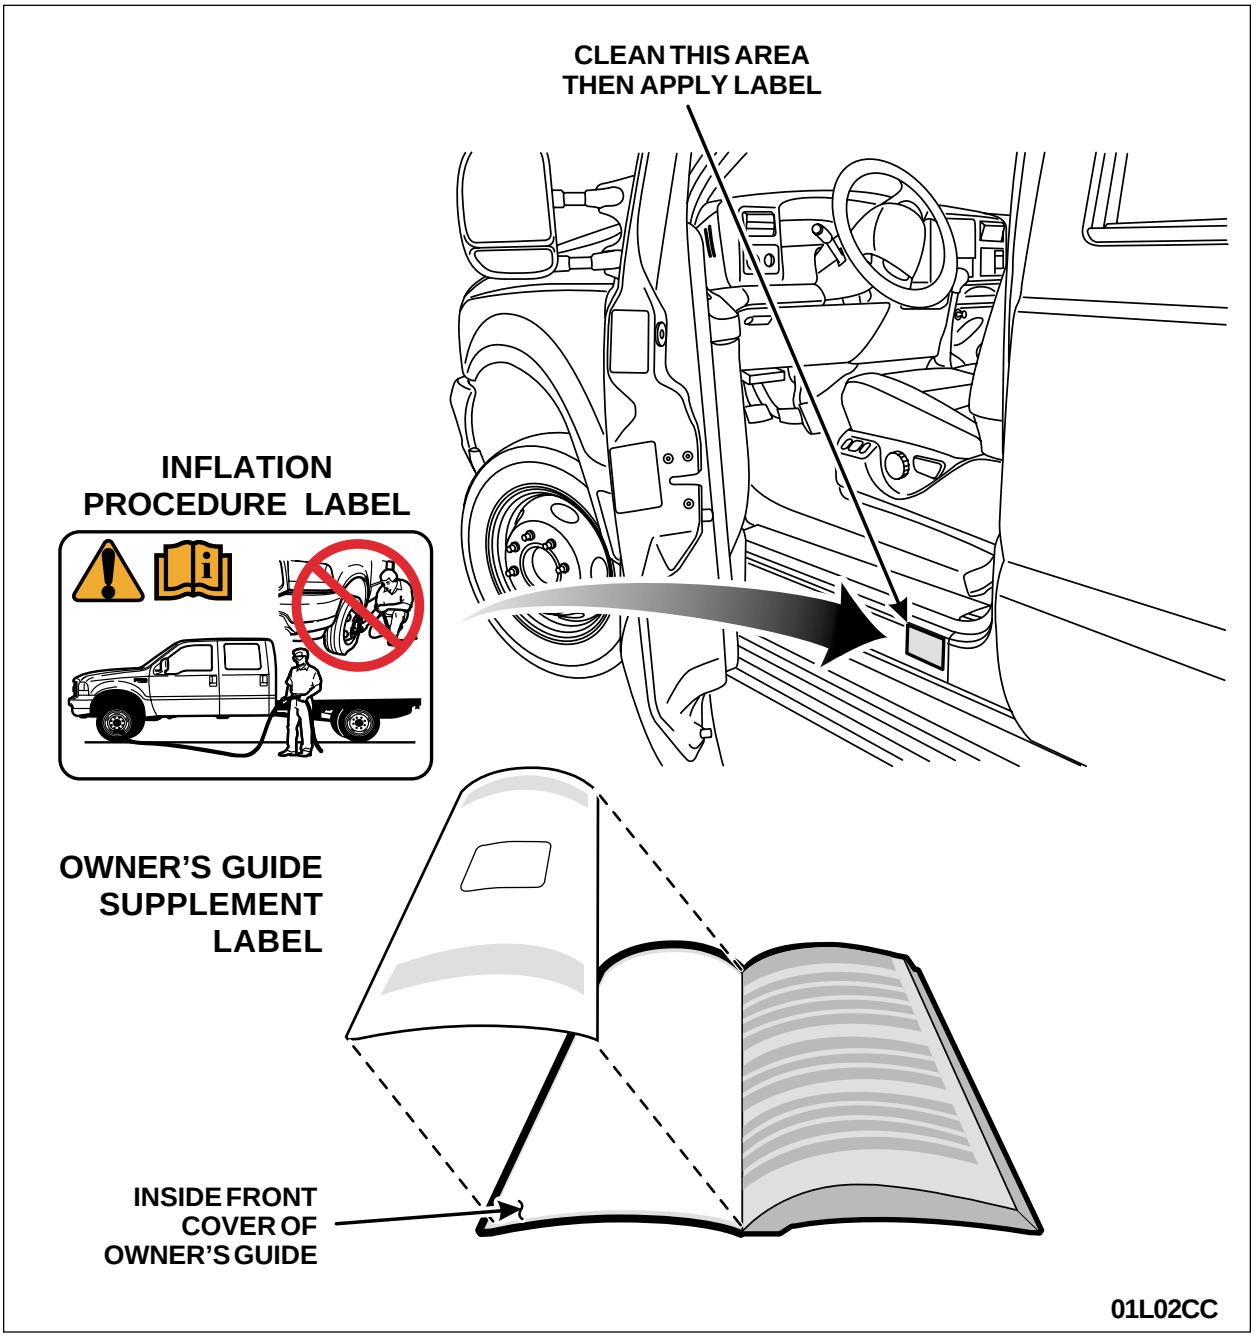

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
03/01